

Facility: **WOMENS INFANTS & CHILDREN**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 HARRIS ST.

Year to be Completed: **FY 22-23**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Reach Range						
2820	<ul style="list-style-type: none"> As-Built Description: Reach height to control or access point, where only forward approach is available, exceeds 48" or is less than 15". As-Built: PTD: 51" Proposed Solution: Modify equipment or mounting. 	PCODE IE01 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 1118B.5 CBC 2013 11B-308.2.1 Priority 3 Severity 4 FY 22-23 Maintenance Work	1	JOB	\$100	\$100



Total Costs for	Part/floor: Interior	Ground Floor	\$2,175.00
------------------------	-----------------------------	---------------------	-------------------

Facility: **WOMENS INFANTS & CHILDREN**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 HARRIS ST.

Year to be Completed: **FY 22-23**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$2,175.00

Facility: **WOMENS INFANTS & CHILDREN**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 HARRIS ST.

Year to be Completed: **FY 22-23**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: WOMENS INFANTS & CHILDREN					\$2,175.00
------------------------	--	--	--	--	--	-------------------

Facility: **LEMORE HEALTH CLINIC**
 Address: 229 C ST.

Area: **Interior**
 Year to be Completed: **FY 22-23**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 Lobby Restroom - Women's

Accessories

4399	<ul style="list-style-type: none"> <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 48" (CA only: 40") from floor to highest operating slot or control. <i>As-Built:</i> SCD: 47" <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 4.23.7 ADA 2010 308.2.1 CBC 2010 1115B.8.3 CBC 2013 11B-603.5 Priority 3 Severity 3 FY 22-23 Maintenance Work	1	JOB	\$100	\$100
------	--	--	---	-----	-------	-------




Door Closer

4388	<ul style="list-style-type: none"> <i>As-Built Description:</i> Excessive force required to open door. <i>As-Built:</i> 14 lbs <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 3 Severity 3 FY 22-23 Maintenance Work	1	JOB	\$25	\$25
------	---	--	---	-----	------	------



Door Stopper


4387	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 3 Severity 3 FY 22-23 Maintenance Work	1	JOB	\$25	\$25
------	---	---	---	-----	------	------

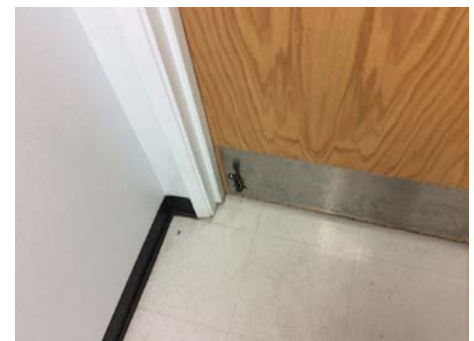



Facility: **LEMORE HEALTH CLINIC**
 Address: 229 C ST.

Area: **Interior**
 Year to be Completed: **FY 22-23**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Swing</u>						
4389	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". <i>As-Built:</i> 53" to partition <i>Proposed Solution:</i> Provide power door operator. 	PCODE ID23C ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 3 Severity 3 FY 22-23 Maintenance Work	1	JOB	\$5,000	\$5,000
						




<u>Grab Bars</u>						
4397	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessories/dispensers in accessible stall located closer than 1-1/2" below or 12" above grab bar impedes its use. <i>As-Built:</i> 0.5" <i>Proposed Solution:</i> Relocate accessories/dispensers to be no closer than 1-1/2" below and 12" above grab bars (except if accessories are recessed, flush with wall, and have no sharp edges). 	PCODE WB07I ADAAG 4.26.2 ADA 2010 609.3 CBC 2010 1133B.4.2.5 CBC 2013 11B-609.3 Priority 3 Severity 4 FY 22-23 Maintenance Work	1	JOB	\$75	\$75
						

<u>Operating Hardware</u>						
4393	<ul style="list-style-type: none"> <i>As-Built Description:</i> Fire extinguisher cabinet does not have accessible hardware. <i>Proposed Solution:</i> Provide accessible pull / latch (touch latches or U-pulls). <i>Notes:</i> 36" to rim when down 	PCODE ID07ANT ADAAG 4.25.4 ADA 2010 309.4 CBC 2010 1125B.4 CBC 2013 11B-309.4 Priority 3 Severity 3 FY 22-23 Maintenance Work	1	JOB	\$50	\$50
						

Facility: **LEMORE HEALTH CLINIC**
 Address: 229 C ST.

Area: **Interior**
 Year to be Completed: **FY 22-23**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
4386	<ul style="list-style-type: none"> <i>As-Built Description:</i> Entrance to wheelchair accessible toilet or bathing facility not identified with the International Symbol of Accessibility when not all are accessible. <i>Proposed Solution:</i> Provide sanitary facility sign that shows the international symbol. 	PCODE SA11 ADAAG 4.1.2(7)(d) ADA 2010 216.8 CBC 2010 1117B.5.8.1.2 CBC 2013 11B-216.8 Priority 3 Severity 3 FY 22-23 Maintenance Work	1	JOB	\$90	\$90
						
4385	<ul style="list-style-type: none"> <i>As-Built Description:</i> Entrance to toilet or bathing facility not identified with ADAAG compliant signage. <i>Proposed Solution:</i> Provide ADAAG compliant sign mounted 5' high on center on nearest adjacent wall, on latch side if a single door (located not to cause a Braille reader to stand within the door swing). 	PCODE SA11A ADAAG 4.1.3(16)(a) ADA 2010 216.8 CBC 2013 11B-216.8 Priority 3 Severity 3 FY 22-23 Maintenance Work	1	JOB	\$90	\$90
						
Stall Door						
4396	<ul style="list-style-type: none"> <i>As-Built Description:</i> Stall door to accessible compartment not self closing. <i>Proposed Solution:</i> Adjust closer. 	PCODE WB05B ADAAG 4.22.4 ADA 2010 604.8.1.2 CBC 2010 1115B.3.1.4.4 CBC 2013 11B-604.8.1.2 Priority 3 Severity 4 FY 22-23 Maintenance Work	1	JOB	\$25	\$25
						

Facility: **LEMORE HEALTH CLINIC**
 Address: 229 C ST.

Area: **Interior**
 Year to be Completed: **FY 22-23**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4395	<ul style="list-style-type: none"> <i>As-Built Description:</i> Stall door does not have accessible operating hardware (U-pulls on both sides, flip-over or sliding lock). <i>Proposed Solution:</i> Provide new accessible locking hardware that does not require grasping, pinching, or twisting and U-pulls on both sides. 	PCODE WB05C ADAAG 4.17.5 ADA 2010 604.8.1.2 CBC 2010 1115B.3.1.4.5 CBC 2013 11B-604.8.1.2 Priority 3 Severity 3 FY 22-23 Maintenance Work	1	JOB	\$100	\$100



3 Lobby Restroom - Men's

Door Closer

4403	<ul style="list-style-type: none"> <i>As-Built Description:</i> Excessive force required to open door. <i>As-Built:</i> 12 lbs <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 3 Severity 3 FY 22-23 Maintenance Work	1	JOB	\$25	\$25
------	---	--	---	-----	------	------



Door Hardware


4408	<ul style="list-style-type: none"> <i>As-Built Description:</i> Cabinet or storage door / drawer does not have accessible hardware. <i>Proposed Solution:</i> Provide accessible pull / latch (touch latches or U-pulls). 	PCODE ID07A ADAAG 4.25.4 ADA 2010 309.4 CBC 2010 1125B.4 CBC 2013 11B-309.4 Priority 3 Severity 3 FY 22-23 Maintenance Work	1	JOB	\$100	\$100
------	---	--	---	-----	-------	-------





Facility: **LEMORE HEALTH CLINIC**
 Address: 229 C ST.

Area: **Interior**
 Year to be Completed: **FY 22-23**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Stopper</u>						
4400	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 3 Severity 3 FY 22-23 Maintenance Work	1	JOB	\$25	\$25
						


<u>Grab Bars</u>						
4411	<ul style="list-style-type: none"> <i>As-Built Description:</i> Side grab bar less than 42" long, or located more than 12 inches max. from the rear wall, or extending less than 54" from rear wall (CA only: front end min. 24" in front of water closet). <i>As-Built:</i> 42"@55" <i>Proposed Solution:</i> Provide or relocate accessible side grab bar. 	PCODE WB07A ADAAG Fig. 29(b) ADA 2010 604.5.1 CBC 2010 1115B.4.1.3.1 CBC 2013 11B-604.5.1 Priority 3 Severity 4 FY 22-23 Maintenance Work	1	JOB	\$260	\$260
						


4410	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessories/dispensers in accessible stall located closer than 1-1/2" below or 12" above grab bar impedes its use. <i>As-Built:</i> 0.5" <i>Proposed Solution:</i> Relocate accessories/dispensers to be no closer than 1-1/2" below and 12" above grab bars (except if accessories are recessed, flush with wall, and have no sharp edges). 	PCODE WB07I ADAAG 4.26.2 ADA 2010 609.3 CBC 2010 1133B.4.2.5 CBC 2013 11B-609.3 Priority 3 Severity 4 FY 22-23 Maintenance Work	1	JOB	\$75	\$75
						

Facility: **LEMORE HEALTH CLINIC**
 Address: 229 C ST.


Area: **Interior**
 Year to be Completed: **FY 22-23**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
4402	<ul style="list-style-type: none"> <i>As-Built Description:</i> Entrance to wheelchair accessible toilet or bathing facility not identified with the International Symbol of Accessibility when not all are accessible. <i>Proposed Solution:</i> Provide sanitary facility sign that shows the international symbol. 	PCODE SA11 ADAAG 4.1.2(7)(d) ADA 2010 216.8 CBC 2010 1117B.5.8.1.2 CBC 2013 11B-216.8 Priority 3 Severity 3 FY 22-23 Maintenance Work	1	JOB	\$90	\$90
						

4401	<ul style="list-style-type: none"> <i>As-Built Description:</i> Entrance to toilet or bathing facility not identified with ADAAG compliant signage. <i>Proposed Solution:</i> Provide ADAAG compliant sign mounted 5' high on center on nearest adjacent wall, on latch side if a single door (located not to cause a Braille reader to stand within the door swing). 	PCODE SA11A ADAAG 4.1.3(16)(a) ADA 2010 216.8 CBC 2013 11B-216.8 Priority 3 Severity 3 FY 22-23 Maintenance Work	1	JOB	\$90	\$90
						

9 Exam Room Corridor - Not Being Used


Reach Range						
4452	<ul style="list-style-type: none"> <i>As-Built Description:</i> Reach height to control or access point, where only forward approach is available, exceeds 48" or is less than 15". <i>As-Built:</i> FE: 52" <i>Proposed Solution:</i> Modify equipment or mounting. <i>Notes:</i> must Break glass 	PCODE IE01 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 1118B.5 CBC 2013 11B-308.2.1 Priority 3 Severity 4 FY 22-23 Maintenance Work	1	JOB	\$100	\$100
						


10 Exam Room Corridor - Unisex Restroom


Facility: **LEMORE HEALTH CLINIC**
 Address: 229 C ST.

Area: **Interior**
 Year to be Completed: **FY 22-23**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Closer</u>						
4446	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door. As-Built: 7 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 3 Severity 4 FY 22-23 Maintenance Work	1	JOB	\$25	\$25
						

<u>Door Stopper</u>						
4447	<ul style="list-style-type: none"> As-Built Description: At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. Proposed Solution: Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 3 Severity 3 FY 22-23 Maintenance Work	1	JOB	\$25	\$25
						

<u>Grab Bars</u>						
4450	<ul style="list-style-type: none"> As-Built Description: Accessories/dispensers in accessible stall located closer than 1-1/2" below or 12" above grab bar impedes its use. As-Built: 0.5" Proposed Solution: Relocate accessories/dispensers to be no closer than 1-1/2" below and 12" above grab bars (except if accessories are recessed, flush with wall, and have no sharp edges). 	PCODE WB07I ADAAG 4.26.2 ADA 2010 609.3 CBC 2010 1133B.4.2.5 CBC 2013 11B-609.3 Priority 3 Severity 4 FY 22-23 Maintenance Work	1	JOB	\$75	\$75
						

Total Costs for Part/floor: Interior Ground Floor \$6,470.00

Facility: **LEMORE HEALTH CLINIC**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 229 C ST.

Year to be Completed: **FY 22-23**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$6,470.00

Facility: **LEMORE HEALTH CLINIC**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 229 C ST.

Year to be Completed: **FY 22-23**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: LEMORE HEALTH CLINIC					\$6,470.00
------------------------	---------------------------------------	--	--	--	--	-------------------

Facility: **LEMORE HEALTH CLINIC**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 229 C ST.

Year to be Completed: **FY 22-23**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for **Year to be Completed: FY 22-23** **\$98,574.00**

Facility: **HANFORD LIBRARY**
 Address: 401 N. DOUTY ST.

Area: **Interior**
 Year to be Completed: **FY 23-24**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 Main Circulation

Desk


2984	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> Top: 39" No knee space <i>Proposed Solution:</i> Provide new fixed accessible table or desk. 	PCODE	IN02	1	JOB	\$2,500	\$2,500
		ADAAG	4.32.3 & .4				
		ADA 2010	306.1				
		CBC 2010	1122B.3 & 4				
		CBC 2013	11B-306.1				
		Priority	2				
		Severity	2				
		FY 23-24	Contract Work				



3 Mezzanine

Handrail

2992	<ul style="list-style-type: none"> <i>As-Built Description:</i> Open guards does not have balusters or ornamental patterns such that a 4-inch-diameter (102 mm) sphere cannot pass through any opening. <i>As-Built:</i> 22" openings <i>Proposed Solution:</i> Provide new guards which do not allow passage of an 4 inch sphere at any opening. 	PCODE	ED08A	40	LF	\$120	\$4,800
		ADA 2010	405.9.2				
		CBC 2010	1013.3				
		CBC 2013	11B-405.9.2				
		Priority	2				
		Severity	2				
				FY 23-24	Contract Work		

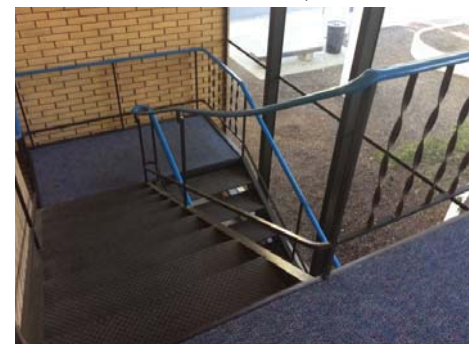

Lifts


2989	<ul style="list-style-type: none"> <i>As-Built Description:</i> Wheelchair lift not provided between levels. <i>As-Built:</i> 9' level change <i>Proposed Solution:</i> Provide equivalent facilitation on ground floor by providing same type of accommodations. <i>Notes:</i> Things that must be equivalent provided include Wifi Hot spot and accessible tables. 	PCODE	I001	1	JOB	\$20,000	\$20,000
		ADAAG	4.11.1; 4.11.2				
		ADA 2010	410.1				
		CBC 2010	1116B.2				
		CBC 2013	11B-410.1				
		Priority	2				
		Severity	2				
		FY 23-24	Contract Work				



Facility: **HANFORD LIBRARY**
 Address: 401 N. DOUTY ST.


Area: **Interior**
 Year to be Completed: **FY 23-24**


Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Top & Bottom Extension at Stairs</u>						
2991	<ul style="list-style-type: none"> <i>As-Built Description:</i> Stair handrail does not extend horizontally 12" minimum beyond top nosing, and one tread width sloped, plus 12" minimum horizontally beyond the bottom nosing. <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for each extension piece). <i>Notes:</i> Stairs on both sides of mezzanine 	PCODE ED06 ADAAG 4.9.4(2) ADA 2010 505.10.2; 505.10.3 CBC 2010 1133B.4.2.2 CBC 2013 11B-505.10.2; 11B-505.10.3 Priority 2 Severity 2 FY 23-24 Contract Work	8	JOB	\$170	\$1,360
						

4 Children's Section

Non-Fixed Desk

2997	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> Adult Stations. 24" high x 24" wide knee space <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 FY 23-24 Contract Work	1	JOB	\$1,600	\$1,600
						


2998	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> Adult table 25.25" high x 25.25" wide. <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 FY 23-24 Contract Work	1	JOB	\$1,600	\$1,600
						


9 Computer Lab

Facility: **HANFORD LIBRARY**
 Address: 401 N. DOUTY ST.

Area: **Interior**
 Year to be Completed: **FY 23-24**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Clearance</u>						
3043	<ul style="list-style-type: none"> As-Built Description: Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. As-Built: 27" Proposed Solution: Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 2 Severity 2 FY 23-24 Contract Work	1	JOB	\$2,600	\$2,600
						

<u>Non-Fixed Desk</u>						
3046	<ul style="list-style-type: none"> As-Built Description: Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. As-Built: Micro film: 14" wide Proposed Solution: Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 FY 23-24 Contract Work	1	JOB	\$1,600	\$1,600
						

Total Costs for	Part/floor: Interior	Ground Floor	\$36,060.00
------------------------	-----------------------------	---------------------	--------------------

Facility: **HANFORD LIBRARY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 401 N. DOUTY ST.

Year to be Completed: **FY 23-24**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$36,060.00

Facility: **HANFORD LIBRARY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 401 N. DOUTY ST.

Year to be Completed: **FY 23-24**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: HANFORD LIBRARY					\$36,060.00
------------------------	----------------------------------	--	--	--	--	--------------------

Facility: **KETTLEMAN CITY LIBRARY**

Area: **Exterior**

Part/Floor: **On-site**

Address: 106 BECKY PEASE ST.

Year to be Completed: **FY 23-24**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Parking

Clear Space

4825

As-Built Description:

An all-level clear space (30" x 48") is not provided which prevents access to the operable parts of a critical space of program function.

As-Built: No clear space

Proposed Solution:

Relocate the critical space so that it is accessible to the public.

Notes:

Relocate the Book Return box.

PCODE PD01NT
 ADA 2010 309.2
 CBC 2013 11B-309.2
 Priority 2
 Severity 2
 FY 23-24 Contract Work

1 JOB \$500 \$500



Total Costs for	Part/floor: Exterior	On-site				\$500.00
------------------------	-----------------------------	----------------	--	--	--	-----------------

Facility: **KETTLEMAN CITY LIBRARY**

Area: **Exterior**

Part/Floor: **On-site**

Address: 106 BECKY PEASE ST.

Year to be Completed: **FY 23-24**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$500.00

Facility: **KETTLEMAN CITY LIBRARY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 106 BECKY PEASE ST.

Year to be Completed: **FY 23-24**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 Staff Office Area

Sink

4789

• *As-Built Description:*

Sink does not have knee space min. 27" high x 19" deep x 30" wide.

• *Proposed Solution:*

Remodel sink cabinet.

PCODE **IN06A**

ADAAG **4.24.3**

ADA 2010 **606.2**

CBC 2010 **1115B.4.7.1**

CBC 2013 **11B-606.2**

Priority **2**

Severity **2**

FY 23-24 **Contract Work**

1 JOB \$1,750 **\$1,750**



Total Costs for	Part/floor: Interior	Ground Floor	\$1,750.00
------------------------	-----------------------------	---------------------	-------------------

Facility: **KETTLEMAN CITY LIBRARY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 106 BECKY PEASE ST.

Year to be Completed: **FY 23-24**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$1,750.00

Facility: **KETTLEMAN CITY LIBRARY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 106 BECKY PEASE ST.

Year to be Completed: **FY 23-24**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: KETTLEMAN CITY LIBRARY					\$2,250.00
------------------------	---	--	--	--	--	-------------------

Facility: **STRATFORD LIBRARY**
 Address: 20300 MAIN ST.

Area: **Interior**
 Year to be Completed: **FY 23-24**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 Library

Non-Fixed Desk

- 4533
- *As-Built Description:*
 Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided.
 - *As-Built:* 26.5"
 - *Proposed Solution:*
 Provide table or desk with accessible dimensions when purchasing new furniture.

PCODE IN02A
 ADAAG 4.32.3 & .4
 ADA 2010 306.1
 CBC 2010 1122B.3 & 4
 CBC 2013 11B-306.1 & 11B-902.3
 Priority 2
 Severity 2
 FY 23-24 Contract Work

2 JOB \$1,600 **\$3,200**



- 4534
- *As-Built Description:*
 Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided.
 - *As-Built:* Study carrel: 26.5"
 - *Proposed Solution:*
 Provide table or desk with accessible dimensions when purchasing new furniture.

PCODE IN02A
 ADAAG 4.32.3 & .4
 ADA 2010 306.1
 CBC 2010 1122B.3 & 4
 CBC 2013 11B-306.1 & 11B-902.3
 Priority 2
 Severity 2
 FY 23-24 Contract Work

1 JOB \$1,600 **\$1,600**



3 Staff Office

Sink

- 4539
- *As-Built Description:*
 Sink does not have knee space min. 27" high x 19" deep x 30" wide.
 - *Proposed Solution:*
 Remodel sink cabinet.

PCODE IN06A
 ADAAG 4.24.3
 ADA 2010 606.2
 CBC 2010 1115B.4.7.1
 CBC 2013 11B-606.2
 Priority 2
 Severity 2
 FY 23-24 Contract Work

1 JOB \$1,750 **\$1,750**



Total Costs for	Part/floor: Interior	Ground Floor	\$6,550.00
------------------------	-----------------------------	---------------------	-------------------

Facility: **STRATFORD LIBRARY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 20300 MAIN ST.

Year to be Completed: **FY 23-24**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$6,550.00

Facility: **STRATFORD LIBRARY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 20300 MAIN ST.

Year to be Completed: **FY 23-24**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: STRATFORD LIBRARY					\$6,550.00
------------------------	------------------------------------	--	--	--	--	-------------------

Facility: **HICKEY PARK**
 Address: 16850 FLINT AVE.

Area: **Exterior**
 Year to be Completed: **FY 23-24**

Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 POT to Areas 1 & 2

Changes in Level

4941	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route. <i>As-Built:</i> 1"-4" <i>Proposed Solution:</i> Remove, replace or repair area of pavement sufficient to correct abrupt change in level. 	PCODE EF03REF				
		ADAAG 4.3.8				
		ADA 2010 403.4				
		CBC 2010 1133B.7.4				
		CBC 2013 11B-403.4				
		Priority 2 Severity 2 FY 23-24 Contract Work				

REF



Picnic Area

4943	<ul style="list-style-type: none"> <i>As-Built Description:</i> Knee clearance at minimums 27" high, 30" wide, and 19" deep is not provided. <i>As-Built:</i> Cover or remove long bolts at designated accessible areas/tables <i>Proposed Solution:</i> Modify picnic table as required to provide knee clearance. 	PCODE NH11A				
		ADAAG 16.5.4.				
		ADA 2010 902.2				
		CBC 2010 1132B.1				
		CBC 2013 11-902.2				
		Priority 2 Severity 2 FY 23-24 Contract Work				

1 JOB \$850 \$850



4942	<ul style="list-style-type: none"> <i>As-Built Description:</i> Min. 36" clear floor or ground space surrounding the useable portion of the table as measured from seating is not provided. <i>As-Built:</i> 8" level change <i>Proposed Solution:</i> Reconfigure floor or ground space surrounding table to provide clear space as required. 	PCODE NH14A				
		ADAAG 16.5.5				
		ADA 2010 226.1				
		CBC 2010 1132B.1				
		CBC 2013 11B-226.1				
		Priority 2 Severity 2 FY 23-24 Contract Work				

1 JOB




4 POT From Lot to Area 4 and Drinking Fountain


Facility: **HICKEY PARK**
 Address: 16850 FLINT AVE.


Area: **Exterior**
 Year to be Completed: **FY 23-24**

Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Picnic Area</u>						
4948	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Min. 36" clear floor or ground space surrounding the useable portion of the table as measured from seating is not provided. • <i>As-Built:</i> 8" • <i>Proposed Solution:</i> Reconfigure floor or ground space surrounding table to provide clear space as required. • <i>Notes:</i> 12 tables. 	PCODE NH14A ADAAG 16.5.5 ADA 2010 226.1 CBC 2010 1132B.1 CBC 2013 11B-226.1 Priority 2 Severity 2 FY 23-24 Contract Work	1	JOB		
						

5 Accessible Parking Space by Volleyball Court


<u>Changes in Level</u>						
5131	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route. • <i>As-Built:</i> 2"-3" • <i>Proposed Solution:</i> Remove, replace or repair area of pavement sufficient to correct abrupt change in level. 	PCODE EF03REF ADAAG 4.3.8 ADA 2010 403.4 CBC 2010 1133B.7.4 CBC 2013 11B-403.4 Priority 2 Severity 2 FY 23-24 Contract Work		REF		
						

<u>Participation Area</u>						
5129	<ul style="list-style-type: none"> • <i>As-Built Description:</i> An accessible path of travel is not provided to and from all participation and activity areas, including athletic team rooms/facilities, playing fields/running tracks, baseball/softball player dugouts and sanitary/locker facilities (home and guest). • <i>Proposed Solution:</i> Provide an accessible path of travel to all participation areas. 	PCODE GF07AREF ADAAG 4.1.1 (1) ADA 2010 206.2.12 CBC 2010 1104B.4.3 CBC 2013 11B-206.2.12 Priority 2 Severity 2 FY 23-24 Contract Work		REF		
						


Facility: **HICKEY PARK**
 Address: 16850 FLINT AVE.

Area: **Exterior**
 Year to be Completed: **FY 23-24**

Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Picnic Area</u>						
5127	<ul style="list-style-type: none"> <i>As-Built Description:</i> Min. 36" clear floor or ground space surrounding the useable portion of the table as measured from seating is not provided. <i>As-Built:</i> 14" wide <i>Proposed Solution:</i> Reconfigure floor or ground space surrounding table to provide clear space as required. 	PCODE NH14A ADAAG 16.5.5 ADA 2010 226.1 CBC 2010 1132B.1 CBC 2013 11B-226.1 Priority 2 Severity 2 FY 23-24 Contract Work	1	JOB		
						

7 Upper Lot Serving Area 22 & Play Structure

<u>Participation Area</u>						
5157	<ul style="list-style-type: none"> <i>As-Built Description:</i> An accessible path of travel is not provided to and from all participation and activity areas, including athletic team rooms/facilities, playing fields/running tracks, baseball/softball player dugouts and sanitary/locker facilities (home and guest). <i>As-Built:</i> Horse shoe pits and t-ball field. <i>Proposed Solution:</i> Provide an accessible path of travel to all participation areas. 	PCODE GF07A ADAAG 4.1.1 (1) ADA 2010 206.2.12 CBC 2010 1104B.4.3 CBC 2013 11B-206.2.12 Priority 2 Severity 2 FY 23-24 Contract Work	1	REF		
						

Total Costs for	Part/floor: Exterior	On-site	\$850.00
------------------------	-----------------------------	----------------	-----------------

Facility: **HICKEY PARK**
Address: 16850 FLINT AVE.

Area: **Exterior**
Year to be Completed: **FY 23-24**

Part/Floor: **On-site**
Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Area: Exterior **\$850.00**

Facility: **HICKEY PARK**
Address: 16850 FLINT AVE.

Area: **Exterior**
Year to be Completed: **FY 23-24**

Part/Floor: **On-site**
Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: HICKEY PARK					\$850.00
------------------------	------------------------------	--	--	--	--	-----------------

Facility: **BURRIS PARK**
 Address: 6500 CLINTON AVE.

Area: **Exterior**
 Year to be Completed: **FY 23-24**

Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 East Accessible Spaces & Picnic Area B

Door

5037	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> No maneuvering clearance at door <i>Proposed Solution:</i> Modify surface slope at door. 	<p>PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 2 FY 23-24 Contract Work</p>	25	SF	\$40	\$1,000
------	--	---	----	----	------	----------------



Non-Fixed Desk

5239	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> 22.5" high knee space. <i>Proposed Solution:</i> Modify table. 	<p>PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 FY 23-24 Contract Work</p>	1	JOB	\$1,600	\$1,600
------	---	---	---	-----	---------	----------------



Participation Area


5121	<ul style="list-style-type: none"> <i>As-Built Description:</i> An accessible path of travel is not provided to and from all participation and activity areas, including athletic team rooms/facilities, playing fields/running tracks, baseball/softball player dugouts and sanitary/locker facilities (home and guest). <i>As-Built:</i> Volley ball & play area <i>Proposed Solution:</i> Provide an accessible path of travel to all participation areas. 	<p>PCODE GF07AREF ADAAG 4.1.1 (1) ADA 2010 206.2.12 CBC 2010 1104B.4.3 CBC 2013 11B-206.2.12 Priority 2 Severity 2 FY 23-24 Contract Work</p>	REF			
------	--	--	-----	--	--	--



Facility: **BURRIS PARK**
 Address: 6500 CLINTON AVE.

Area: **Exterior**
 Year to be Completed: **FY 23-24**

Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Sink						
5237	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 FY 23-24 Contract Work	1	JOB	\$1,750	\$1,750
						

Total Costs for	Part/floor: Exterior	On-site	\$4,350.00
------------------------	-----------------------------	----------------	-------------------

Facility: **BURRIS PARK**

Area: **Exterior**

Part/Floor: **On-site**

Address: 6500 CLINTON AVE.

Year to be Completed: **FY 23-24**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$4,350.00

Facility: **BURRIS PARK**

Area: **Exterior**

Part/Floor: **On-site**

Address: 6500 CLINTON AVE.

Year to be Completed: **FY 23-24**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: BURRIS PARK					\$4,350.00
------------------------	------------------------------	--	--	--	--	-------------------

Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Exterior**
 Year to be Completed: **FY 23-24**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Accessible Parking

Detectable Warning

<p>3704</p> <ul style="list-style-type: none"> <i>As-Built Description:</i> 36" wide band of truncated domes not provided at walkway or crossing adjoining a vehicular way, if surfaces are not separated by a curb, railing, or other element. <i>Proposed Solution:</i> Provide 36" wide, contrasting color, band of truncated domes between pedestrian and vehicular area. 	<p>PCODE EG09 ADAAG 4.29.5 CBC 2010 1133B.8.5 CBC 2013 11B-705.1.2.5 Priority 1 Severity 3 FY 23-24 Maintenance Work</p>	<p>4 LF \$27 \$108</p>
---	---	-------------------------------



Minimum Number

<p>3700</p> <ul style="list-style-type: none"> <i>As-Built Description:</i> At parking lot with 26-50 spaces, the number of accessible spaces is less than required by code; 2 spaces required. <i>Proposed Solution:</i> Provide required accessible parking spaces with signs including a minimum of one van space. Notes: 35 total spaces 1 accessible space 0 van 	<p>PCODE EA01B ADAAG 4.1.2(5)* ADA 2010 208.2 CBC 2010 Tbl. 11B-6 CBC 2013 11B-208.2 Tbl. 11B-208.2 Priority 1 Severity 2 FY 23-24 Maintenance Work</p>	<p>1 JOB \$300 \$300</p>
--	--	---------------------------------



Parking


<p>3702</p> <ul style="list-style-type: none"> <i>As-Built Description:</i> No van parking provided (one in every 6 or fraction of 6 accessible spaces, but not less than one). <i>Proposed Solution:</i> Provide van parking space(s) by restriping; provide van sign. 	<p>PCODE EA07 ADAAG 4.1.2(5)(b) ADA 2010 208.2; 502.1 CBC 2010 1129B.3.2 CBC 2013 11B-208.2.4 Priority 1 Severity 2 FY 23-24 Maintenance Work</p>	<p>1 JOB \$350 \$350</p>
---	--	---------------------------------




Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.


Area: **Exterior**
 Year to be Completed: **FY 23-24**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Parking Signage</u>						
3703	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: Additional Sign or additional language below the symbol of accessibility stating "Minimum Fine \$250" not provided. <i>Proposed Solution:</i> Provide compliant parking signage that includes fine information. 	PCODE EA04G CBC 2010 1129B.4 CBC 2013 11B-502.6.2 Priority 1 Severity 4 FY 23-24 Maintenance Work	1	JOB	\$100	\$100
						

2 POT from Accessible Parking to Entrance

<u>Route Sign</u>						
3706	<ul style="list-style-type: none"> <i>As-Built Description:</i> No sign by inaccessible route directing persons to an accessible route. <i>Proposed Solution:</i> Provide directional sign. 	PCODE SA20 ADAAG 35.163(b) ADA 2010 216.3 CBC 2010 1127B.3 CBC 2013 11B-216.3 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$170	\$170
						


<u>Signage</u>						
3707	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible building entrance when not all are accessible not identified with a sign showing the International Symbol of Accessibility. <i>Proposed Solution:</i> Provide building entrance sign that shows international symbol at accessible entrance. 	PCODE SA12 ADAAG 4.1.2(7)(c) ADA 2010 216.6 CBC 2010 1127B.3 CBC 2013 11B-216.6 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$50	\$50
						

4 Staff Entrance - Breakroom


Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Exterior**
 Year to be Completed: **FY 23-24**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Curb Ramp</u>						
3710	<ul style="list-style-type: none"> <i>As-Built Description:</i> Detectable warning not provided where pedestrian crosses vehicular area. <i>Proposed Solution:</i> Provide detectable warning surface (i.e. in-line truncated domes) at regular curb ramp. 	PCODE EH07AREF ADAAG 4.7.7 ADA 2010 705.1 CBC 2010 1127B.5.7 CBC 2013 11B-705.1.2.2 Priority 1 Severity 3 FY 23-24 Maintenance Work				
						REF 

5 Conference Room Door

<u>Curb Ramp</u>						
3713	<ul style="list-style-type: none"> <i>As-Built Description:</i> Detectable warning not provided where pedestrian crosses vehicular area. <i>Proposed Solution:</i> Provide detectable warning surface (i.e. in-line truncated domes) at regular curb ramp. 	PCODE EH07AREF ADAAG 4.7.7 ADA 2010 705.1 CBC 2010 1127B.5.7 CBC 2013 11B-705.1.2.2 Priority 1 Severity 3 FY 23-24 Maintenance Work				
						REF 

Total Costs for Part/floor: Exterior On-site \$1,078.00

Facility: **SUPERINTENDENT OF SCHOOLS**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1144 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$1,078.00

Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 23-24**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Main Entrance & Lobby

Brochure Bins

3590	<ul style="list-style-type: none"> <i>As-Built Description:</i> Information brochure bins mounted above accessible height of 48". <i>As-Built:</i> Provide same information at lower bins, 34"-70" <i>Proposed Solution:</i> Relocate/remount bins at accessible height. 	PCODE IN08 ADAAG 4.2.5 & 6 ADA 2010 308.2.1 CBC 2010 1118B.5 CBC 2013 11B-308.2.1 Priority 1 Severity 1 FY 23-24 Maintenance Work	1	JOB	\$100	\$100
------	---	--	---	-----	-------	-------



Carpet/Doormat

3583	<ul style="list-style-type: none"> <i>As-Built Description:</i> Doormat not securely attached to ground or floor structure. <i>Proposed Solution:</i> Attach doormat to floor surface or remove doormat. 	PCODE ID05A ADAAG 4.5.3 ADA 2010 302.2 CBC 2010 1124B.3 CBC 2013 11B-302.2 Priority 1 Severity 3 FY 23-24 Maintenance Work	2	JOB	\$75	\$150
------	--	---	---	-----	------	-------



Door Closer




3586	<ul style="list-style-type: none"> <i>As-Built Description:</i> Excessive force required to open door. <i>As-Built:</i> 8 lbs <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 1 Severity 4 FY 23-24 Maintenance Work	1	JOB	\$25	\$25
------	--	--	---	-----	------	------



Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 23-24**

Part/Floor: **Ground Floor**
 Priority No: **1**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
3587	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90
						
3593	<ul style="list-style-type: none"> <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90
						
3584	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible building entrance when not all are accessible not identified with a sign showing the International Symbol of Accessibility. <i>Proposed Solution:</i> Provide building entrance sign that shows international symbol at accessible entrance. 	PCODE SA12 ADAAG 4.1.2(7)(c) ADA 2010 216.6 CBC 2010 1127B.3 CBC 2013 11B-216.6 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$50	\$50
						


2 Human Resources

Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **FY 23-24**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Closer</u>						
3606	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door. As-Built: 7 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 1 Severity 4 FY 23-24 Maintenance Work	1	JOB	\$25	\$25
						

<u>Door Swing</u>						
3604	<ul style="list-style-type: none"> As-Built Description: Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). As-Built: 38" Proposed Solution: Change door swing. 	PCODE ID24 ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$500	\$500
						

5 Breakroom Corridor

<u>Signage</u>						
3630	<ul style="list-style-type: none"> As-Built Description: At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. Proposed Solution: Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90
						

11 Business Services


Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Interior**

Part/Floor: **Ground Floor**

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
3698	<ul style="list-style-type: none"> <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90
						

Total Costs for	Part/floor: Interior	Ground Floor					\$1,210.00
------------------------	-----------------------------	---------------------	--	--	--	--	-------------------

Facility: **SUPERINTENDENT OF SCHOOLS**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1144 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$1,210.00

Facility: **SUPERINTENDENT OF SCHOOLS**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1144 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: SUPERINTENDENT OF SCHOOLS	\$2,288.00
------------------------	--	-------------------

Facility: **JOB TRAINING OFFICE**
 Address: 124 N. IRWIN ST.

Area: **Interior-EDC**
 Year to be Completed: **FY 23-24**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

14 EDC Entrance

Carpet/Doormat

3872 • *As-Built Description:*
 Doormat not securely attached to ground or floor structure.

• *Proposed Solution:*
 Attach doormat to floor surface or remove doormat.

PCODE ID05A
ADAAG 4.5.3
ADA 2010 302.2
CBC 2010 1124B.3
CBC 2013 11B-302.2
Priority 1
Severity 3
FY 23-24 Maintenance Work

1 JOB \$75 \$75



Door Swing

3871 • *As-Built Description:*
 Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).

• *As-Built:* 7"
 • *Proposed Solution:*
 Provide door operator.

PCODE ID24C
ADAAG Fig. 25(a)
ADA 2010 404.2.4
CBC 2010 11B-26A(a)
CBC 2013 11B-404.2.4
Priority 1
Severity 3
FY 23-24 Maintenance Work

1 JOB \$5,000 \$5,000



Total Costs for	Part/floor: Interior-EDC	Ground Floor	\$5,075.00
------------------------	---------------------------------	---------------------	-------------------

Facility: **JOB TRAINING OFFICE**

Area: **Interior-EDC**

Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Area: Interior-EDC					\$5,075.00
------------------------	---------------------------	--	--	--	--	-------------------

Facility: **JOB TRAINING OFFICE**

Area: **Interior-EDC**

Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: JOB TRAINING OFFICE					\$5,075.00
------------------------	--------------------------------------	--	--	--	--	-------------------

Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 23-24**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Central Services Lobby

Carpet/Doormat

943	<ul style="list-style-type: none"> <i>As-Built Description:</i> Doormat not securely attached to ground or floor structure. <i>Proposed Solution:</i> Attach doormat to floor surface or remove doormat. 	PCODE ID05A ADAAG 4.5.3 ADA 2010 302.2 CBC 2010 1124B.3 CBC 2013 11B-302.2 Priority 1 Severity 3 FY 23-24 Maintenance Work	2	JOB	\$75	\$150
-----	--	---	---	-----	------	-------



Door Closer

944	<ul style="list-style-type: none"> <i>As-Built Description:</i> Excessive force required to open door. <i>As-Built:</i> 10-12 lbs <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 1 Severity 3 FY 23-24 Maintenance Work	2	JOB	\$25	\$50
-----	--	--	---	-----	------	------




950	<ul style="list-style-type: none"> <i>As-Built Description:</i> Excessive force required to open door. <i>As-Built:</i> 8 lbs <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 1 Severity 4 FY 23-24 Maintenance Work	1	JOB	\$25	\$25
-----	--	--	---	-----	------	------




Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **FY 23-24**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Hardware</u>						
949	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$250	\$250
						

<u>Signage</u>						
941	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Existing sign designating permanent room or space is noncompliant. • <i>Proposed Solution:</i> Provide compliant signage. 	PCODE SA13 ADAAG 4.1.3(16)(a) ADA 2010 216.2 CBC 2010 1117B.5 CBC 2013 11B-216.2 Priority 1 Severity 4 FY 23-24 Maintenance Work	1	JOB	\$150	\$150
						


2 Minors Advocates Lobby


<u>Carpet/Doormat</u>						
953	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Doormat not securely attached to ground or floor structure. • <i>Proposed Solution:</i> Attach doormat to floor surface or remove doormat. 	PCODE ID05A ADAAG 4.5.3 ADA 2010 302.2 CBC 2010 1124B.3 CBC 2013 11B-302.2 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$75	\$75
						

Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 23-24**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Hardware</u>						
951	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$250	\$250
						

<u>Door Stopper</u>						
952	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. • <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$25	\$25
						

Total Costs for	Part/floor: Interior	Ground Floor	\$975.00
------------------------	-----------------------------	---------------------	-----------------

Facility: **COUNTY SERVICES OFFICES**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$975.00

Facility: **COUNTY SERVICES OFFICES**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: COUNTY SERVICES OFFICES					\$975.00
------------------------	--	--	--	--	--	-----------------

Facility: **ENGINEERING BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Public Works Lobby

Brochure Bins

771	<ul style="list-style-type: none"> <i>As-Built Description:</i> Information brochure bins mounted above accessible height of 48". <i>As-Built:</i> 48"-63" <i>Proposed Solution:</i> Relocate/remount bins at accessible height. 	<p>PCODE IN08 ADAAG 4.2.5 & 6 ADA 2010 308.2.1 CBC 2010 1118B.5 CBC 2013 11B-308.2.1 Priority 1 Severity 2 FY 23-24 Maintenance Work</p>	1	JOB	\$100	\$100
-----	---	---	---	-----	-------	-------



Carpet/Doormat

765	<ul style="list-style-type: none"> <i>As-Built Description:</i> Doormat not securely attached to ground or floor structure. <i>Proposed Solution:</i> Attach doormat to floor surface or remove doormat. 	<p>PCODE ID05A ADAAG 4.5.3 ADA 2010 302.2 CBC 2010 1124B.3 CBC 2013 11B-302.2 Priority 1 Severity 3 FY 23-24 Maintenance Work</p>	2	JOB	\$75	\$150
-----	--	--	---	-----	------	-------



Door Closer

770	<ul style="list-style-type: none"> <i>As-Built Description:</i> Excessive force required to open door. <i>As-Built:</i> 7 lbs <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). 	<p>PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 1 Severity 4 FY 23-24 Maintenance Work</p>	2	JOB	\$25	\$50
-----	--	---	---	-----	------	------



Facility: **ENGINEERING BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**


Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
766	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90
						

764	<ul style="list-style-type: none"> <i>As-Built Description:</i> Existing sign designating permanent room or space is noncompliant. <i>Proposed Solution:</i> Provide compliant signage. 	PCODE SA13 ADAAG 4.1.3(16)(a) ADA 2010 216.2 CBC 2010 1117B.5 CBC 2013 11B-216.2 Priority 1 Severity 4 FY 23-24 Maintenance Work	1	JOB	\$150	\$150
						

6 Public Works Office

Door Swing

813	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). <i>As-Built:</i> 9.5" to wall <i>Proposed Solution:</i> Provide door operator. 	PCODE ID24C ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 1 Severity 4 FY 23-24 Maintenance Work	1	JOB	\$5,000	\$5,000
						

9 Planning Offices

Facility: **ENGINEERING BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**


Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
857	<ul style="list-style-type: none"> <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90
						

860	<ul style="list-style-type: none"> <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90
						

12 IT & Purchasing Lobby

Carpet/Doormat

881	<ul style="list-style-type: none"> <i>As-Built Description:</i> Doormat not securely attached to ground or floor structure. <i>Proposed Solution:</i> Attach doormat to floor surface or remove doormat. 	PCODE ID05A ADAAG 4.5.3 ADA 2010 302.2 CBC 2010 1124B.3 CBC 2013 11B-302.2 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$75	\$75
						

Facility: **ENGINEERING BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Closer</u>						
878	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door. As-Built: 10 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 1 Severity 4 FY 23-24 Maintenance Work	2	JOB	\$25	\$50
						

<u>Door Hardware</u>						
886	<ul style="list-style-type: none"> As-Built Description: Door does not have accessible operating hardware. As-Built: purchasing Proposed Solution: Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$250	\$250
						

<u>Door Stopper</u>						
887	<ul style="list-style-type: none"> As-Built Description: At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. As-Built: purchasing Proposed Solution: Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$25	\$25
						

Facility: **ENGINEERING BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
891	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 1 Severity 3 FY 23-24 Maintenance Work	4	JOB	\$25	\$100
						

Signage

880	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90
						

879	<ul style="list-style-type: none"> <i>As-Built Description:</i> Existing sign designating permanent room or space is noncompliant. <i>Proposed Solution:</i> Provide compliant signage. 	PCODE SA13 ADAAG 4.1.3(16)(a) ADA 2010 216.2 CBC 2010 1117B.5 CBC 2013 11B-216.2 Priority 1 Severity 4 FY 23-24 Maintenance Work	2	JOB	\$150	\$300
						

14 Server Room & Offices

Facility: **ENGINEERING BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
906	<ul style="list-style-type: none"> <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90



Total Costs for	Part/floor: Interior	Ground Floor					\$6,700.00
------------------------	-----------------------------	---------------------	--	--	--	--	-------------------

Facility: **ENGINEERING BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$6,700.00

Facility: **ENGINEERING BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: ENGINEERING BUILDING					\$6,700.00
------------------------	---------------------------------------	--	--	--	--	-------------------

Facility: **FINANCE BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Treasurer & Tax Collector


Brochure Bins

581	<ul style="list-style-type: none"> As-Built Description: Information brochure bins mounted above accessible height of 48". As-Built: 57" Proposed Solution: Relocate/remount bins at accessible height. 	<p>PCODE IN08</p> <p>ADAAG 4.2.5 & 6</p> <p>ADA 2010 308.2.1</p> <p>CBC 2010 1118B.5</p> <p>CBC 2013 11B-308.2.1</p> <p>Priority 1</p> <p>Severity 3</p> <p>FY 23-24 Maintenance Work</p>	1	JOB	\$100	\$100
-----	--	---	---	-----	-------	-------



Door

579	<ul style="list-style-type: none"> As-Built Description: At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. As-Built: 8.5" Proposed Solution: Provide 10" min. "kick plate" covering width of door when altering area. 	<p>PCODE ID06</p> <p>ADA 2010 404.2.10</p> <p>CBC 2010 1133B.2.6</p> <p>CBC 2013 11B-404.2.10</p> <p>Priority 1</p> <p>Severity 3</p> <p>FY 23-24 Maintenance Work</p>	4	JOB	\$100	\$400
-----	--	---	---	-----	-------	-------

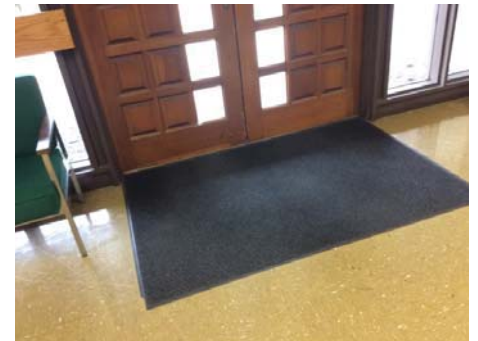

Door Closer

578	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door. As-Built: 9-10 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs max). 	<p>PCODE ID03</p> <p>ADAAG 4.13.11</p> <p>ADA 2010 404.2.9</p> <p>CBC 2010 1133B.2.5</p> <p>CBC 2013 11B-404.2.9</p> <p>Priority 1</p> <p>Severity 4</p> <p>FY 23-24 Maintenance Work</p>	4	JOB	\$25	\$100
-----	--	---	---	-----	------	-------



Facility: **FINANCE BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
574	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	2	JOB	\$90	\$180
						

573	<ul style="list-style-type: none"> <i>As-Built Description:</i> Existing sign designating permanent room or space is noncompliant. <i>Proposed Solution:</i> Provide compliant signage and ISA. 	PCODE SA13 ADAAG 4.1.3(16)(a) ADA 2010 216.2 CBC 2010 1117B.5 CBC 2013 11B-216.2 Priority 1 Severity 4 FY 23-24 Maintenance Work	2	JOB	\$150	\$300
						

2 Treasurer Staff Offices

Signage						
587	<ul style="list-style-type: none"> <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90
						

4 Auditor Controller Office

Facility: **FINANCE BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Swing</u>						
603	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). • <i>As-Built:</i> 9" • <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID24A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 1 Severity 4 FY 23-24 Maintenance Work	1	JOB	\$50	\$50
						

5 Auditor Controller Lobby

<u>Door</u>						
613	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. • <i>As-Built:</i> 8.5" • <i>Proposed Solution:</i> Provide 10" min. "kick plate" covering width of door when altering area. 	PCODE ID06 ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$100	\$100
						

<u>Door Closer</u>						
615	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door. • <i>As-Built:</i> 10 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 1 Severity 4 FY 23-24 Maintenance Work	1	JOB	\$25	\$25
						

Facility: **FINANCE BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
610	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90
						

6 Elections Lobby

Door						
620	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>As-Built:</i> 8.5" <i>Proposed Solution:</i> Provide 10" min. "kick plate" covering width of door when altering area. 	PCODE ID06 ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 1 Severity 3 FY 23-24 Maintenance Work	2	JOB	\$100	\$200
						

Door Closer						
621	<ul style="list-style-type: none"> <i>As-Built Description:</i> Excessive force required to open door. <i>As-Built:</i> 12 lbs <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 1 Severity 3 FY 23-24 Maintenance Work	2	JOB	\$25	\$50
						

Facility: **FINANCE BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**



Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
622	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90
						

7 Elections Staff Area

Signage						
629	<ul style="list-style-type: none"> <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90
						
632	<ul style="list-style-type: none"> <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90
						

9 Courtesy Room

Facility: **FINANCE BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Hardware</u>						
643	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	<p>PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 1 Severity 3 FY 23-24 Maintenance Work</p>	1	JOB	\$250	\$250
						

10 Assessor Lobby

<u>Brochure Bins</u>						
649	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Information brochure bins mounted above accessible height of 48". • <i>As-Built:</i> 48"-71" difficult to reach • <i>Proposed Solution:</i> Relocate/remount bins at accessible height. 	<p>PCODE IN08 ADAAG 4.2.5 & 6 ADA 2010 308.2.1 CBC 2010 1118B.5 CBC 2013 11B-308.2.1 Priority 1 Severity 1 FY 23-24 Maintenance Work</p>	1	JOB	\$100	\$100
						

<u>Carpet/Doormat</u>						
644	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Doormat not securely attached to ground or floor structure. • <i>Proposed Solution:</i> Attach doormat to floor surface or remove doormat. 	<p>PCODE ID05A ADAAG 4.5.3 ADA 2010 302.2 CBC 2010 1124B.3 CBC 2013 11B-302.2 Priority 1 Severity 3 FY 23-24 Maintenance Work</p>	2	JOB	\$75	\$150
						

Facility: **FINANCE BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
646	<ul style="list-style-type: none"> <i>As-Built Description:</i> Doormat not securely attached to ground or floor structure. <i>As-Built:</i> General mats <i>Proposed Solution:</i> Attach doormat to floor surface or remove doormat. 	<p>PCODE ID05A ADAAG 4.5.3 ADA 2010 302.2 CBC 2010 1124B.3 CBC 2013 11B-302.2 Priority 1 Severity 3 FY 23-24 Maintenance Work</p>	4	JOB	\$75	\$300
						

Signage

647	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	<p>PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work</p>	1	JOB	\$90	\$90
						

15 Assessors Office - Staff

Signage

698	<ul style="list-style-type: none"> <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	<p>PCODE SA10D ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work</p>	1	JOB	\$90	\$90
						

Facility: **FINANCE BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
708	<ul style="list-style-type: none"> <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90



18 HR Lobby

Door Closer

735	<ul style="list-style-type: none"> <i>As-Built Description:</i> Excessive force required to open door. <i>As-Built:</i> 12 lbs <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 1 Severity 3 FY 23-24 Maintenance Work	2	JOB	\$25	\$50
-----	---	--	---	-----	------	------



Signage

736	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90
-----	--	--	---	-----	------	------



21 Staff Offices

Facility: **FINANCE BUILDING**



Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
752	<ul style="list-style-type: none"> <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90
						
757	<ul style="list-style-type: none"> <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90
						

Total Costs for	Part/floor: Interior	Ground Floor	\$3,345.00
------------------------	-----------------------------	---------------------	-------------------

Facility: **FINANCE BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$3,345.00

Facility: **FINANCE BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: FINANCE BUILDING					\$3,345.00
------------------------	-----------------------------------	--	--	--	--	-------------------

Facility: **LAW OFFICES BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 DA Offices

Signage

1465

As-Built Description:

At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.

Proposed Solution:

Provide raised letter/Braille "EXIT ROUTE" sign at door.

PCODE SA10D
 ADAAG 4.1.3(16)
 ADA 2010 216.4.1
 CBC 2010 1011.3
 CBC 2013 11B-216.4.1
 Priority 1
 Severity 3
 FY 23-24 Maintenance Work

1 JOB \$90 \$90



6 Sexual Assault Lobby

Door Stopper

1492

As-Built Description:


At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface.

Proposed Solution:

Remove door stopper when altering area. Provide rubber wedge.

PCODE ID06A
 ADA 2010 404.2.10
 CBC 2010 1133B.2.6
 CBC 2013 11B-404.2.10
 Priority 1
 Severity 3
 FY 23-24 Maintenance Work

2 JOB \$25 \$50

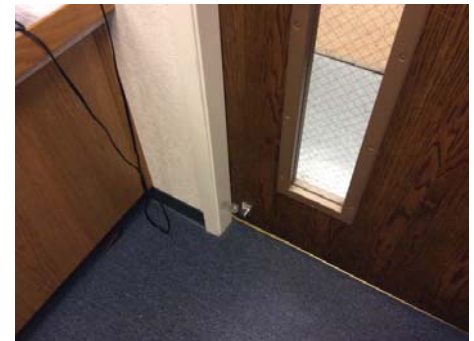

Signage

1497

As-Built Description:

At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.

Proposed Solution:

Provide raised letter/Braille "EXIT" sign at door.

PCODE SA10A
 ADAAG 4.1.3(16)
 ADA 2010 216.4.1
 CBC 2010 1011.3
 CBC 2013 11B-216.4.1
 Priority 1
 Severity 3
 FY 23-24 Maintenance Work

1 JOB \$90 \$90



13 DA Lobby

Facility: **LAW OFFICES BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Carpet/Doormat</u>						
1559	<ul style="list-style-type: none"> <i>As-Built Description:</i> Doormat not securely attached to ground or floor structure. <i>Proposed Solution:</i> Attach doormat to floor surface or remove doormat. 	PCODE ID05A ADAAG 4.5.3 ADA 2010 302.2 CBC 2010 1124B.3 CBC 2013 11B-302.2 Priority 1 Severity 3 FY 23-24 Maintenance Work	2	JOB	\$75	\$150
						

<u>Door Hardware</u>						
1561	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door does not have accessible operating hardware. <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$250	\$250
						

<u>Door Stopper</u>						
1562	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$25	\$25
						

14 Law Library

Facility: **LAW OFFICES BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Carpet/Doormat</u>						
1570	<ul style="list-style-type: none"> <i>As-Built Description:</i> Doormat not securely attached to ground or floor structure. <i>Proposed Solution:</i> Attach doormat to floor surface or remove doormat. 	PCODE ID05A ADAAG 4.5.3 ADA 2010 302.2 CBC 2010 1124B.3 CBC 2013 11B-302.2 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$75	\$75
						
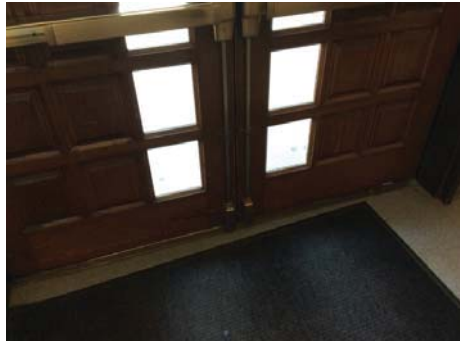
<u>Door</u>						
1568	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Install kick plate at bottom 10" of door to cover floor latch and floor latch rods. 	PCODE ID06ANT ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$200	\$200
						

<u>Door Closer</u>						
1569	<ul style="list-style-type: none"> <i>As-Built Description:</i> Excessive force required to open door. <i>As-Built:</i> 16 lbs <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 1 Severity 2 FY 23-24 Maintenance Work	2	JOB	\$25	\$50
						

Facility: **LAW OFFICES BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1574	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door. As-Built: 17 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 1 Severity 2 FY 23-24 Maintenance Work	2	JOB	\$25	\$50



Door Hardware

1572	<ul style="list-style-type: none"> As-Built Description: Door does not have accessible operating hardware. Proposed Solution: Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$250	\$250
------	--	---	---	-----	-------	-------



1580	<ul style="list-style-type: none"> As-Built Description: Door does not have accessible operating hardware. Proposed Solution: Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$250	\$250
------	--	---	---	-----	-------	-------



Facility: **LAW OFFICES BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Stopper</u>						
1573	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$25	\$25
						

<u>Door Swing</u>						
1578	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). <i>As-Built:</i> 6" <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID24A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$50	\$50
						

<u>Signage</u>						
1571	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90
						

15 Veterans Services

Facility: **LAW OFFICES BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 23-24**

Priority No: **1**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
1586	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90
						

17 County Council

Carpet/Doormat

1597	<ul style="list-style-type: none"> <i>As-Built Description:</i> Doormat not securely attached to ground or floor structure. <i>Proposed Solution:</i> Attach doormat to floor surface or remove doormat. 	PCODE ID05A ADAAG 4.5.3 ADA 2010 302.2 CBC 2010 1124B.3 CBC 2013 11B-302.2 Priority 1 Severity 3 FY 23-24 Maintenance Work	2	JOB	\$75	\$150
						

Door Stopper

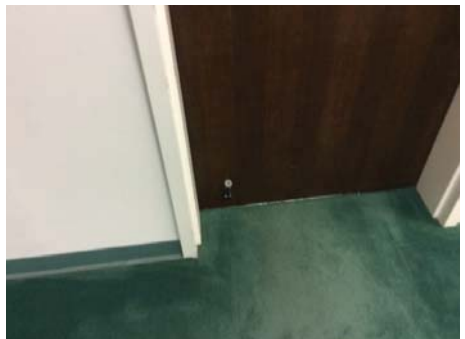1611	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$25	\$25
						

Facility: **LAW OFFICES BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Swing</u>						
1598	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). • <i>As-Built:</i> 2" to bench • <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	<p>PCODE ID24A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 1 Severity 2 FY 23-24 Maintenance Work</p>	1	JOB	\$50	\$50
						

<u>Signage</u>						
1600	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	<p>PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work</p>	1	JOB	\$90	\$90
						

1610	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. • <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	<p>PCODE SA10D ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work</p>	1	JOB	\$90	\$90
						

Facility: **LAW OFFICES BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1612	<ul style="list-style-type: none"> <i>As-Built Description:</i> At door leading to horizontal exit: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "TO EXIT" sign at door. 	PCODE SA10E ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90



Total Costs for	Part/floor: Interior	Ground Floor					\$2,280.00
------------------------	-----------------------------	---------------------	--	--	--	--	-------------------

Facility: **LAW OFFICES BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$2,280.00

Facility: **LAW OFFICES BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: LAW OFFICES BUILDING					\$2,280.00
------------------------	---------------------------------------	--	--	--	--	-------------------

Facility: **SHERIFF ADMIN BLDG**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Accessible Parking Serving Sheriff Facilities

Parking


2616	<ul style="list-style-type: none"> <i>As-Built Description:</i> No van parking provided (one in every 6 or fraction of 6 accessible spaces, but not less than one. <i>Proposed Solution:</i> Provide van parking space(s) by restriping; provide van sign. 	<p>PCODE EA07 ADAAG 4.1.2(5)(b) ADA 2010 208.2; 502.1 CBC 2010 1129B.3.2 CBC 2013 11B-208.2.4 Priority 1 Severity 2 FY 23-24 Maintenance Work</p>	1	JOB	\$350	\$350
------	--	--	---	-----	-------	-------



2 POT from Driveway to Admin Buildings

Curb Ramp

2620	<ul style="list-style-type: none"> <i>As-Built Description:</i> Detectable warning not provided where pedestrian crosses vehicular area. <i>Proposed Solution:</i> Provide detectable warning surface (i.e. in-line truncated domes) at regular curb ramp. 	<p>PCODE EH07A ADAAG 4.7.7 ADA 2010 705.1 CBC 2010 1127B.5.7 CBC 2013 11B-705.1.2.2 Priority 1 Severity 3 FY 23-24 Maintenance Work</p>	1	JOB	\$250	\$250
------	--	--	---	-----	-------	-------

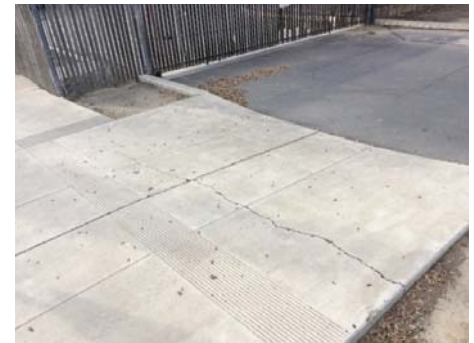

4 POT from Street

Route Sign

2646	<ul style="list-style-type: none"> <i>As-Built Description:</i> No sign by inaccessible route directing persons to an accessible route. <i>Proposed Solution:</i> Provide directional sign. 	<p>PCODE SA20 ADAAG 35.163(b) ADA 2010 216.3 CBC 2010 1127B.3 CBC 2013 11B-216.3 Priority 1 Severity 3 FY 23-24 Maintenance Work</p>	1	JOB	\$170	\$170
------	---	---	---	-----	-------	-------



6 Accessible Space in Secured Staff Lot

Facility: **SHERIFF ADMIN BLDG**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Minimum Number</u>						
2652	<ul style="list-style-type: none"> <i>As-Built Description:</i> At parking lot with 26-50 spaces, the number of accessible spaces is less than required by code; 2 spaces required. <i>As-Built:</i> 0 spaces <i>Proposed Solution:</i> Provide required accessible parking spaces with signs including a minimum of one van space. 	PCODE EA01B ADAAG 4.1.2(5)* ADA 2010 208.2 CBC 2010 Tbl. 11B-6 CBC 2013 11B-208.2 Tbl. 11B-208.2 Priority 1 Severity 2 FY 23-24 Maintenance Work	1	JOB	\$300	\$300



Total Costs for	Part/floor: Exterior	On-site	\$1,070.00
------------------------	-----------------------------	----------------	-------------------

Facility: **SHERIFF ADMIN BLDG**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$1,070.00

Facility: **SHERIFF ADMIN BLDG**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

7 Intake & Staff Entry

Door Swing

1870

• *As-Built Description:*

Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60".

- *As-Built:* 8" 48" to ramp

• *Proposed Solution:*

Provide power door operator.

PCODE ID23C

ADAAG Fig. 25(a)

ADA 2010 404.2.4

CBC 2010 11B-26A(a)

CBC 2013 11B-404.2.4

Priority 1

Severity 3

FY 23-24 Maintenance Work

1 JOB \$5,000 \$5,000



Signage

1867

• *As-Built Description:*

At door leading into exit stairway: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.

• *Proposed Solution:*

Provide raised letter/Braille "EXIT STAIR UP/DOWN" sign at door.

• *Notes:*

1 step and ramp on inside

PCODE SA10B

ADAAG 4.1.3(16)

ADA 2010 216.4.1

CBC 2010 1011.3


CBC 2013 11B-216.4.1

Priority 1

Severity 3

FY 23-24 Maintenance Work

1 JOB \$90 \$90

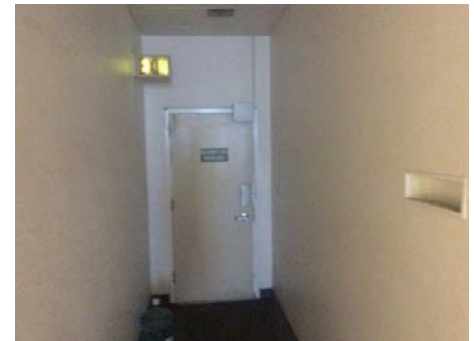

Total Costs for	Part/floor: Interior	Ground Floor	\$5,090.00
------------------------	-----------------------------	---------------------	-------------------

Facility: **SHERIFF ADMIN BLDG**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$5,090.00

Facility: **SHERIFF ADMIN BLDG**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: SHERIFF ADMIN BLDG					\$6,160.00
------------------------	-------------------------------------	--	--	--	--	-------------------

Facility: **SHERIFF'S ADMINISTRATION**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Administration Entrance & Lobby

Brochure Bins

1743	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Information brochure bins mounted above accessible height of 48". • <i>As-Built:</i> 27"-60" • <i>Proposed Solution:</i> Relocate/remount bins at accessible height. 	<p>PCODE IN08</p> <p>ADAAG 4.2.5 & 6</p> <p>ADA 2010 308.2.1</p> <p>CBC 2010 1118B.5</p> <p>CBC 2013 11B-308.2.1</p> <p>Priority 1</p> <p>Severity 2</p> <p>FY 23-24 Maintenance Work</p>	1	JOB	\$100	\$100
------	---	---	---	-----	-------	-------



Carpet/Doormat

1733	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Doormat not securely attached to ground or floor structure. • <i>Proposed Solution:</i> Attach doormat to floor surface or remove doormat. 	<p>PCODE ID05A</p> <p>ADAAG 4.5.3</p> <p>ADA 2010 302.2</p> <p>CBC 2010 1124B.3</p> <p>CBC 2013 11B-302.2</p> <p>Priority 1</p> <p>Severity 3</p> <p>FY 23-24 Maintenance Work</p>	2	JOB	\$75	\$150
------	--	--	---	-----	------	-------



Door

1734	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. • <i>As-Built:</i> 4" • <i>Proposed Solution:</i> Provide 10" min. "kick plate" covering width of door when altering area. 	<p>PCODE ID06</p> <p>ADA 2010 404.2.10</p> <p>CBC 2010 1133B.2.6</p> <p>CBC 2013 11B-404.2.10</p> <p>Priority 1</p> <p>Severity 3</p> <p>FY 23-24 Maintenance Work</p>	1	JOB	\$100	\$100
------	---	---	---	-----	-------	-------



Facility: **SHERIFF'S ADMINISTRATION**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Closer</u>						
1735	<ul style="list-style-type: none"> <i>As-Built Description:</i> Excessive force required to open door. <i>As-Built:</i> 13 lbs <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$25	\$25
						

<u>Protrusion Limits</u>						
1740	<ul style="list-style-type: none"> <i>As-Built Description:</i> Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor. <i>As-Built:</i> 12" protrusion at 42" <i>Proposed Solution:</i> Provide cane-detectable railing to mark area of low clearance. 	PCODE EG04A ADAAG 4.4.1 ADA 2010 307.2 CBC 2010 1133B.8.6.1 CBC 2013 11B-307.2 Priority 1 Severity 1 FY 23-24 Maintenance Work	4"	LF	\$100	\$400
						

1738	<ul style="list-style-type: none"> <i>As-Built Description:</i> Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor. <i>As-Built:</i> 11.5" protrusion at 43.5" <i>Proposed Solution:</i> Provide cane-detectable railing to mark area of low clearance. 	PCODE EG04A ADAAG 4.4.1 ADA 2010 307.2 CBC 2010 1133B.8.6.1 CBC 2013 11B-307.2 Priority 1 Severity 2 FY 23-24 Maintenance Work	4	LF	\$100	\$400
						

Facility: **SHERIFF'S ADMINISTRATION**


Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
1736	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90
						

Total Costs for	Part/floor: Interior	Ground Floor	\$1,265.00
------------------------	-----------------------------	---------------------	-------------------

Facility: **SHERIFF'S ADMINISTRATION**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$1,265.00

Facility: **SHERIFF'S ADMINISTRATION**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: SHERIFF'S ADMINISTRATION					\$1,265.00
------------------------	---	--	--	--	--	-------------------

Facility: **ENVIRONMENTAL OFFICES**

Area: **Exterior**

Part/Floor: **On-site**

Address: 330 CAMPUS DR.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 POT from Accessible Parking Space to Buildings 1 & 2

Detectable Warning

2943

- *As-Built Description:*
36" wide band of truncated domes not provided at walkway or crossing adjoining a vehicular way, if surfaces are not separated by a curb, railing, or other element.
- *Proposed Solution:*
Provide 36" wide, contrasting color, band of truncated domes between pedestrian and vehicular area.

PCODE EG09
 ADAAG 4.29.5
 CBC 2010 1133B.8.5
 CBC 2013 11B-705.1.2.5
 Priority 1
 Severity 3
 FY 23-24 Maintenance Work

60 LF \$27 \$1,620



3 POT from Lacey Blvd. to Buildings. 1 & 2

Route Sign

2947

- *As-Built Description:*
No sign by inaccessible route directing persons to an accessible route.
- *Proposed Solution:*
Provide directional sign.
- **Notes:**
Directional sign recommended.

PCODE SA20
 ADAAG 35.163(b)
 ADA 2010 216.3
 CBC 2010 1127B.3
 CBC 2013 11B-216.3
 Priority 1
 Severity 3
 FY 23-24 Maintenance Work

1 JOB \$170 \$170



4 POT from Accessible Parking Space to Building 2 & 3 Staff Entrance

Detectable Warning

2952

- *As-Built Description:*
36" wide band of truncated domes not provided at walkway or crossing adjoining a vehicular way, if surfaces are not separated by a curb, railing, or other element.
- *Proposed Solution:*
Provide 36" wide, contrasting color, band of truncated domes between pedestrian and vehicular area.

PCODE EG09
 ADAAG 4.29.5
 CBC 2010 1133B.8.5
 CBC 2013 11B-705.1.2.5
 Priority 1
 Severity 3
 FY 23-24 Maintenance Work

84 LF \$27 \$2,268



Total Costs for	Part/floor: Exterior	On-site	\$4,058.00
------------------------	-----------------------------	----------------	-------------------

Facility: **ENVIRONMENTAL OFFICES**

Area: **Exterior**

Part/Floor: **On-site**

Address: 330 CAMPUS DR.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$4,058.00

Facility: **ENVIRONMENTAL OFFICES**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **FY 23-24**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Building 1 Corridor

Carpet/Doormat

2529	<ul style="list-style-type: none"> <i>As-Built Description:</i> Doormat not securely attached to ground or floor structure. <i>Proposed Solution:</i> Attach doormat to floor surface or remove doormat. 	PCODE ID05A ADAAG 4.5.3 ADA 2010 302.2 CBC 2010 1124B.3 CBC 2013 11B-302.2 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$75	\$75
------	--	---	---	-----	------	------



Signage


2526	<ul style="list-style-type: none"> <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.13(16) ADA 2010 216.4.1 CBC 2010 10113 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90
------	--	--	---	-----	------	------



7 Environmental Health Lobby

Brochure Bins


2584	<ul style="list-style-type: none"> <i>As-Built Description:</i> Information brochure bins mounted above accessible height of 48". <i>As-Built:</i> 32"-62" <i>Proposed Solution:</i> Relocate/remount bins at accessible height. 	PCODE IN08 ADAAG 4.2.5 & 6 ADA 2010 308.2.1 CBC 2010 1118B.5 CBC 2013 11B-308.2.1 Priority 1 Severity 2 FY 23-24 Maintenance Work	1	JOB	\$100	\$100
------	---	--	---	-----	-------	-------

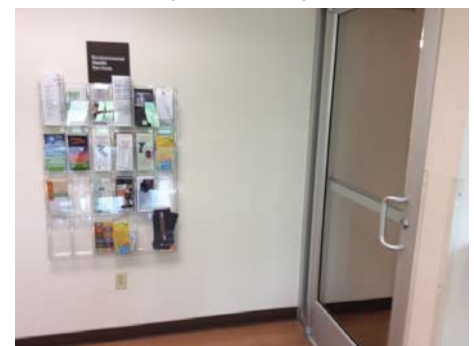



Facility: **ENVIRONMENTAL OFFICES**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **FY 23-24**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Carpet/Doormat</u>						
2578	<ul style="list-style-type: none"> <i>As-Built Description:</i> Doormat not securely attached to ground or floor structure. <i>Proposed Solution:</i> Attach doormat to floor surface or remove doormat. 	PCODE ID05A ADAAG 4.5.3 ADA 2010 302.2 CBC 2010 1124B.3 CBC 2013 11B-302.2 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$75	\$75
						

<u>Door Swing</u>							
2581	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). <i>As-Built:</i> 10" deep <i>Proposed Solution:</i> Provide door operator. 	PCODE ID24CREF ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 1 Severity 2 FY 23-24 Maintenance Work	REF				

<u>Signage</u>						
2582	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work	1	JOB	\$90	\$90
						

Total Costs for Part/floor: Interior Ground Floor \$430.00

Facility: ENVIRONMENTAL OFFICES

Area: Interior

Part/Floor: Ground Floor

Address: 330 CAMPUS DR.

Year to be Completed: FY 23-24

Priority No: 1

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$430.00

Facility: **ENVIRONMENTAL OFFICES**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 CAMPUS DR.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: ENVIRONMENTAL OFFICES					\$4,488.00
------------------------	--	--	--	--	--	-------------------

Facility: **WOMENS INFANTS & CHILDREN**
 Address: 330 HARRIS ST.

Area: **Interior**
 Year to be Completed: **FY 23-24**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

4 Men's Restroom

Door Swing

2788 • *As-Built Description:*

Latch approach: At push side, door does not have clear and level maneuvering space measuring door width plus 24" (starting at hinge) x 42", or 48" if door has closer.

- *As-Built:* 47.5"
- *Proposed Solution:*
Provide door operator.

PCODE ID28C
 ADAAG Fig. 25(c)
 ADA 2010 404.2.4
 CBC 2010 11B-26A(c)
 CBC 2013 11B-404.2.4
 Priority 3
 Severity 4
 FY 23-24 Maintenance Work

1 JOB \$5,000 \$5,000



5 Women's Restroom

Door Swing


2789 • *As-Built Description:*

Latch approach: At push side, door does not have clear and level maneuvering space measuring door width plus 24" (starting at hinge) x 42", or 48" if door has closer.

- *As-Built:* 45"-47"
- *Proposed Solution:*
Provide door operator.

PCODE ID28C
 ADAAG Fig. 25(c)
 ADA 2010 404.2.4
 CBC 2010 11B-26A(c)
 CBC 2013 11B-404.2.4
 Priority 3
 Severity 4
 FY 23-24 Maintenance Work

1 JOB \$5,000 \$5,000

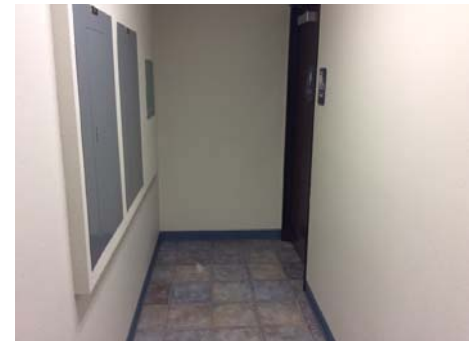

Total Costs for	Part/floor: Interior	Ground Floor	\$10,000.00
------------------------	-----------------------------	---------------------	--------------------

Facility: **WOMENS INFANTS & CHILDREN**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 HARRIS ST.

Year to be Completed: **FY 23-24**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$10,000.00

Facility: **WOMENS INFANTS & CHILDREN**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 HARRIS ST.

Year to be Completed: **FY 23-24**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: WOMENS INFANTS & CHILDREN					\$10,000.00
------------------------	--	--	--	--	--	--------------------

Facility: **PARKS/KART BUILDING**
 Address: 710 NORTH DR.

Area: **Exterior**
 Year to be Completed: **FY 23-24**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Site Entry from North Dr.

Detectable Warning

3570 • *As-Built Description:*
 36" wide band of truncated domes not provided at walkway or crossing adjoining a vehicular way, if surfaces are not separated by a curb, railing, or other element.

• *Proposed Solution:*
 Provide 36" wide, contrasting color, band of truncated domes between pedestrian and vehicular area.

PCODE **EG09**
 ADAAG **4.29.5**
 CBC 2010 **1133B.8.5**
 CBC 2013 **11B-705.1.2.5**
 Priority **1**
 Severity **3**
 FY 23-24 **Maintenance Work**

6 LF \$27 \$162



2 Accessible Parking Space

Parking

3572 • *As-Built Description:*
 No van parking provided (one in every 6 or fraction of 6 accessible spaces, but not less than one).

• *As-Built:* provide sign

• *Proposed Solution:*
 Provide van parking space(s) by restriping; provide van sign.

PCODE **EA07REF**
 ADAAG **4.1.2(5)(b)**
 ADA 2010 **208.2; 502.1**
 CBC 2010 **1129B.3.2**
 CBC 2013 **11B-208.2.4**
 Priority **1**
 Severity **2**
 FY 23-24 **Maintenance Work**

REF



3 POT to Parks and CalVans

Detectable Warning

3577 • *As-Built Description:*
 36" wide band of truncated domes not provided at walkway or crossing adjoining a vehicular way, if surfaces are not separated by a curb, railing, or other element.

• *Proposed Solution:*
 Provide 36" wide, contrasting color, band of truncated domes between pedestrian and vehicular area.

PCODE **EG09**
 ADAAG **4.29.5**
 CBC 2010 **1133B.8.5**
 CBC 2013 **11B-705.1.2.5**
 Priority **1**
 Severity **3**
 FY 23-24 **Maintenance Work**

42 LF \$27 \$1,134



Facility: **PARKS/KART BUILDING**
 Address: 710 NORTH DR.

Area: **Exterior**
 Year to be Completed: **FY 23-24**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3578	<ul style="list-style-type: none"> <i>As-Built Description:</i> 36" wide band of truncated domes not provided at walkway or crossing adjoining a vehicular way, if surfaces are not separated by a curb, railing, or other element. <i>Proposed Solution:</i> Provide 36" wide, contrasting color, band of truncated domes between pedestrian and vehicular area. 	PCODE EG09REF ADAAG 4.29.5 CBC 2010 1133B.8.5 CBC 2013 11B-705.1.2.5 Priority 1 Severity 3 FY 23-24 Maintenance Work	5	REF		



Gate

3581	<ul style="list-style-type: none"> <i>As-Built Description:</i> 10" min kick-plate/accessible operating hardware at gate not provided on push-side of gate and/or gap between floor surface and bottom of gate exceeds 3" max. (required in CA only). <i>Proposed Solution:</i> Provide accessible operating hardware and 10" min. "kick plate" covering width of gate when altering area. <i>Notes:</i> Not Acc. route. also no pull side landing. locked. 	PCODE ID06BREF ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 1 Severity 3 FY 23-24 Maintenance Work		REF		
------	---	--	--	-----	--	--



Total Costs for	Part/floor: Exterior	On-site	\$1,296.00
------------------------	-----------------------------	----------------	-------------------

Facility: **PARKS/KART BUILDING**

Area: **Exterior**

Part/Floor: **On-site**

Address: 710 NORTH DR.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$1,296.00

Facility: **PARKS/KART BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 710 NORTH DR.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Parks Main Entrance

Signage

3495	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	<p>PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 1 Severity 3 FY 23-24 Maintenance Work</p>	2	JOB	\$90	\$180
------	--	---	---	-----	------	-------



5 CalVans Main Entrance


Brochure Bins

3540	<ul style="list-style-type: none"> <i>As-Built Description:</i> Information brochure bins mounted above accessible height of 48". <i>As-Built:</i> 74" <i>Proposed Solution:</i> Relocate/remount bins at accessible height. <i>Notes:</i> provide same at lower. 	<p>PCODE IN08 ADAAG 4.2.5 & 6 ADA 2010 308.2.1 CBC 2010 1118B.5 CBC 2013 11B-308.2.1 Priority 1 Severity 1 FY 23-24 Maintenance Work</p>	1	JOB	\$100	\$100
------	---	---	---	-----	-------	-------



Carpet/Doormat

3523	<ul style="list-style-type: none"> <i>As-Built Description:</i> Doormat not securely attached to ground or floor structure. <i>Proposed Solution:</i> Attach doormat to floor surface or remove doormat. 	<p>PCODE ID05A ADAAG 4.5.3 ADA 2010 302.2 CBC 2010 1124B.3 CBC 2013 11B-302.2 Priority 1 Severity 3 FY 23-24 Maintenance Work</p>	1	JOB	\$75	\$75
------	--	--	---	-----	------	------

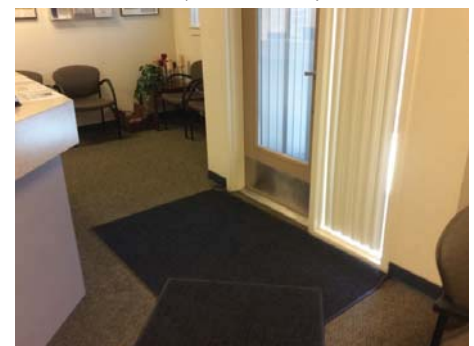

Total Costs for	Part/floor: Interior	Ground Floor	\$355.00
------------------------	-----------------------------	---------------------	-----------------

Facility: **PARKS/KART BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 710 NORTH DR.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$355.00

Facility: **PARKS/KART BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 710 NORTH DR.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: PARKS/KART BUILDING	\$1,651.00
------------------------	--------------------------------------	-------------------

Facility: **LEMORE HEALTH CLINIC**
 Address: 229 C ST.

Area: **Interior**
 Year to be Completed: **FY 23-24**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

3 Lobby Restroom - Men's

Door Swing

- 4405
- *As-Built Description:*
 Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60".
 - *As-Built:* 15" to lav
 - *Proposed Solution:*
 Provide power door operator.

PCODE ID23C
 ADAAG Fig. 25(a)
 ADA 2010 404.2.4
 CBC 2010 11B-26A(a)
 CBC 2013 11B-404.2.4
 Priority 3
 Severity 4
 FY 23-24 Maintenance Work

1 JOB \$5,000 \$5,000



Total Costs for	Part/floor: Interior	Ground Floor				\$5,000.00
------------------------	-----------------------------	---------------------	--	--	--	-------------------

Facility: **LEMORE HEALTH CLINIC**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 229 C ST.

Year to be Completed: **FY 23-24**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$5,000.00

Facility: **LEMORE HEALTH CLINIC**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 229 C ST.

Year to be Completed: **FY 23-24**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: LEMORE HEALTH CLINIC					\$5,000.00
------------------------	---------------------------------------	--	--	--	--	-------------------

Facility: **KINGSTON PARK RESTROOM**
 Address: 13196 DOUGLAS AVE.

Area: **Exterior**
 Year to be Completed: **FY 23-24**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

3 Accessible Parking

Curb Ramp

- 4909
- As-Built Description:**
Detectable warning not provided where pedestrian crosses vehicular area.
 - Proposed Solution:**
Provide detectable warning surface (i.e. in-line truncated domes) at regular curb ramp.

PCODE EH07AREF
 ADAAG 4.7.7
 ADA 2010 705.1
 CBC 2010 1127B.5.7
 CBC 2013 11B-705.1.2.2
 Priority 1
 Severity 3
 FY 23-24 Maintenance Work

REF



Minimum Number

- 4912
- As-Built Description:**
At parking lot with 76-100 spaces, the number of accessible spaces is less than required by code; 4 spaces required.
 - Proposed Solution:**
Provide required accessible parking spaces with signs including a minimum of one van space.
 - Notes:**
Approx. 80 spaces
2 Acc
0 van

PCODE EA01D
 ADAAG 4.1.2(5)*
 ADA 2010 208.2
 CBC 2010 Tbl. 11B-6
 CBC 2013 11B-208.2 Tbl. 11B-208.2
 Priority 1
 Severity 2
 FY 23-24 Maintenance Work

1 JOB \$300 \$300



Parking

- 4907
- As-Built Description:**
No van parking provided (one in every 6 or fraction of 6 accessible spaces, but not less than one).
 - Proposed Solution:**
Provide van parking space(s) by restriping; provide van sign.

PCODE EA07
 ADAAG 4.1.2(5)(b)
 ADA 2010 208.2; 502.1
 CBC 2010 1129B.3.2
 CBC 2013 11B-208.2.4
 Priority 1
 Severity 2
 FY 23-24 Maintenance Work

1 JOB \$350 \$350



Total Costs for	Part/floor: Exterior	On-site	\$650.00
------------------------	-----------------------------	----------------	-----------------

Facility: **KINGSTON PARK RESTROOM**

Area: **Exterior**

Part/Floor: **On-site**

Address: 13196 DOUGLAS AVE.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$650.00

Facility: **KINGSTON PARK RESTROOM**

Area: **Exterior**

Part/Floor: **On-site**

Address: 13196 DOUGLAS AVE.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: KINGSTON PARK RESTROOM					\$650.00
------------------------	---	--	--	--	--	-----------------

Facility: **KINGSTON PARK RESTROOM**

Area: **Exterior**

Part/Floor: **On-site**

Address: 13196 DOUGLAS AVE.

Year to be Completed: **FY 23-24**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Year to be Completed: FY 23-24					\$99,937.00
------------------------	---------------------------------------	--	--	--	--	--------------------

Facility: **GOVERNMENT CENTER CAMPUS**
 Address: 1400 W. LACEY BLVD.

Area: **Exterior**
 Year to be Completed: **FY 24-25**

Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

19 POT from Probation to Law Building

Ramps

2590

• *As-Built Description:*

Ramp needed to provide disabled access at steps or change of level along path of travel.

• *Proposed Solution:*

Provide new concrete ramp with handrails [slope more than 1:20 (5.0%) needed].

• *Notes:*

Loading Ramp. Provide directional signage.

PCODE **EB01AREF**

ADAAG **4.1.1**

ADA 2010 **303.4**

CBC 2010 **1127B.1**

CBC 2013 **11B-303.4**

Priority **2**

Severity **3**

FY 24-25 **Contract Work**

REF



Total Costs for Part/floor: Exterior On-site

Facility: **GOVERNMENT CENTER CAMPUS**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

Facility: **GOVERNMENT CENTER CAMPUS**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Facility: GOVERNMENT CENTER CAMPUS

Facility: **ADMINISTRATION BUILDING**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 24-25**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 Large Meeting Room

Door


349	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 2.6% at SW exit door <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11REF ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 4 FY 24-25 Contract Work				
-----	--	---	--	--	--	--

REF



Door Swing

344	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18"(CA only: 24" at exterior doors)x 60". <i>As-Built:</i> Exterior: Door width + 6" <i>Proposed Solution:</i> Extend maneuvering space. 	PCODE ID23D ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 3 FY 24-25 Contract Work	1	JOB	\$800	\$800
-----	--	--	---	-----	-------	-------

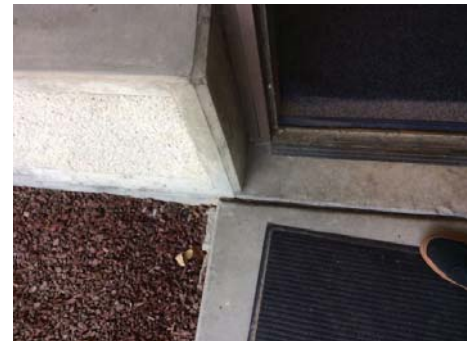

Door Threshold


345	<ul style="list-style-type: none"> <i>As-Built Description:</i> Existing threshold at door is 1/2" high or less but without a beveled edge on both sides. <i>As-Built:</i> No bevel <i>Proposed Solution:</i> Modify threshold to have beveled edge on each side. 	PCODE ID02 ADAAG 4.1.6(3)(d)(ii) ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 2 Severity 4 FY 24-25 Contract Work	2	JOB	\$250	\$500
-----	--	---	---	-----	-------	-------




Facility: **ADMINISTRATION BUILDING**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 24-25**


Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Sink						
354	<ul style="list-style-type: none"> As-Built Description: Sink is more than 6 1/2" deep. As-Built: 10" deep Proposed Solution: Provide new sink remodel and cabinet as needed. 	PCODE IN06BREF ADAAG 4.24.4 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.7 Priority 2 Severity 3 FY 24-25 Contract Work				
						REF
						

353	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 36" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 2 Severity 4 FY 24-25 Contract Work				
						REF
						

6 Board of Supervisors

Disabled Seating

419	<ul style="list-style-type: none"> As-Built Description: Wheelchair space (33"x48") not provided at fixed seating with forward or rear approach. (NOTE: Space must be adjacent to regular seating; can provide easily removable fixed seat). As-Built: 7.5-7.1% slope Proposed Solution: Remove fixed seating and provide wheelchair space plus necessary maneuvering clearance. Notes: 73 seats. Modify flooring 	PCODE GB01A ADAAG 4.1.3(19)(a) ADA 2010 221.2 CBC 2010 1104B.3.6 CBC 2013 11B-221.2 Priority 2 Severity 3 FY 24-25 Contract Work	2	JOB	\$450	\$900
						

Facility: **ADMINISTRATION BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Swing</u>						
414	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18"(CA only: 24" at exterior doors)x 60". <i>As-Built:</i> Exterior 10" <i>Proposed Solution:</i> Extend maneuvering space. 	PCODE ID23D ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 3 FY 24-25 Contract Work	1	JOB	\$800	\$800
						

<u>Stairway</u>						
425	<ul style="list-style-type: none"> <i>As-Built Description:</i> Stair tread width less than 11", measured horizontally from nosing to nosing. <i>As-Built:</i> Nonuniform <i>Proposed Solution:</i> Rebuild stair as needed. 	PCODE II02E ADAAG 4.9.2 ADA 2010 504.2 CBC 2010 1133B.4.5.3 CBC 2013 11B-504.2 Priority 2 Severity 3 FY 24-25 Contract Work	1	JOB	\$2,000	\$2,000
						


9 Admin & Board of Supervisor Conference Room

<u>Sink</u>							
458	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink is more than 6 1/2" deep. <i>As-Built:</i> 10" <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed. 	PCODE IN06BREF ADAAG 4.24.4 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.7 Priority 2 Severity 3 FY 24-25 Contract Work	REF				

Facility: **ADMINISTRATION BUILDING**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 24-25**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
457	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 35.75" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 2 Severity 4 FY 24-25 Contract Work				
						REF
						

Total Costs for	Part/floor: Interior	Ground Floor	\$5,000.00
------------------------	-----------------------------	---------------------	-------------------

Facility: **ADMINISTRATION BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$5,000.00

Facility: **ADMINISTRATION BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: ADMINISTRATION BUILDING					\$5,000.00
------------------------	--	--	--	--	--	-------------------

Facility: **HANFORD LIBRARY**
 Address: 401 N. DOUTY ST.

Area: **Exterior**
 Year to be Completed: **FY 24-25**

Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

5 Bench Area

Cross Slope

- 3134
- *As-Built Description:*
Cross slope more than 1":48" (2.083%).
 - *As-Built:* 2.8%
 - *Proposed Solution:*
Modify cross slope.

PCODE EF07
 ADAAG 4.3.7
 ADA 2010 403.3
 CBC 2010 1133B.7.1.3
 CBC 2013 11B-403.3
 Priority 2
 Severity 4
 FY 24-25 Contract Work

25 SF \$25 **\$625**



Total Costs for	Part/floor: Exterior	On-site	\$625.00
------------------------	-----------------------------	----------------	-----------------

Facility: **HANFORD LIBRARY**

Area: **Exterior**

Part/Floor: **On-site**

Address: 401 N. DOUTY ST.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$625.00

Facility: **HANFORD LIBRARY**
 Address: 401 N. DOUTY ST.

Area: **Interior**
 Year to be Completed: **FY 24-25**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------


3 Mezzanine

Open Risers

- 2990
- *As-Built Description:*
Stair does not have closed risers.
 - *Proposed Solution:*
Modify stair to have closed risers

PCODE **EC03**
 ADAAG **4.9.2**
 ADA 2010 **504.3**
 CBC 2010 **1133B.4.5.3**
 CBC 2013 **11B-504.3**
 Priority **2**
 Severity **3**
 FY 24-25 **Contract Work**

32 LF \$36 **\$1,152**

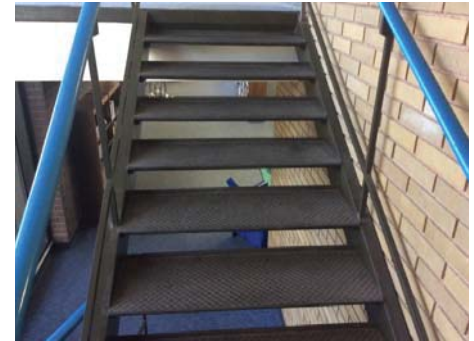

Stairway

- 2993
- *As-Built Description:*
The leading 2" of the tread does not have visual contrast of dark-on-light or light-on-dark from the remainder of the tread.
 - *Proposed Solution:*
Provide 2" wide contrasting color strip 1" max. from nosing on top & bottom treads when altering area.
 - *Notes:*
Both sets of stairs

PCODE **II02B**
 ADA 2010 **504.4**
 CBC 2010 **1133B.4.4**
 CBC 2013 **11B-504.4.1**
 Priority **2**
 Severity **3**
 FY 24-25 **Contract Work**

32 LF \$14 **\$448**



Total Costs for	Part/floor: Interior	Ground Floor	\$1,600.00
------------------------	-----------------------------	---------------------	-------------------

Facility: **HANFORD LIBRARY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 401 N. DOUTY ST.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$1,600.00

Facility: **HANFORD LIBRARY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 401 N. DOUTY ST.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: HANFORD LIBRARY					\$2,225.00
------------------------	----------------------------------	--	--	--	--	-------------------

Facility: **HICKEY PARK**
 Address: 16850 FLINT AVE.

Area: **Exterior**
 Year to be Completed: **FY 24-25**

Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

5 Accessible Parking Space by Volleyball Court

Accessible Route

- 5128
- *As-Built Description:*
No walk / sidewalk provided to connect accessible facilities or elements that are on the same site.
 - *As-Built:* to drinking fountain and volleyball
 - *Proposed Solution:*
Provide new 48" wide walk / sidewalk.

PCODE EF13
 ADAAG 4.3.2
 ADA 2010 206.1
 CBC 2010 1114B.1.2
 CBC 2013 11B-206.1
 Priority 2
 Severity 3
 FY 24-25 Contract Work

100 LF \$45 \$4,500



7 Upper Lot Serving Area 22 & Play Structure

Accessible Route

- 5150
- *As-Built Description:*
No walk / sidewalk provided to connect accessible facilities or elements that are on the same site.
 - *Proposed Solution:*
Provide new 48" wide walk / sidewalk.

PCODE EF13
 ADAAG 4.3.2
 ADA 2010 206.1
 CBC 2010 1114B.1.2
 CBC 2013 11B-206.1
 Priority 2
 Severity 3
 FY 24-25 Contract Work

15 LF \$45 \$675



Total Costs for	Part/floor: Exterior	On-site	\$5,175.00
------------------------	-----------------------------	----------------	-------------------

Facility: **HICKEY PARK**
Address: 16850 FLINT AVE.

Area: **Exterior**
Year to be Completed: **FY 24-25**

Part/Floor: **On-site**
Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Area: Exterior					\$5,175.00
------------------------	-----------------------	--	--	--	--	-------------------

Facility: **HICKEY PARK**
Address: 16850 FLINT AVE.

Area: **Exterior**
Year to be Completed: **FY 24-25**

Part/Floor: **On-site**
Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: HICKEY PARK					\$5,175.00
------------------------	------------------------------	--	--	--	--	-------------------

Facility: **BURRIS PARK**
 Address: 6500 CLINTON AVE.

Area: **Exterior**
 Year to be Completed: **FY 24-25**


Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------


1 East Accessible Spaces & Picnic Area B

Accessible Route

5040	<ul style="list-style-type: none"> As-Built Description: No walk / sidewalk provided to connect accessible facilities or elements that are on the same site. Proposed Solution: Provide new 48" wide walk / sidewalk. 	<p>PCODE EF13 ADAAG 4.3.2 ADA 2010 206.1 CBC 2010 1114B.1.2 CBC 2013 11B-206.1 Priority 2 Severity 3 FY 24-25 Contract Work</p>	10	LF	\$45	\$450
------	---	--	----	----	------	--------------




5044	<ul style="list-style-type: none"> As-Built Description: No walk / sidewalk provided to connect accessible facilities or elements that are on the same site. Proposed Solution: Provide new 48" wide walk / sidewalk. Notes: To play area and horse shoe area 	<p>PCODE EF13 ADAAG 4.3.2 ADA 2010 206.1 CBC 2010 1114B.1.2 CBC 2013 11B-206.1 Priority 2 Severity 3 FY 24-25 Contract Work</p>	90	LF	\$45	\$4,050
------	--	--	----	----	------	----------------



Changes in Level

5036	<ul style="list-style-type: none"> As-Built Description: Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route. As-Built: 1.5" Proposed Solution: Remove, replace or repair area of pavement sufficient to correct abrupt change in level. 	<p>PCODE EF03 ADAAG 4.3.8 ADA 2010 403.4 CBC 2010 1133B.7.4 CBC 2013 11B-403.4 Priority 2 Severity 3 FY 24-25 Contract Work</p>	4	SF	\$21	\$84
------	---	--	---	----	------	-------------



Facility: **BURRIS PARK**
 Address: 6500 CLINTON AVE.

Area: **Exterior**
 Year to be Completed: **FY 24-25**

Part/Floor: **On-site**
 Priority No: **2**




Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Sink						
5238	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink faucet controls not accessible. <i>Proposed Solution:</i> Provide accessible sink faucet controls. 	PCODE IN07 ADAAG 4.24.7 ADA 2010 606.4 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.4 Priority 2 Severity 3 FY 24-25 Contract Work	1	JOB	\$600	\$600
						

Table						
5043	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> Prep table 20" high knee space. <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 FY 24-25 Contract Work	1	JOB	\$1,600	\$1,600
						

Walk						
5042	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk more than 36" but less than 48" wide (required in CA only). <i>As-Built:</i> 31" <i>Proposed Solution:</i> Enlarge width of walk to 48". 	PCODE EF08 CBC 2010 1133B.7.1 CBC 2013 11B-403.5.1.3 Priority 2 Severity 2 FY 24-25 Contract Work	96	SF	\$45	\$4,320
						

3 Accessible Parking & Picnic Area Y

Facility: **BURRIS PARK**
 Address: 6500 CLINTON AVE.

Area: **Exterior**
 Year to be Completed: **FY 24-25**

Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Changes in Level

- 5078
- *As-Built Description:*
Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route.
 - *As-Built:* 3"
 - *Proposed Solution:*
Remove, replace or repair area of pavement sufficient to correct abrupt change in level.

PCODE EF03REF
 ADAAG 4.3.8
 ADA 2010 403.4
 CBC 2010 1133B.7.4
 CBC 2013 11B-403.4
 Priority 2
 Severity 2
 FY 24-25 Contract Work

REF



Height

- 5062
- *As-Built Description:*
Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings.
 - *As-Built:* 32"
 - *Proposed Solution:*
Remove existing and provide new handrail.

PCODE ED02REF
 ADAAG 4.9.4(5)
 ADA 2010 505.4
 CBC 2010 1133B.4.2.1 &
 CBC 2013 11B-505.4
 Priority 2
 Severity 3
 FY 24-25 Contract Work

REF



Open Risers

- 5063
- *As-Built Description:*
Stair does not have closed risers.
 - *Proposed Solution:*
Modify stair to have closed risers

PCODE EC03
 ADAAG 4.9.2
 ADA 2010 504.3
 CBC 2010 1133B.4.5.3
 CBC 2013 11B-504.3
 Priority 2
 Severity 3
 FY 24-25 Contract Work


40 LF \$36 \$1,440





Facility: **BURRIS PARK**
 Address: 6500 CLINTON AVE.

Area: **Exterior**
 Year to be Completed: **FY 24-25**

Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Picnic Area</u>						
5074	<ul style="list-style-type: none"> <i>As-Built Description:</i> Knee clearance at minimums 27" high, 30" wide, and 19" deep is not provided. <i>As-Built:</i> Tables ok but bolts may scratch wheelchair user. <i>Proposed Solution:</i> Modify picnic table as required to provide knee clearance. <i>Notes:</i> Ensure that designated Acc. tables do not have sharp abrasive surfaces below. 	PCODE NH11A ADAAG 16.5.4. ADA 2010 902.2 CBC 2010 1132B.1 CBC 2013 11-902.2 Priority 2 Severity 2 FY 24-25 Contract Work	1	JOB	\$850	\$850
						


<u>Ramps</u>						
5059	<ul style="list-style-type: none"> <i>As-Built Description:</i> Ramp needed to provide disabled access at steps or change of level along path of travel. <i>Proposed Solution:</i> Provide new concrete ramp with handrails [slope more than 1:20 (5.0%) needed]. <i>Notes:</i> 27" high 	PCODE EB01A ADAAG 4.1.1 ADA 2010 303.4 CBC 2010 1127B.1 CBC 2013 11B-303.4 Priority 2 Severity 3 FY 24-25 Contract Work	108	SF	\$100	\$10,800
						

<u>Surfacing</u>						
5077	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible route within 8'-0" of play equipment is not firm, resilient safety surfacing. <i>Proposed Solution:</i> Provide 8'-0" resilient surfacing around play structure. 	PCODE OA01 ADAAG 36 CFR Part 1191 ADA 2010 1008.2.6 CBC 2010 DSA 99-02 CBC 2013 11B-1008.2.6 Priority 2 Severity 3 FY 24-25 Contract Work	400	SF	\$9	\$3,600
						


Facility: **BURRIS PARK**
 Address: 6500 CLINTON AVE.

Area: **Exterior**
 Year to be Completed: **FY 24-25**


Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
5079	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible route within 8'-0" of play equipment is not firm, resilient safety surfacing. <i>Proposed Solution:</i> Provide 8'-0" resilient surfacing around play structure. 	PCODE OA01REF ADAAG 36 CFR Part 1191 ADA 2010 1008.2.6 CBC 2010 DSA 99-02 CBC 2013 11B-1008.2.6 Priority 2 Severity 3 FY 24-25 Contract Work				
			REF			
						

Table

5066	<ul style="list-style-type: none"> <i>As-Built Description:</i> Prep counter (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> Top 36" prep table. no knee space. <i>Proposed Solution:</i> Modify table 	PCODE IN02 ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 Priority 2 Severity 2 FY 24-25 Contract Work	1	JOB	\$2,500	\$2,500
						

Top & Bottom Extension at Stairs


5060	<ul style="list-style-type: none"> <i>As-Built Description:</i> Stair handrail does not extend horizontally 12" minimum beyond top nosing, and one tread width sloped, plus 12" minimum horizontally beyond the bottom nosing. <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for each extension piece). 	PCODE ED06REF ADAAG 4.9.4(2) ADA 2010 505.10.2; 505.10.3 CBC 2010 1133B.4.2.2 CBC 2013 11B-505.10.2; 11B-505.10.3 Priority 2 Severity 2 FY 24-25 Contract Work				
			REF			
						

8 Multi-Purpose Bldg

Facility: **BURRIS PARK**
 Address: 6500 CLINTON AVE.

Area: **Exterior**
 Year to be Completed: **FY 24-25**

Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Accessible Route</u>						
5112	<ul style="list-style-type: none"> <i>As-Built Description:</i> No walk / sidewalk provided to connect accessible facilities or elements that are on the same site. <i>Proposed Solution:</i> Provide new 48" wide walk / sidewalk. <i>Notes:</i> recommen providing picnic areas due to proximity of Acc. parking and restrooms. Areas H,G,F, and or V 	PCODE EF13 ADAAG 4.3.2 ADA 2010 206.1 CBC 2010 1114B.1.2 CBC 2013 11B-206.1 Priority 2 Severity 3 FY 24-25 Contract Work	150	LF	\$45	\$6,750
						

Total Costs for	Part/floor: Exterior	On-site	\$37,044.00
------------------------	-----------------------------	----------------	--------------------

Facility: **BURRIS PARK**

Area: **Exterior**

Part/Floor: **On-site**

Address: 6500 CLINTON AVE.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$37,044.00

Facility: **BURRIS PARK**
 Address: 6500 CLINTON AVE.

Area: **Interior-Multi-Purpose**
 Year to be Completed: **FY 24-25**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Multi-Purpose Bldg.

Sink

5209

- *As-Built Description:*
Hot or sharp-surfaced water/drain pipe not insulated or covered.
- *Proposed Solution:*
Insulate or cover water/drain pipe.

PCODE **IN06C**
 ADAAG **4.24.6**
 ADA 2010 **606.5**
 CBC 2010 **1115B.4.7.1**
 CBC 2013 **11B-606.5**
 Priority **2**
 Severity **3**
 FY 24-25 **Contract Work**

1 JOB \$120 \$120



Total Costs for	Part/floor: Interior-Multi-	Ground Floor	\$120.00
------------------------	------------------------------------	---------------------	-----------------

Facility: **BURRIS PARK**

Area: **Interior-Multi-Purpose**

Part/Floor: **Ground Floor**

Address: 6500 CLINTON AVE.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Area: Interior-Multi-Purpose	\$120.00
------------------------	-------------------------------------	-----------------

Facility: **BURRIS PARK**

Area: **Interior-Multi-Purpose**

Part/Floor: **Ground Floor**

Address: 6500 CLINTON AVE.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Facility: BURRIS PARK \$37,164.00

Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 24-25**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 Human Resources

Door Hardware

3601	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door does not have accessible operating hardware. <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$250	\$250
------	--	---	---	-----	-------	-------



Signage

3598	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille (1/10" on center dots with 2/10" space between cells). <i>Notes:</i> Lacks braille and tactile letters 	PCODE SA07A ADAAG 4.30.4 ADA 2010 703.2 CBC 2010 1117B.5.6 CBC 2013 11B-703.3 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$90	\$90
------	--	--	---	-----	------	------



3609	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille (1/10" on center dots with 2/10" space between cells). <i>Notes:</i> Lacks braille and tactile letters. Also has glare. 	PCODE SA07A ADAAG 4.30.4 ADA 2010 703.2 CBC 2010 1117B.5.6 CBC 2013 11B-703.3 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$90	\$90
------	---	--	---	-----	------	------



Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 24-25**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3611	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille (1/10" on center dots with 2/10" space between cells). 	PCODE SA07A ADAAG 4.30.4 ADA 2010 703.2 CBC 2010 1117B.5.6 CBC 2013 11B-703.3 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$90	\$90



3 Restroom Corridor & Credentials


Electrical

3619	<ul style="list-style-type: none"> <i>As-Built Description:</i> Electric switch or control mounted less than 36" or more than 48" above floor to center. <i>As-Built:</i> Light switch: 54" <i>Proposed Solution:</i> Relocate light switches or control to between 36" and 48" height. 	PCODE IC01 ADAAG 4.2.5 & 6 ADA 2010 308.2.1 & 308.2.2 CBC 2010 1117B.6.3 CBC 2013 11B-308.2.1 & 11B-308.2.2 Priority 2 Severity 3 FY 24-25 Maintenance Work	3	JOB	\$300	\$900
------	--	--	---	-----	-------	-------



Signage

3627	<ul style="list-style-type: none"> <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	PCODE SA10D ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$90	\$90
------	--	--	---	-----	------	------

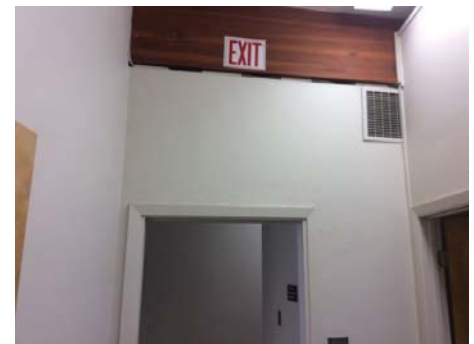


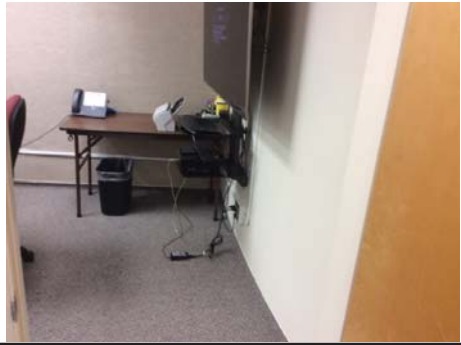
4 Conference Room

Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **FY 24-25**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Hardware</u>						
3620	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door does not have accessible operating hardware. <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07REF ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work				
						REF
						

<u>Protrusion Limits</u>						
3625	<ul style="list-style-type: none"> <i>As-Built Description:</i> Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor. <i>As-Built:</i> TV: 9" protrusion at 44" and in clear space of door. <i>Proposed Solution:</i> Remove/relocate protruding object. Patch existing surface. 	PCODE EG04 ADAAG 4.4.1 ADA 2010 307.2 CBC 2010 1133B.8.6.1 CBC 2013 11B-307.2 Priority 2 Severity 2 FY 24-25 Maintenance Work	1	JOB	\$100	\$100
						


6 Large Conference Room


<u>Door</u>						
3642	<ul style="list-style-type: none"> <i>As-Built Description:</i> Vision Light at door that permits viewing, does not have bottom of at least one glazed panel located 43 inches maximum above the finish floor. (Exception: More than 66" above finished floor.) <i>As-Built:</i> 55" <i>Proposed Solution:</i> Provide new door with vision panel at 43" max. 	PCODE ID06C ADA 2010 404.2.11 CBC 2013 11B-404.2.11 Priority 2 Severity 2 FY 24-25 Maintenance Work	1	JOB	\$2,500	\$2,500
						


Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 24-25**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Closer</u>						
3645	<ul style="list-style-type: none"> <i>As-Built Description:</i> Excessive force required to open door. <i>As-Built:</i> 13 lbs <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$25	\$25
						


<u>Door Hardware</u>						
3634	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door does not have accessible operating hardware. <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$250	\$250
						


<u>Door Stopper</u>						
3643	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$25	\$25
						

Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **FY 24-25**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Electrical						
3636	<ul style="list-style-type: none"> <i>As-Built Description:</i> Electric switch or control mounted less than 36" or more than 48" above floor to center. <i>As-Built:</i> 55"-58" various items <i>Proposed Solution:</i> Relocate light switches or control to between 36" and 48" height. 	PCODE IC01 ADAAG 4.2.5 & 6 ADA 2010 308.2.1 & 308.2.2 CBC 2010 1117B.6.3 CBC 2013 11B-308.2.1 & 11B-308.2.2 Priority 2 Severity 3 FY 24-25 Maintenance Work	4	JOB	\$300	\$1,200
						

Signage						
3641	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$90	\$90
						

7 Server Room


Signage						
3647	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille (1/10" on center dots with 2/10" space between cells). 	PCODE SA07ANT ADAAG 4.30.4 ADA 2010 703.2 CBC 2010 1117B.5.6 CBC 2013 11B-703.3 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$150	\$150
						


11 Business Services


Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 24-25**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Hardware</u>						
3695	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door does not have accessible operating hardware. <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$250	\$250
						

<u>Door Stopper</u>						
3696	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$25	\$25
						

<u>Door Swing</u>						
3699	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". <i>As-Built:</i> 20" to book shelf <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID23A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 2 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
						


Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Interior**

Part/Floor: **Ground Floor**

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
3694	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille (1/10" on center dots with 2/10" space between cells). 	PCODE SA07A ADAAG 4.30.4 ADA 2010 703.2 CBC 2010 1117B.5.6 CBC 2013 11B-703.3 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$90	\$90
						

Total Costs for	Part/floor: Interior	Ground Floor				\$6,265.00
------------------------	-----------------------------	---------------------	--	--	--	-------------------

Facility: **SUPERINTENDENT OF SCHOOLS**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1144 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Area: Interior	\$6,265.00
------------------------	-----------------------	-------------------

Facility: **SUPERINTENDENT OF SCHOOLS**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1144 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: SUPERINTENDENT OF SCHOOLS	\$6,265.00
------------------------	--	-------------------

Facility: **JOB TRAINING OFFICE**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

4 Career Center

Brochure Bins

3826

- *As-Built Description:*
Information brochure bins mounted above accessible height of 48".
- *As-Built:* 12"-59"
- *Proposed Solution:*
Relocate/remount bins at accessible height.
- *Notes:*
Provide same at Acc. Heights

PCODE IN08
 ADAAG 4.2.5 & 6
 ADA 2010 308.2.1
 CBC 2010 1118B.5
 CBC 2013 11B-308.2.1
 Priority 2
 Severity 3
 FY 24-25 Maintenance Work

1 JOB \$100 \$100



5 EDD Staff Area


Door Swing

3829

- *As-Built Description:*
Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60".
- *Proposed Solution:*
- *Notes:*
provide dual swing gate.

PCODE ID23ANT
 ADAAG Fig. 25(a)
 ADA 2010 404.2.4
 CBC 2010 11B-26A(a)
 CBC 2013 11B-404.2.4
 Priority 2
 Severity 2
 FY 24-25 Maintenance Work

1 JOB \$50 \$50

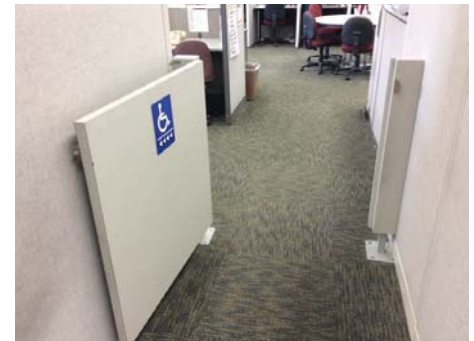

9 Conference Room

Door

3844

- *As-Built Description:*
At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface.
- *As-Built:* 4"
- *Proposed Solution:*
Provide 10" min. "kick plate" covering width of door when altering area.

PCODE ID06
 ADA 2010 404.2.10
 CBC 2010 1133B.2.6
 CBC 2013 11B-404.2.10
 Priority 2
 Severity 3
 FY 24-25 Maintenance Work

1 JOB \$100 \$100



Facility: **JOB TRAINING OFFICE**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 124 N. IRWIN ST.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Swing</u>						
3843	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). <i>As-Built:</i> Door blocked and stuck. <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID24A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 2 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
						

<u>Signage</u>						
3840	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sign designating a permanent room or space does not include Grade 2 Braille. <i>As-Built:</i> characters not raised <i>Proposed Solution:</i> Provide new compliant signage including California Grade 2 Braille (1/10" on center dots with 2/10" space between cells). 	PCODE SA07AREF ADAAG 4.30.4 ADA 2010 703.2 CBC 2010 1117B.5.6 CBC 2013 11B-703.3 Priority 2 Severity 3 FY 24-25 Maintenance Work	REF			

3839	<ul style="list-style-type: none"> <i>As-Built Description:</i> Braille symbols: dots are not 1/10" on centers in each cell with 2/10" space between cells. <i>Proposed Solution:</i> CA only - Provide new compliant signage including Contracted Grade 2 Braille with Title 24 spacing requirements - 1/10" on center dots with 2/10" space between cells. 	PCODE SA07C ADA 2010 703.3 CBC 2010 1117B.5.6 CBC 2013 11B-703.3 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$150	\$150
						

Total Costs for	Part/floor: Interior	Ground Floor	\$450.00
------------------------	-----------------------------	---------------------	-----------------

Facility: **JOB TRAINING OFFICE**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Area: Interior **\$450.00**

Facility: **JOB TRAINING OFFICE**

Area: **Interior-EDC**

Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

15 EDC Conference Room

Door Swing

3876

• *As-Built Description:*

Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60".

• *As-Built:* 32" to table.

• *Proposed Solution:*

Remove or relocate furniture or storage items.

• *Notes:*

Slide down past 18" from strike side of door.

PCODE ID23A

ADAAG Fig. 25(a)

ADA 2010 404.2.4

CBC 2010 11B-26A(a)


CBC 2013 11B-404.2.4

Priority 2

Severity 2

FY 24-25 Maintenance Work

1 JOB \$50 \$50

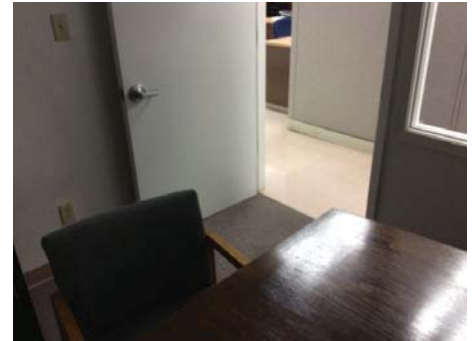

Total Costs for	Part/floor: Interior-EDC	Ground Floor	\$50.00
------------------------	---------------------------------	---------------------	----------------

Facility: **JOB TRAINING OFFICE**

Area: **Interior-EDC**

Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior-EDC

\$50.00

Facility: **JOB TRAINING OFFICE**

Area: **Interior-EDC**

Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: JOB TRAINING OFFICE					\$500.00
------------------------	--------------------------------------	--	--	--	--	-----------------

Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 24-25**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

3 Minors Advocates Offices


Carpet/Doormat

959	<ul style="list-style-type: none"> <i>As-Built Description:</i> Doormat not securely attached to ground or floor structure. <i>Proposed Solution:</i> Attach doormat to floor surface or remove doormat. 	PCODE ID05A ADAAG 4.5.3 ADA 2010 302.2 CBC 2010 1124B.3 CBC 2013 11B-302.2 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$75	\$75
-----	--	---	---	-----	------	------




Door Stopper

958	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$25	\$25
-----	---	--	---	-----	------	------

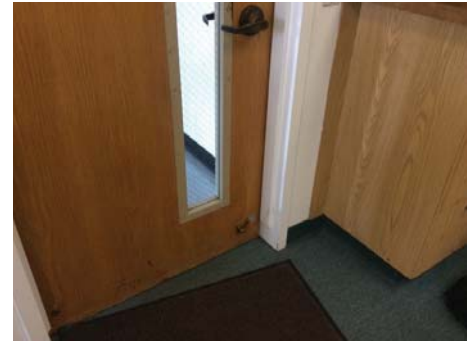

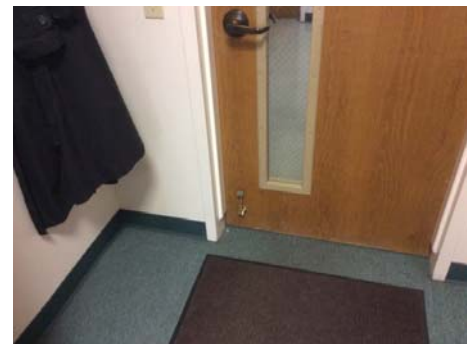


963	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$25	\$25
-----	---	--	---	-----	------	------



Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 24-25**


Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Swing</u>						
957	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". <i>As-Built:</i> Door width plus 4.5" <i>Proposed Solution:</i> Change door swing. Latch to hinge side. 	PCODE ID23 ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 2 FY 24-25 Maintenance Work	1	JOB	\$500	\$500
						
967	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). <i>As-Built:</i> 36" to shelving <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID24A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
						
960	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). <i>As-Built:</i> 8-11" <i>Proposed Solution:</i> Change door swing. Latch to hinge side. 	PCODE ID24REF ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 3 FY 24-25 Maintenance Work	REF			
						

Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **FY 24-25**

Part/Floor: **Ground Floor**
 Priority No: **2**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
956	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sign not located on latch side of door and/or not located at 48" min. above to baseline of the lowest Braille cells and 60" max. to baseline of the highest line of raised characters. <i>Proposed Solution:</i> Provide compliant signage including tactile characters and Grade II Braille on latch side of door located 60" on center from floor. 	PCODE SA07 ADAAG 4.30.6 ADA 2010 703.4.1 CBC 2010 1117B.5.7 CBC 2013 11B-703.4.1 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
						

4 Central Services Office

Door

970	<ul style="list-style-type: none"> <i>As-Built Description:</i> Vision Light at door that permits viewing, does not have bottom of at least one glazed panel located 43 inches maximum above the finish floor. (Exception: More than 66" above finished floor.) <i>As-Built:</i> 60" <i>Proposed Solution:</i> Provide new door with vision panel at 43" max. 	PCODE ID06C ADA 2010 404.2.11 CBC 2013 11B-404.2.11 Priority 2 Severity 1 FY 24-25 Maintenance Work	1	JOB	\$2,500	\$2,500
						

Door Hardware

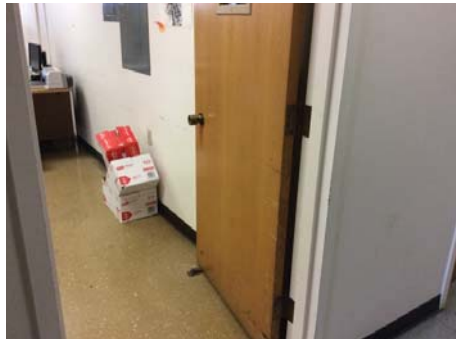969	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door does not have accessible operating hardware. <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$250	\$250
						

Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 24-25**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
980	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door does not have accessible operating hardware. <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$250	\$250



Signage

968	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sign not located on latch side of door and/or not located at 48" min. above to baseline of the lowest Braille cells and 60" max. to baseline of the highest line of raised characters. <i>Proposed Solution:</i> Provide compliant signage including tactile characters and Grade II Braille on latch side of door located 60" on center from floor. 	PCODE SA07 ADAAG 4.30.6 ADA 2010 703.4.1 CBC 2010 1117B.5.7 CBC 2013 11B-703.4.1 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
-----	--	---	---	-----	------	------



979	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$90	\$90
-----	--	--	---	-----	------	------





7 Corridors


Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 24-25**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Carpet/Doormat</u>						
996	<ul style="list-style-type: none"> <i>As-Built Description:</i> Doormat not securely attached to ground or floor structure. <i>Proposed Solution:</i> Attach doormat to floor surface or remove doormat. 	PCODE ID05A ADAAG 4.5.3 ADA 2010 302.2 CBC 2010 1124B.3 CBC 2013 11B-302.2 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$75	\$75
						

<u>Reach Range</u>						
997	<ul style="list-style-type: none"> <i>As-Built Description:</i> Reach height to control or access point, where only forward approach is available, exceeds 48" or is less than 15". <i>As-Built:</i> Doorbell: 58" <i>Proposed Solution:</i> Modify equipment or mounting. 	PCODE IE01 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 1118B.5 CBC 2013 11B-308.2.1 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$100	\$100
						


<u>Signage</u>						
999	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$90	\$90
						


11 Dispatch Center


Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 24-25**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Closer</u>						
1053	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door. As-Built: 13 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$25	\$25
						


1054	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door. As-Built: 12 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$25	\$25
						


<u>Door Hardware</u>						
1047	<ul style="list-style-type: none"> As-Built Description: Door does not have accessible operating hardware. Proposed Solution: Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$250	\$250
						

Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 24-25**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Reach Range						
1049	<ul style="list-style-type: none"> As-Built Description: Reach height to control or access point, where only forward approach is available, exceeds 48" or is less than 15". As-Built: Doorbell & drop box: 56" and 52" Proposed Solution: Modify equipment or mounting. 	PCODE IE01 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 1118B.5 CBC 2013 11B-308.2.1 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$100	\$100
						

Signage						
1048	<ul style="list-style-type: none"> As-Built Description: Sign not located on latch side of door and/or not located at 48" min. above to baseline of the lowest Braille cells and 60" max. to baseline of the highest line of raised characters. Proposed Solution: Provide compliant signage including tactile characters and Grade II Braille on latch side of door located 60" on center from floor. 	PCODE SA07 ADAAG 4.30.6 ADA 2010 703.4.1 CBC 2010 1117B.5.7 CBC 2013 11B-703.4.1 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
						

Total Costs for	Part/floor: Interior	Ground Floor	\$4,580.00
------------------------	-----------------------------	---------------------	-------------------

Facility: COUNTY SERVICES OFFICES

Area: Interior

Part/Floor: Ground Floor

Address: 1400 W. LACEY BLVD.

Year to be Completed: FY 24-25

Priority No: 2

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$4,580.00

Facility: **COUNTY SERVICES OFFICES**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: COUNTY SERVICES OFFICES					\$4,580.00
------------------------	--	--	--	--	--	-------------------

Facility: **ENGINEERING BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 Lobby Conference Room

Door Closer

777	<ul style="list-style-type: none"> <i>As-Built Description:</i> Excessive force required to open door. <i>As-Built:</i> 12 lbs <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). 	<p>PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 3 FY 24-25 Maintenance Work</p>	2	JOB	\$25	\$50
-----	---	--	---	-----	------	------




Door Stopper

776	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	<p>PCODE ID06A ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 2 Severity 3 FY 24-25 Maintenance Work</p>	2	JOB	\$25	\$50
-----	---	---	---	-----	------	------



Door Swing

780	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18"(CA only: 24" at exterior doors)x 60". <i>As-Built:</i> 58" to table <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	<p>PCODE ID23A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 2 FY 24-25 Maintenance Work</p>	1	JOB	\$50	\$50
-----	--	---	---	-----	------	------

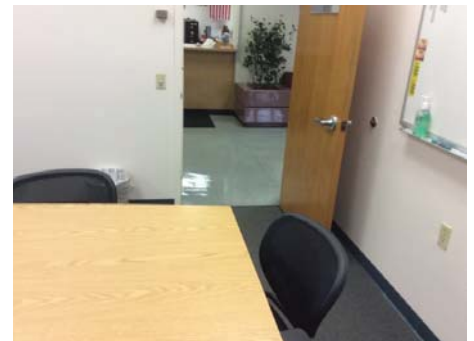

Facility: **ENGINEERING BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
778	<ul style="list-style-type: none"> As-Built Description: Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). As-Built: 5" to chair Proposed Solution: Remove or relocate furniture or storage items. 	PCODE ID24A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 2 FY 24-25 Maintenance Work	1	JOB	\$50	\$50



Signage


775	<ul style="list-style-type: none"> As-Built Description: Sign not located on latch side of door and/or not located at 48" min. above to baseline of the lowest Braille cells and 60" max. to baseline of the highest line of raised characters. Proposed Solution: Provide compliant signage including tactile characters and Grade II Braille on latch side of door located 60" on center from floor. 	PCODE SA07 ADAAG 4.30.6 ADA 2010 703.4.1 CBC 2010 1117B.5.7 CBC 2013 11B-703.4.1 Priority 2 Severity 3 FY 24-25 Maintenance Work	2	JOB	\$50	\$100
-----	--	---	---	-----	------	-------



6 Public Works Office

Corridor

814	<ul style="list-style-type: none"> As-Built Description: Corridor, for occupant load less than 10, less than 36" wide. As-Built: 32-36" Proposed Solution: Remove or relocate furniture and storage items. 	PCODE IH03A ADAAG 4.3.3 ADA 2010 403.5.1 CBC 2010 1133B.3.1 CBC 2013 11B-403.5.1 Priority 2 Severity 2 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
-----	---	---	---	-----	------	------

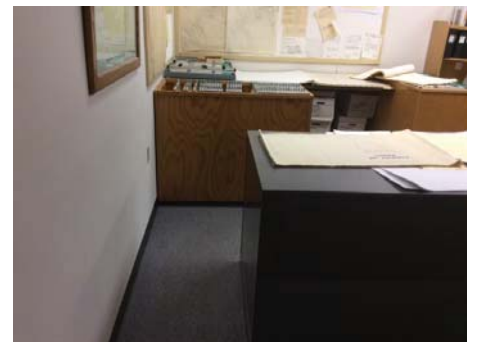

Facility: **ENGINEERING BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 24-25**

Priority No: **2**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Door Hardware

812	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	<p>PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work</p>	1	JOB	\$250	\$250
-----	--	--	---	-----	-------	-------




819	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	<p>PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work</p>	1	JOB	\$250	\$250
-----	--	--	---	-----	-------	-------



Door Swing

820	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". • <i>As-Built:</i> 5" to desk • <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	<p>PCODE ID23A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 2 FY 24-25 Maintenance Work</p>	1	JOB	\$50	\$50
-----	---	--	---	-----	------	------

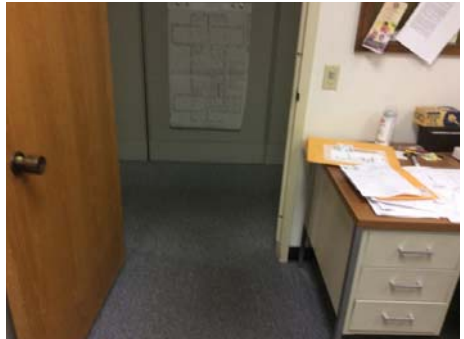

7 Public Works Office Corridors

Facility: **ENGINEERING BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Protrusion Limits</u>						
843	<ul style="list-style-type: none"> <i>As-Built Description:</i> Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor. <i>As-Built:</i> File trays: 9" protrusion at 48" AFF <i>Proposed Solution:</i> Remove/relocate protruding object. Patch existing surface. <i>Notes:</i> Copy room 	<p>PCODE EG04 ADAAG 4.4.1 ADA 2010 307.2 CBC 2010 1133B.8.6.1 CBC 2013 11B-307.2 Priority 2 Severity 2 FY 24-25 Maintenance Work</p>	1	JOB	\$100	\$100
						

<u>Signage</u>						
833	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	<p>PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 2 Severity 3 FY 24-25 Maintenance Work</p>	1	JOB	\$90	\$90
						

9 Planning Offices

<u>Door Swing</u>						
859	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". <i>As-Built:</i> 37" to cabinet <i>Proposed Solution:</i> Remove or relocate furniture or storage items. <i>Notes:</i> Ensure clearances where public may have access. 	<p>PCODE ID23A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 2 FY 24-25 Maintenance Work</p>	1	JOB	\$50	\$50
						

11 Planning Office Print Room

Facility: **ENGINEERING BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Swing</u>						
875	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). • <i>As-Built:</i> 40" to copy machine • <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID24A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
						

<u>Turn Space</u>						
874	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than 60" diameter or T-shaped space provided for wheelchair turns. • <i>Proposed Solution:</i> Remove or relocate storage items or furniture. 	PCODE IN04A ADAAG 4.2.3 ADA 2010 304.1 CBC 2010 1118B.3 CBC 2013 11B-304.1 Priority 2 Severity 2 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
						

12 IT & Purchasing Lobby
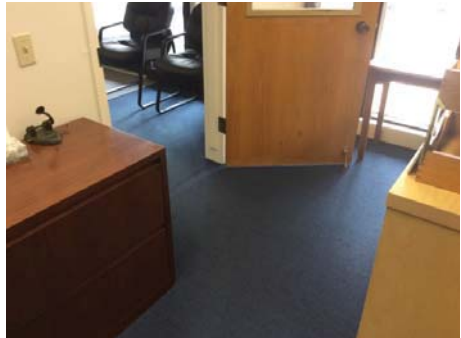
<u>Door Swing</u>						
888	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". • <i>As-Built:</i> 6" and 56.5" • <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID23A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
						

Facility: **ENGINEERING BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**


Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
884	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sign not located on latch side of door and/or not located at 48" min. above to baseline of the lowest Braille cells and 60" max. to baseline of the highest line of raised characters. <i>Proposed Solution:</i> Provide compliant signage including tactile characters and Grade II Braille on latch side of door located 60" on center from floor. 	PCODE SA07 ADAAG 4.30.6 ADA 2010 703.4.1 CBC 2010 1117B.5.7 CBC 2013 11B-703.4.1 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
						

13 IT Offices

Signage						
901	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$90	\$90
						

14 Server Room & Offices

Door						
907	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Install kick plate at bottom 10" of door to cover floor latch and floor latch rods. 	PCODE ID06ANT ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$200	\$200
						

Facility: **ENGINEERING BUILDING**




Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

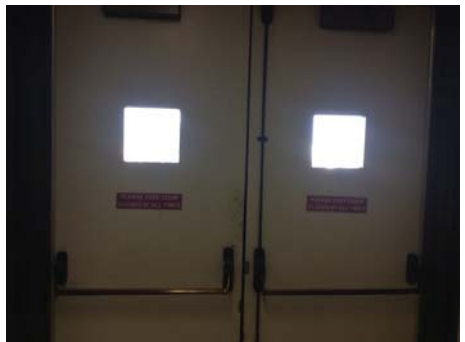Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
914	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Install kick plate at bottom 10" of door to cover floor latch and floor latch rods. <i>Notes:</i> And remove stopper. 	PCODE ID06ANT ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$200	\$200
						
910	<ul style="list-style-type: none"> <i>As-Built Description:</i> Vision Light at door that permits viewing, does not have bottom of at least one glazed panel located 43 inches maximum above the finish floor. (Exception: More than 66" above finished floor.) <i>As-Built:</i> 60.5" <i>Proposed Solution:</i> Provide new door with vision panel at 43" max. 	PCODE ID06C ADA 2010 404.2.11 CBC 2013 11B-404.2.11 Priority 2 Severity 1 FY 24-25 Maintenance Work	2	JOB	\$2,500	\$5,000
						
917	<ul style="list-style-type: none"> <i>As-Built Description:</i> Vision Light at door that permits viewing, does not have bottom of at least one glazed panel located 43 inches maximum above the finish floor. (Exception: More than 66" above finished floor.) <i>As-Built:</i> 60.5" <i>Proposed Solution:</i> Provide new door with vision panel at 43" max. 	PCODE ID06C ADA 2010 404.2.11 CBC 2013 11B-404.2.11 Priority 2 Severity 1 FY 24-25 Maintenance Work	2	JOB	\$2,500	\$5,000
						

Facility: **ENGINEERING BUILDING**




Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Hardware</u>						
911	<ul style="list-style-type: none"> As-Built Description: Door does not have accessible operating hardware. Proposed Solution: Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work	2	JOB	\$250	\$500
						
916	<ul style="list-style-type: none"> As-Built Description: Door does not have accessible operating hardware. Proposed Solution: Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work	2	JOB	\$250	\$500
						
922	<ul style="list-style-type: none"> As-Built Description: Door does not have accessible operating hardware. Proposed Solution: Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work	2	JOB	\$250	\$500
						

Facility: **ENGINEERING BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door Stopper						
919	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. <i>Notes:</i> And provide latch cover plate. 	<p>PCODE ID06A</p> <p>ADA 2010 404.2.10</p> <p>CBC 2010 1133B.2.6</p> <p>CBC 2013 11B-404.2.10</p> <p>Priority 2</p> <p>Severity 3</p> <p>FY 24-25 Maintenance Work</p>	2	JOB	\$25	\$50
						

Signage						
913	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	<p>PCODE SA10A</p> <p>ADAAG 4.1.3(16)</p> <p>ADA 2010 216.4.1</p> <p>CBC 2010 1011.3</p> <p>CBC 2013 11B-216.4.1</p> <p>Priority 2</p> <p>Severity 3</p> <p>FY 24-25 Maintenance Work</p>	1	JOB	\$90	\$90
						

918	<ul style="list-style-type: none"> <i>As-Built Description:</i> At door leading into exit corridor: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT ROUTE" sign at door. 	<p>PCODE SA10D</p> <p>ADAAG 4.1.3(16)</p> <p>ADA 2010 216.4.1</p> <p>CBC 2010 1011.3</p> <p>CBC 2013 11B-216.4.1</p> <p>Priority 2</p> <p>Severity 3</p> <p>FY 24-25 Maintenance Work</p>	1	JOB	\$90	\$90
						

15 Programming Conference Room

Facility: **ENGINEERING BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door</u>						
926	<ul style="list-style-type: none"> As-Built Description: Vision Light at door that permits viewing, does not have bottom of at least one glazed panel located 43 inches maximum above the finish floor. (Exception: More than 66" above finished floor.) As-Built: 54" Proposed Solution: Provide new door with vision panel at 43" max. 	PCODE ID06C ADA 2010 404.2.11 CBC 2013 11B-404.2.11 Priority 2 Severity 2 FY 24-25 Maintenance Work	2	JOB	\$2,500	\$5,000
						

<u>Door Closer</u>						
928	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door. As-Built: 11 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 3 FY 24-25 Maintenance Work	2	JOB	\$25	\$50
						

<u>Door Swing</u>						
930	<ul style="list-style-type: none"> As-Built Description: Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". As-Built: 11" to sapphire Proposed Solution: Remove or relocate furniture or storage items. 	PCODE ID23ANT ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
						

Facility: **ENGINEERING BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
927	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). <i>As-Built:</i> 39" to cubicle wing, within 12" <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	<p>PCODE ID24A</p> <p>ADAAG Fig. 25(a)</p> <p>ADA 2010 404.2.4</p> <p>CBC 2010 11B-26A(a)</p> <p>CBC 2013 11B-404.2.4</p> <p>Priority 2</p> <p>Severity 3</p> <p>FY 24-25 Maintenance Work</p>	1	JOB	\$50	\$50



Signage


925	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sign not located on latch side of door and/or not located at 48" min. above to baseline of the lowest Braille cells and 60" max. to baseline of the highest line of raised characters. <i>Proposed Solution:</i> Provide compliant signage including tactile characters and Grade II Braille on latch side of door located 60" on center from floor. 	<p>PCODE SA07</p> <p>ADAAG 4.30.6</p> <p>ADA 2010 703.4.1</p> <p>CBC 2010 1117B.5.7</p> <p>CBC 2013 11B-703.4.1</p> <p>Priority 2</p> <p>Severity 3</p> <p>FY 24-25 Maintenance Work</p>	1	JOB	\$50	\$50
-----	--	--	---	-----	------	------



16 Network Conference Room

Door Hardware

933	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door does not have accessible operating hardware. <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>ADA 2010 404.2.7</p> <p>CBC 2010 1133B.2.5.2</p> <p>CBC 2013 11B-404.2.7</p> <p>Priority 2</p> <p>Severity 3</p> <p>FY 24-25 Maintenance Work</p>	1	JOB	\$250	\$250
-----	--	--	---	-----	-------	-------

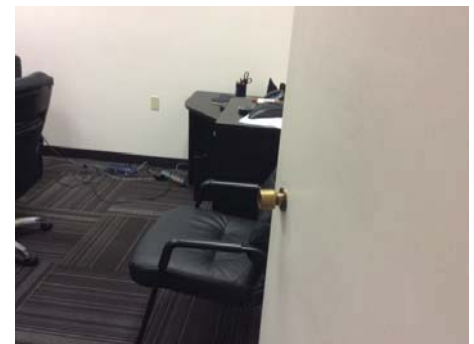

Facility: **ENGINEERING BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Stopper</u>						
934	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$25	\$25
						

<u>Signage</u>						
932	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sign not located on latch side of door and/or not located at 48" min. above to baseline of the lowest Braille cells and 60" max. to baseline of the highest line of raised characters. <i>Proposed Solution:</i> Provide compliant signage including tactile characters and Grade II Braille on latch side of door located 60" on center from floor. 	PCODE SA07 ADAAG 4.30.6 ADA 2010 703.4.1 CBC 2010 1117B.5.7 CBC 2013 11B-703.4.1 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
						

Total Costs for	Part/floor: Interior	Ground Floor	\$19,085.00
------------------------	-----------------------------	---------------------	--------------------

Facility: **ENGINEERING BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$19,085.00

Facility: **ENGINEERING BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: ENGINEERING BUILDING					\$19,085.00
------------------------	---------------------------------------	--	--	--	--	--------------------

Facility: **FINANCE BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 Treasurer Staff Offices

Door Swing

583

• *As-Built Description:*

Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60".


• *As-Built:* 8.5"

• *Proposed Solution:*

Remove or relocate furniture or storage items.

PCODE ID23A
 ADAAG Fig. 25(a)
 ADA 2010 404.2.4
 CBC 2010 11B-26A(a)
 CBC 2013 11B-404.2.4
 Priority 2
 Severity 3
 FY 24-25 Maintenance Work

1 JOB \$50 \$50

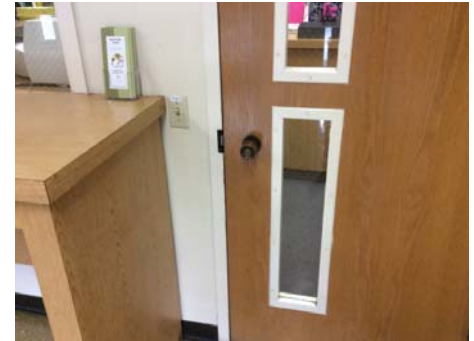

4 Auditor Controller Office

Signage

601

• *As-Built Description:*

At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided.

• *Proposed Solution:*

Provide raised letter/Braille "EXIT" sign at door.

PCODE SA10A
 ADAAG 4.1.3(16)
 ADA 2010 216.4.1
 CBC 2010 1011.3
 CBC 2013 11B-216.4.1
 Priority 2
 Severity 3
 FY 24-25 Maintenance Work

1 JOB \$90 \$90



5 Auditor Controller Lobby

Signage

616

• *As-Built Description:*

Existing sign designating permanent room or space is noncompliant.

• *Proposed Solution:*

Provide compliant signage.

PCODE SA13
 ADAAG 4.1.3(16)(a)
 ADA 2010 216.2
 CBC 2010 1117B.5
 CBC 2013 11B-216.2
 Priority 1
 Severity 4
 FY 24-25 Maintenance Work

1 JOB \$150 \$150



6 Elections Lobby

Facility: **FINANCE BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.



Year to be Completed: **FY 24-25**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
618	<ul style="list-style-type: none"> <i>As-Built Description:</i> Existing sign designating permanent room or space is noncompliant. <i>Proposed Solution:</i> Provide compliant signage. 	PCODE SA13 ADAAG 4.1.3(16)(a) ADA 2010 216.2 CBC 2010 1117B.5 CBC 2013 11B-216.2 Priority 1 Severity 4 FY 24-25 Maintenance Work	1	JOB	\$150	\$150
						

7 Elections Staff Area

Door Hardware

626	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door does not have accessible operating hardware. <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$250	\$250
						
633	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door does not have accessible operating hardware. <i>As-Built:</i> exit door <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$250	\$250
						

10 Assessor Lobby

Facility: **FINANCE BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 24-25**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
645	<ul style="list-style-type: none"> <i>As-Built Description:</i> Existing sign designating permanent room or space is noncompliant. <i>Proposed Solution:</i> Provide compliant signage and ISA. 	PCODE SA13 ADAAG 4.1.3(16)(a) ADA 2010 216.2 CBC 2010 1117B.5 CBC 2013 11B-216.2 Priority 1 Severity 4 FY 24-25 Maintenance Work	1	JOB	\$150	\$150
						


11 Records Room

Door Swing

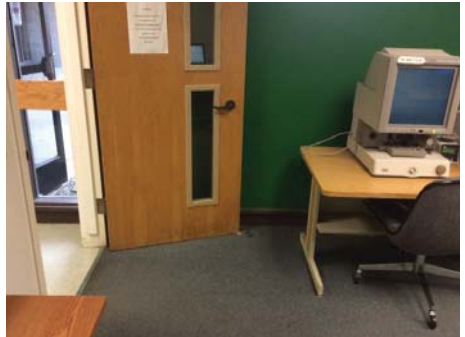657	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". <i>As-Built:</i> 53" to desk. <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID23A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
						

15 Assessors Office - Staff

Door Hardware

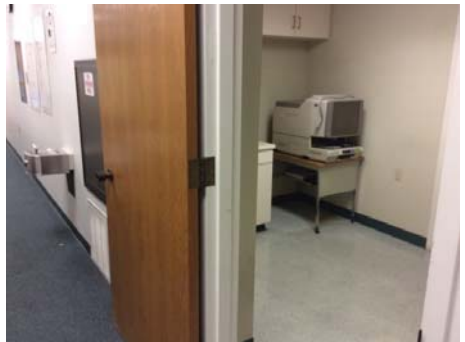704	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door does not have accessible operating hardware. <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$250	\$250
						

Facility: **FINANCE BUILDING**

Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**


Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
712	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	<p>PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work</p>	1	JOB	\$250	\$250



Door Swing


709	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). • <i>As-Built:</i> 4.5" to cabinet • <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	<p>PCODE ID24A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 2 FY 24-25 Maintenance Work</p>	1	JOB	\$50	\$50
-----	--	--	---	-----	------	------



17 Shared Conference Room

Door

728	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. • <i>As-Built:</i> 8.5" • <i>Proposed Solution:</i> Provide 10" min. "kick plate" covering width of door when altering area. 	<p>PCODE ID06 ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 2 Severity 3 FY 24-25 Maintenance Work</p>	1	JOB	\$100	\$100
-----	---	--	---	-----	-------	-------



Facility: **FINANCE BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**


Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
727	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$90	\$90
						

18 HR Lobby

Signage						
733	<ul style="list-style-type: none"> <i>As-Built Description:</i> Existing sign designating permanent room or space is noncompliant. <i>Proposed Solution:</i> Provide compliant signage. 	PCODE SA13 ADAAG 4.1.3(16)(a) ADA 2010 216.2 CBC 2010 1117B.5 CBC 2013 11B-216.2 Priority 1 Severity 4 FY 24-25 Maintenance Work	1	JOB	\$150	\$150
						

19 Training Testing Room

Door Hardware						
741	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door does not have accessible operating hardware. <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work	2	JOB	\$250	\$500
						

Facility: **FINANCE BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**


Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Swing</u>						
743	<ul style="list-style-type: none"> As-Built Description: Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". As-Built: 51" to table Proposed Solution: Remove or relocate furniture or storage items. 	PCODE ID23A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
						

20 Training Testing Room

<u>Door Swing</u>						
745	<ul style="list-style-type: none"> As-Built Description: Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". As-Built: 30" & 41" Proposed Solution: Remove or relocate furniture or storage items. 	PCODE ID23A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 2 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
						

21 Staff Offices

<u>Door Hardware</u>						
753	<ul style="list-style-type: none"> As-Built Description: Door does not have accessible operating hardware. Proposed Solution: Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$250	\$250
						

Facility: **FINANCE BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door Swing						
749	<ul style="list-style-type: none"> As-Built Description: Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). As-Built: 2" Proposed Solution: Remove or relocate furniture or storage items. 	PCODE ID24A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 2 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
						

Total Costs for	Part/floor: Interior	Ground Floor	\$2,930.00
------------------------	-----------------------------	---------------------	-------------------

Facility: **FINANCE BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$2,930.00

Facility: **FINANCE BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: FINANCE BUILDING					\$2,930.00
------------------------	-----------------------------------	--	--	--	--	-------------------

Facility: **LAW OFFICES BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**


Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 DA Offices


Door Hardware

1464	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door does not have accessible operating hardware. <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	<p>PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work</p>	20	JOB	\$250	\$5,000
------	--	--	----	-----	-------	---------

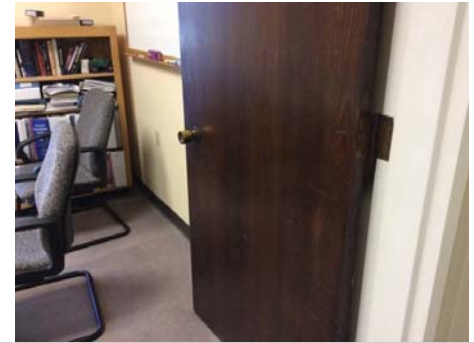

Door Stopper

1467	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	<p>PCODE ID06A ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 2 Severity 3 FY 24-25 Maintenance Work</p>	1	JOB	\$25	\$25
------	---	---	---	-----	------	------

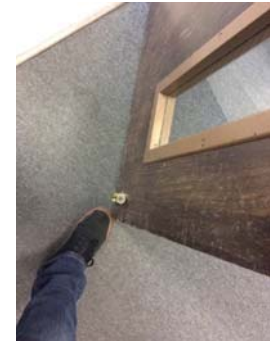

2 DA Offices - Conference Room

Carpet/Doormat

1470	<ul style="list-style-type: none"> <i>As-Built Description:</i> Doormat not securely attached to ground or floor structure. <i>Proposed Solution:</i> Attach doormat to floor surface or remove doormat. 	<p>PCODE ID05A ADAAG 4.5.3 ADA 2010 302.2 CBC 2010 1124B.3 CBC 2013 11B-302.2 Priority 2 Severity 3 FY 24-25 Maintenance Work</p>	1	JOB	\$75	\$75
------	--	--	---	-----	------	------



Facility: **LAW OFFICES BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Hardware</u>						
1469	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door does not have accessible operating hardware. <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$250	\$250
						

4 Staff Office West

<u>Door Hardware</u>						
1482	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door does not have accessible operating hardware. <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$250	\$250
						

<u>Signage</u>						
1483	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$90	\$90
						

6 Sexual Assault Lobby

Facility: **LAW OFFICES BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Closer</u>						
1496	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door. • <i>As-Built:</i> 7 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 1 Severity 4 FY 24-25 Maintenance Work	1	JOB	\$25	\$25
						

<u>Door Swing</u>						
1499	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". • <i>As-Built:</i> 7" to table • <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID23A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
						

1498	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). • <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID24A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 1 Severity 4 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
						

Facility: **LAW OFFICES BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 24-25**

Priority No: **1**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
1493	<ul style="list-style-type: none"> <i>As-Built Description:</i> Existing sign designating permanent room or space is noncompliant. <i>Proposed Solution:</i> Provide compliant signage. 	PCODE SA13 ADAAG 4.1.3(16)(a) ADA 2010 216.2 CBC 2010 1117B.5 CBC 2013 11B-216.2 Priority 1 Severity 4 FY 24-25 Maintenance Work	1	JOB	\$150	\$150
						

8 DA Staff Conference Room

Door Hardware

1508	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door does not have accessible operating hardware. <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$250	\$250
						

Door Stopper

1510	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$25	\$25
						

10 DA Restroom Corridor - Kitchenette

Facility: **LAW OFFICES BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door Swing						
1527	<ul style="list-style-type: none"> As-Built Description: Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). As-Built: 6" to cabinets Proposed Solution: Remove or relocate furniture or storage items. 	PCODE ID24A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
						

Signage						
1528	<ul style="list-style-type: none"> As-Built Description: At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. Proposed Solution: Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$90	\$90
						

13 DA Lobby

Signage						
1558	<ul style="list-style-type: none"> As-Built Description: Existing sign designating permanent room or space is noncompliant. Proposed Solution: Provide compliant signage. 	PCODE SA13 ADAAG 4.1.3(16)(a) ADA 2010 216.2 CBC 2010 1117B.5 CBC 2013 11B-216.2 Priority 1 Severity 4 FY 24-25 Maintenance Work	1	JOB	\$150	\$150
						

14 Law Library

Facility: **LAW OFFICES BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 24-25**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
1567	<ul style="list-style-type: none"> <i>As-Built Description:</i> Existing sign designating permanent room or space is noncompliant. <i>Proposed Solution:</i> Provide compliant signage. 	PCODE SA13 ADAAG 4.1.3(16)(a) ADA 2010 216.2 CBC 2010 1117B.5 CBC 2013 11B-216.2 Priority 1 Severity 4 FY 24-25 Maintenance Work	1	JOB	\$150	\$150
						

Turn Space							
1581	<ul style="list-style-type: none"> <i>As-Built Description:</i> Less than 60" diameter or T-shaped space provided for wheelchair turns. <i>Proposed Solution:</i> Remove or relocate storage items or furniture. Notes: If accessed by public. 	PCODE IN04AREF ADAAG 4.2.3 ADA 2010 304.1 CBC 2010 1118B.3 CBC 2013 11B-304.1 Priority 2 Severity 2 FY 24-25 Maintenance Work	REF				

15 Veterans Services

Brochure Bins						
1585	<ul style="list-style-type: none"> <i>As-Built Description:</i> Information brochure bins mounted above accessible height of 48". <i>As-Built:</i> 47"-70" <i>Proposed Solution:</i> Relocate/remount bins at accessible height. 	PCODE IN08 ADAAG 4.2.5 & 6 ADA 2010 308.2.1 CBC 2010 1118B.5 CBC 2013 11B-308.2.1 Priority 2 Severity 1 FY 24-25 Maintenance Work	1	JOB	\$100	\$100
						

Facility: **LAW OFFICES BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 24-25**

Priority No: **1**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
1583	<ul style="list-style-type: none"> <i>As-Built Description:</i> Existing sign designating permanent room or space is noncompliant. <i>Proposed Solution:</i> Provide compliant signage. 	PCODE SA13 ADAAG 4.1.3(16)(a) ADA 2010 216.2 CBC 2010 1117B.5 CBC 2013 11B-216.2 Priority 1 Severity 4 FY 24-25 Maintenance Work	1	JOB	\$150	\$150
						

16 Veterans Services Offices

Carpet/Doormat

1593	<ul style="list-style-type: none"> <i>As-Built Description:</i> Doormat not securely attached to ground or floor structure. <i>Proposed Solution:</i> Attach doormat to floor surface or remove doormat. <i>Notes:</i> Exit door 	PCODE ID05A ADAAG 4.5.3 ADA 2010 302.2 CBC 2010 1124B.3 CBC 2013 11B-302.2 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$75	\$75
						

Door Closer

1592	<ul style="list-style-type: none"> <i>As-Built Description:</i> Excessive force required to open door. <i>As-Built:</i> 9 lbs <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). <i>Notes:</i> Exit door 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 1 Severity 4 FY 24-25 Maintenance Work	1	JOB	\$25	\$25
						

Facility: **LAW OFFICES BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door Swing						
1594	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". <i>As-Built:</i> 46" <i>Proposed Solution:</i> Remove or relocate furniture or storage items. <i>Notes:</i> Door is kept open 	<p>PCODE ID23A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 3 FY 24-25 Maintenance Work</p>	1	JOB	\$50	\$50
						

1595	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". <i>As-Built:</i> 8" to chair <i>Proposed Solution:</i> Remove or relocate furniture or storage items. <i>Notes:</i> To restrooms 	<p>PCODE ID23A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 3 FY 24-25 Maintenance Work</p>	1	JOB	\$50	\$50
						

Signage						
1591	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	<p>PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 2 Severity 3 FY 24-25 Maintenance Work</p>	1	JOB	\$90	\$90
						

Facility: **LAW OFFICES BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Turn Space</u>						
1590	<ul style="list-style-type: none"> <i>As-Built Description:</i> Less than 60" diameter or T-shaped space provided for wheelchair turns. <i>Proposed Solution:</i> Remove or relocate storage items or furniture. <i>Notes:</i> When needed if public access 	PCODE IN04A ADAAG 4.2.3 ADA 2010 304.1 CBC 2010 1118B.3 CBC 2013 11B-304.1 Priority 2 Severity 2 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
						

17 County Council

<u>Door Swing</u>						
1602	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". <i>As-Built:</i> 2" to cabinet <i>Proposed Solution:</i> Remove or relocate furniture or storage items. <i>Notes:</i> If door is added 	PCODE ID23A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 2 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
						

Total Costs for	Part/floor: Interior	Ground Floor		\$7,320.00
------------------------	----------------------	--------------	--	-------------------

Facility: **LAW OFFICES BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$7,320.00

Facility: **LAW OFFICES BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: LAW OFFICES BUILDING					\$7,320.00
------------------------	---------------------------------------	--	--	--	--	-------------------

Facility: **SHERIFF ADMIN BLDG**
 Address: 1444 W. LACEY BLVD.

Area: **Exterior**
 Year to be Completed: **FY 24-25**


Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------


1 Accessible Parking Serving Sheriff Facilities

Parking Signage

2614	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sign relating to parking privileges for disabled persons is non-compliant. <i>As-Built:</i> Wording <i>Proposed Solution:</i> Provide compliant parking signage that does not contain the word "handicapped". 	PCODE EA04F ADA 2010 502.6 CBC 2010 VC \$22511.9. CBC 2013 11B-502.6 Priority 1 Severity 4 FY 24-25 Maintenance Work	1	JOB	\$100	\$100
------	--	--	---	-----	-------	-------




2615	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: Additional Sign or additional language below the symbol of accessibility stating "Minimum Fine \$250" not provided. <i>Proposed Solution:</i> Provide compliant parking signage that includes fine information. 	PCODE EA04G CBC 2010 1129B.4 CBC 2013 11B-502.6.2 Priority 1 Severity 4 FY 24-25 Maintenance Work	1	JOB	\$100	\$100
------	--	--	---	-----	-------	-------



2 POT from Driveway to Admin Buildings

Changes in Level

2619	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk: Pavement dislocation creates vertical change in level between 1/4" and 1/2" in accessible route. <i>As-Built:</i> 0.5" <i>Proposed Solution:</i> Grind or fill pavement dislocation to create beveled transition. 	PCODE EF03A ADAAG 4.3.8 ADA 2010 403.4 CBC 2010 1133B.7.4 CBC 2013 11B-403.4 Priority 1 Severity 4 FY 24-25 Maintenance Work	4	SF	\$21	\$84
------	--	---	---	----	------	------

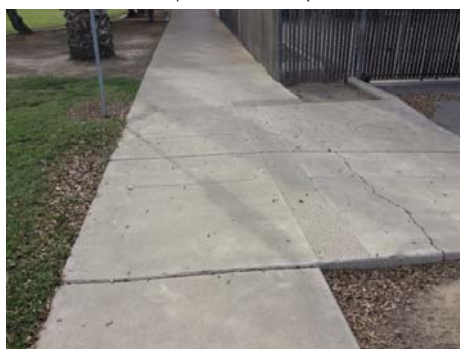

5 Accessible Space in Secured Staff Lot

Facility: **SHERIFF ADMIN BLDG**


Area: **Exterior**

Part/Floor: **On-site**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Parking Signage</u>						
2650	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: Additional Sign or additional language below the symbol of accessibility stating "Minimum Fine \$250" not provided. <i>Proposed Solution:</i> Provide compliant parking signage that includes fine information. 	<p>PCODE EA04G</p> <p>CBC 2010 1129B.4</p> <p>CBC 2013 11B-502.6.2</p> <p>Priority 1</p> <p>Severity 4</p> <p>FY 24-25 Maintenance Work</p>	1	JOB	\$100	\$100
						

Total Costs for	Part/floor: Exterior	On-site	\$384.00
------------------------	-----------------------------	----------------	-----------------

Facility: **SHERIFF ADMIN BLDG**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$384.00

Facility: **SHERIFF ADMIN BLDG**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Sheriff Operations Building Entrance & Lobby


Carpet/Doormat

1809	<ul style="list-style-type: none"> <i>As-Built Description:</i> Doormat not securely attached to ground or floor structure. <i>As-Built:</i> Meeting room doors <i>Proposed Solution:</i> Attach doormat to floor surface or remove doormat. 	PCODE ID05A	2	JOB	\$75	\$150
		ADAAG 4.5.3				
		ADA 2010 302.2				
		CBC 2010 1124B.3				
		CBC 2013 11B-302.2				
		Priority 2				
		Severity 3				
		FY 24-25 Maintenance Work				



Door Closer

1810	<ul style="list-style-type: none"> <i>As-Built Description:</i> Excessive force required to open door. <i>As-Built:</i> 8 lbs <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03	1	JOB	\$25	\$25
		ADAAG 4.13.11				
		ADA 2010 404.2.9				
		CBC 2010 1133B.2.5				
		CBC 2013 11B-404.2.9				
		Priority 1				
		Severity 4				
		FY 24-25 Maintenance Work				

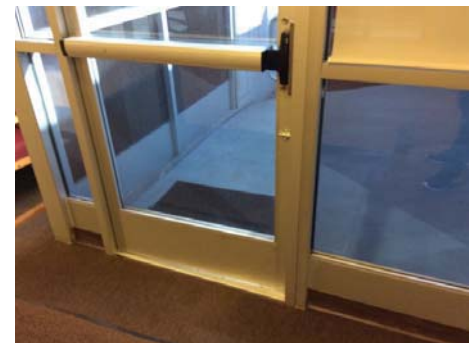

Signage

1807	<ul style="list-style-type: none"> <i>As-Built Description:</i> Existing sign designating permanent room or space is noncompliant. <i>Proposed Solution:</i> Provide compliant signage. 	PCODE SA13	1	JOB	\$150	\$150
		ADAAG 4.1.3(16)(a)				
		ADA 2010 216.2				
		CBC 2010 1117B.5				
		CBC 2013 11B-216.2				
		Priority 1				
		Severity 4				
		FY 24-25 Maintenance Work				



2 Large Meeting Room

Facility: **SHERIFF ADMIN BLDG**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Closer</u>						
1812	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door. • <i>As-Built:</i> 12 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). 	<p>PCODE ID03</p> <p>ADAAG 4.13.11</p> <p>ADA 2010 404.2.9</p> <p>CBC 2010 1133B.2.5</p> <p>CBC 2013 11B-404.2.9</p> <p>Priority 2</p> <p>Severity 3</p> <p>FY 24-25 Maintenance Work</p>	2	JOB	\$25	\$50
						


<u>Door Hardware</u>						
1813	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door does not have accessible operating hardware. • <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	<p>PCODE ID07</p> <p>ADAAG 4.13.9</p> <p>ADA 2010 404.2.7</p> <p>CBC 2010 1133B.2.5.2</p> <p>CBC 2013 11B-404.2.7</p> <p>Priority 2</p> <p>Severity 3</p> <p>FY 24-25 Maintenance Work</p>	1	JOB	\$250	\$250
						


<u>Door Stopper</u>						
1814	<ul style="list-style-type: none"> • <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. • <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	<p>PCODE ID06A</p> <p>ADA 2010 404.2.10</p> <p>CBC 2010 1133B.2.6</p> <p>CBC 2013 11B-404.2.10</p> <p>Priority 2</p> <p>Severity 3</p> <p>FY 24-25 Maintenance Work</p>	2	JOB	\$25	\$50
						

Facility: **SHERIFF ADMIN BLDG**
 Address: 1444 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **FY 24-25**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
1817	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sign not located on latch side of door and/or not located at 48" min. above to baseline of the lowest Braille cells and 60" max. to baseline of the highest line of raised characters. <i>Proposed Solution:</i> Provide compliant signage including tactile characters and Grade II Braille on latch side of door located 60" on center from floor. 	PCODE SA07 ADAAG 4.30.6 ADA 2010 703.4.1 CBC 2010 1117B.5.7 CBC 2013 11B-703.4.1 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$50	\$50
						

1816	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.1.3(16) ADA 2010 216.4.1 CBC 2010 1011.3 CBC 2013 11B-216.4.1 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$90	\$90
						

5 Interrogation Room

Door Hardware						
1858	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door does not have accessible operating hardware. <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 24-25 Maintenance Work	1	JOB	\$250	\$250
						

6 General Staff Corridors

Facility: **SHERIFF ADMIN BLDG**


Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
1864	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sign not located on latch side of door and/or not located at 48" min. above to baseline of the lowest Braille cells and 60" max. to baseline of the highest line of raised characters. <i>Proposed Solution:</i> Provide compliant signage including tactile characters and Grade II Braille on latch side of door located 60" on center from floor. 	PCODE SA07 ADAAG 4.30.6 ADA 2010 703.4.1 CBC 2010 1117B.5.7 CBC 2013 11B-703.4.1 Priority 2 Severity 3 FY 24-25 Maintenance Work	8	JOB	\$50	\$400
						

Total Costs for	Part/floor: Interior	Ground Floor	\$1,465.00
------------------------	-----------------------------	---------------------	-------------------

Facility: **SHERIFF ADMIN BLDG**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$1,465.00

Facility: **SHERIFF ADMIN BLDG**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: SHERIFF ADMIN BLDG					\$1,849.00
------------------------	-------------------------------------	--	--	--	--	-------------------

Facility: **SHERIFF'S ADMINISTRATION**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Administration Entrance & Lobby

Reach Range

1741	<ul style="list-style-type: none"> <i>As-Built Description:</i> Reach height to control or access point, where only forward approach is available, exceeds 48" or is less than 15". <i>As-Built:</i> Call button: 53" <i>Proposed Solution:</i> Modify equipment or mounting. 	<p>PCODE IE01 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 1118B.5 CBC 2013 11B-308.2.1 Priority 1 Severity 4 FY 24-25 Maintenance Work</p>	1	JOB	\$100	\$100
------	--	--	---	-----	-------	-------



Signage


1731	<ul style="list-style-type: none"> <i>As-Built Description:</i> Existing sign designating permanent room or space is noncompliant. <i>Proposed Solution:</i> Provide compliant signage. 	<p>PCODE SA13 ADAAG 4.1.3(16)(a) ADA 2010 216.2 CBC 2010 1117B.5 CBC 2013 11B-216.2 Priority 1 Severity 4 FY 24-25 Maintenance Work</p>	1	JOB	\$150	\$150
------	---	---	---	-----	-------	-------



5 Civil Office

Door Swing

1766	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". <i>As-Built:</i> 2" to counter. <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	<p>PCODE ID23A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 2 FY 24-25 Maintenance Work</p>	1	JOB	\$50	\$50
------	---	---	---	-----	------	------

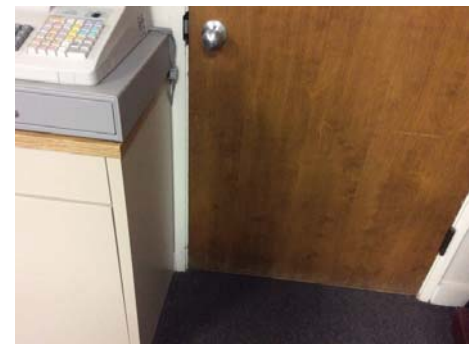

Total Costs for	Part/floor: Interior	Ground Floor	\$300.00
------------------------	-----------------------------	---------------------	-----------------

Facility: **SHERIFF'S ADMINISTRATION**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$300.00

Facility: **SHERIFF'S ADMINISTRATION**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: SHERIFF'S ADMINISTRATION					\$300.00
------------------------	---	--	--	--	--	-----------------

Facility: **ENVIRONMENTAL OFFICES**

Area: **Exterior**

Part/Floor: **On-site**

Address: 330 CAMPUS DR.

Year to be Completed: **FY 24-25**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Accessible Parking Space Serving Buildings 1 & 2

Parking

2940

As-Built Description:

The words "NO PARKING" not painted on the ground within loading and unloading access aisle (12" min high white letters), located so that it is visible to traffic enforcement officials (required in CA only).

Proposed Solution:

Provide the words "NO PARKING" in each access aisle, painted in 12" high letters, when altering area.

PCODE EA04D
 CBC 2010 1129B.3.1
 CBC 2013 11B-502.3.3
 Priority 1
 Severity 4
 FY 24-25 Maintenance Work

1 JOB \$100 \$100



Parking Signage

2939

As-Built Description:

CA only: Additional Sign or additional language below the symbol of accessibility stating "Minimum Fine \$250" not provided.

Proposed Solution:

Provide compliant parking signage that includes fine information.

PCODE EA04G
 CBC 2010 1129B.4
 CBC 2013 11B-502.6.2
 Priority 1
 Severity 4
 FY 24-25 Maintenance Work

1 JOB \$100 \$100



4 POT from Accessible Parking Space to Building 2 & 3 Staff Entrance

Protrusion Limits

2955

As-Built Description:

Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.


As-Built: Pipe: 5" protrusion at 49"

Proposed Solution:

Remove/relocate protruding object. Patch existing surface.

PCODE EG04
 ADAAG 4.4.1
 ADA 2010 307.2
 CBC 2010 1133B.8.6.1
 CBC 2013 11B-307.2
 Priority 1
 Severity 4
 FY 24-25 Maintenance Work

1 JOB \$100 \$100

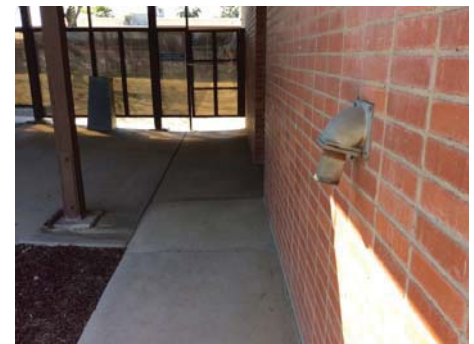

Total Costs for	Part/floor: Exterior	On-site	\$300.00
------------------------	-----------------------------	----------------	-----------------

Facility: **ENVIRONMENTAL OFFICES**

Area: **Exterior**

Part/Floor: **On-site**

Address: 330 CAMPUS DR.

Year to be Completed: **FY 24-25**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$300.00

Facility: **ENVIRONMENTAL OFFICES**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **FY 24-25**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Building 1 Corridor

Door Swing

2524

- *As-Built Description:*
 Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).
- *As-Built:* 2.5" & 40"
- *Proposed Solution:*
 Provide door operator.

PCODE ID24C
 ADAAG Fig. 25(a)
 ADA 2010 404.2.4
 CBC 2010 11B-26A(a)
 CBC 2013 11B-404.2.4
 Priority 2
 Severity 2
 FY 24-25 Maintenance Work

1 JOB \$5,000 \$5,000



Protrusion Limits

2525

- *As-Built Description:*
 Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.
- *As-Built:* Shelving: 12" protrusion at 31"
- *Proposed Solution:*
 Remove/relocate protruding object. Patch existing surface.

PCODE EG04
 ADAAG 4.4.1
 ADA 2010 307.2
 CBC 2010 1133B.8.6.1
 CBC 2013 11B-307.2
 Priority 2
 Severity 1
 FY 24-25 Maintenance Work

1 JOB \$100 \$100



2 Large Conference Room

Door Swing

2534

- *As-Built Description:*
 Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60".
- *As-Built:* 4" to cabinet
- *Proposed Solution:*
 Remove or relocate furniture or storage items.

PCODE ID23A
 ADAAG Fig. 25(a)
 ADA 2010 404.2.4
 CBC 2010 11B-26A(a)
 CBC 2013 11B-404.2.4
 Priority 2
 Severity 2
 FY 24-25 Maintenance Work

1 JOB \$50 \$50



7 Environmental Health Lobby

Facility: **ENVIRONMENTAL OFFICES**


Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 CAMPUS DR.

Year to be Completed: **FY 24-25**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Closer</u>						
2580	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door. As-Built: 9 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 1 Severity 4 FY 24-25 Maintenance Work	1	JOB	\$25	\$25
						

Total Costs for Part/floor: Interior Ground Floor \$5,175.00

Facility: **ENVIRONMENTAL OFFICES**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 CAMPUS DR.

Year to be Completed: **FY 24-25**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$5,175.00

Facility: **ENVIRONMENTAL OFFICES**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 CAMPUS DR.

Year to be Completed: **FY 24-25**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: ENVIRONMENTAL OFFICES					\$5,475.00
------------------------	--	--	--	--	--	-------------------

Facility: **PARKS/KART BUILDING**
 Address: 710 NORTH DR.

Area: **Exterior**
 Year to be Completed: **FY 24-25**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 Accessible Parking Space

Identification

3571	<ul style="list-style-type: none"> As-Built Description: Sign for accessible parking space is missing or non-compliant. Proposed Solution: Provide compliant parking signage. Notes: 12 to 1 Acc. 	PCODE EA04B ADAAG 4.6.4 ADA 2010 502.6 CBC 2010 1129B.4 CBC 2013 11B-502.6 Priority 1 Severity 4 FY 24-25 Maintenance Work	1	JOB	\$315	\$315
------	---	---	---	-----	-------	-------



Parking

3575	<ul style="list-style-type: none"> As-Built Description: The words "NO PARKING" not painted on the ground within loading and unloading access aisle (12" min high white letters), located so that it is visible to traffic enforcement officials (required in CA only). Proposed Solution: Provide the words "NO PARKING" in each access aisle, painted in 12" high letters, when altering area. 	PCODE EA04D CBC 2010 1129B.3.1 CBC 2013 11B-502.3.3 Priority 1 Severity 4 FY 24-25 Maintenance Work	1	JOB	\$100	\$100
------	--	--	---	-----	-------	-------



Parking Signage

3574	<ul style="list-style-type: none"> As-Built Description: No "Tow Away" sign provided at parking lot entrance does not include retrieval contact information (required in CA only). As-Built: No contact information Proposed Solution: Provide compliant "Tow Away" sign at parking lot entrance when altering area. 	PCODE EA04CNT CBC 2010 1129B.4 CBC 2013 11B-502.8.2 Priority 1 Severity 4 FY 24-25 Maintenance Work	1	JOB	\$325	\$325
------	--	--	---	-----	-------	-------




Facility: **PARKS/KART BUILDING**
 Address: 710 NORTH DR.

Area: **Exterior**

Part/Floor: **On-site**

Year to be Completed: **FY 24-25**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3573	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: Additional Sign or additional language below the symbol of accessibility stating "Minimum Fine \$250" not provided. <i>Proposed Solution:</i> Provide compliant parking signage that includes fine information. 	PCODE EA04GREF CBC 2010 1129B.4 CBC 2013 11B-502.6.2 Priority 1 Severity 4 FY 24-25 Maintenance Work				
						REF
						

Total Costs for	Part/floor: Exterior	On-site	\$740.00
------------------------	----------------------	---------	-----------------

Facility: **PARKS/KART BUILDING**

Area: **Exterior**

Part/Floor: **On-site**

Address: 710 NORTH DR.

Year to be Completed: **FY 24-25**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$740.00

Facility: **PARKS/KART BUILDING**
 Address: 710 NORTH DR.

Area: **Interior**
 Year to be Completed: **FY 24-25**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------


1 Parks Main Entrance

Signage

- 3493
- As-Built Description:*
Existing sign designating permanent room or space is noncompliant.
 - Proposed Solution:*
Provide compliant signage.

PCODE SA13
 ADAAG 4.1.3(16)(a)
 ADA 2010 216.2
 CBC 2010 1117B.5
 CBC 2013 11B-216.2
 Priority 1
 Severity 4
 FY 24-25 Maintenance Work

1 JOB \$150 \$150

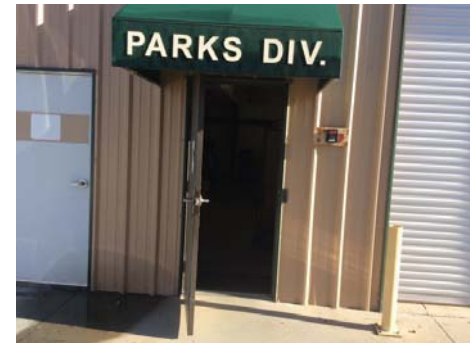

5 CalVans Main Entrance

Door Closer

- 3522
- As-Built Description:*
Excessive force required to open door.
 - As-Built:* 9 lbs
 - Proposed Solution:*
Adjust regular door closer to accessible standards (5 lbs max).

PCODE ID03
 ADAAG 4.13.11
 ADA 2010 404.2.9
 CBC 2010 1133B.2.5
 CBC 2013 11B-404.2.9
 Priority 1
 Severity 4
 FY 24-25 Maintenance Work

1 JOB \$25 \$25



7 Accounting Conference Room

Door Swing

- 3529
- As-Built Description:*
Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60".
 - As-Built:* Table does not allow door to fully open
 - Proposed Solution:*
Remove or relocate furniture or storage items.

PCODE ID23A
 ADAAG Fig. 25(a)
 ADA 2010 404.2.4
 CBC 2010 11B-26A(a)
 CBC 2013 11B-404.2.4
 Priority 2
 Severity 2
 FY 24-25 Maintenance Work

1 JOB \$50 \$50



Total Costs for	Part/floor: Interior	Ground Floor	\$225.00
------------------------	-----------------------------	---------------------	-----------------

Facility: **PARKS/KART BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 710 NORTH DR.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$225.00

Facility: **PARKS/KART BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 710 NORTH DR.

Year to be Completed: **FY 24-25**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: PARKS/KART BUILDING					\$965.00
------------------------	--------------------------------------	--	--	--	--	-----------------

Facility: **KINGSTON PARK RESTROOM**
 Address: 13196 DOUGLAS AVE.

Area: **Exterior**
 Year to be Completed: **FY 24-25**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

3 Accessible Parking

Parking

4910	<ul style="list-style-type: none"> <i>As-Built Description:</i> The words "NO PARKING" not painted on the ground within loading and unloading access aisle (12" min high white letters), located so that it is visible to traffic enforcement officials (required in CA only). <i>Proposed Solution:</i> Provide the words "NO PARKING" in each access aisle, painted in 12" high letters, when altering area. 	<p>PCODE EA04D</p> <p>CBC 2010 1129B.3.1</p> <p>CBC 2013 11B-502.3.3</p> <p>Priority 1</p> <p>Severity 4</p> <p>FY 24-25 Maintenance Work</p>	1	JOB	\$100	\$100
------	--	---	---	-----	-------	-------



Parking Signage

4911	<ul style="list-style-type: none"> <i>As-Built Description:</i> No "Tow Away" sign at parking lot entrance (required in CA only). <i>Proposed Solution:</i> Provide "Tow Away" sign at parking lot entrance when altering area. 	<p>PCODE EA04C</p> <p>CBC 2010 1129B.4</p> <p>CBC 2013 11B-502.8.2</p> <p>Priority 1</p> <p>Severity 4</p> <p>FY 24-25 Maintenance Work</p>	1	JOB	\$325	\$325
------	---	---	---	-----	-------	-------



4905	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: Additional Sign or additional language below the symbol of accessibility stating "Minimum Fine \$250" not provided. <i>Proposed Solution:</i> Provide compliant parking signage that includes fine information. 	<p>PCODE EA04G</p> <p>CBC 2010 1129B.4</p> <p>CBC 2013 11B-502.6.2</p> <p>Priority 1</p> <p>Severity 4</p> <p>FY 24-25 Maintenance Work</p>	2	JOB	\$100	\$200
------	--	---	---	-----	-------	-------



Total Costs for	Part/floor: Exterior	On-site	\$625.00
------------------------	-----------------------------	----------------	-----------------

Facility: **KINGSTON PARK RESTROOM**

Area: **Exterior**

Part/Floor: **On-site**

Address: 13196 DOUGLAS AVE.

Year to be Completed: **FY 24-25**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$625.00

Facility: **KINGSTON PARK RESTROOM**

Area: **Exterior**

Part/Floor: **On-site**

Address: 13196 DOUGLAS AVE.

Year to be Completed: **FY 24-25**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: KINGSTON PARK RESTROOM					\$625.00
------------------------	---	--	--	--	--	-----------------

Facility: **KINGSTON PARK RESTROOM**

Area: **Exterior**

Part/Floor: **On-site**

Address: 13196 DOUGLAS AVE.

Year to be Completed: **FY 24-25**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Year to be Completed: FY 24-25					\$99,458.00
------------------------	---------------------------------------	--	--	--	--	--------------------

Facility: **AVENAL LIBRARY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 501 E. KINGS ST.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

3 Restroom - Unisex

Toilet Stall

4505

• *As-Built Description:*

The lavatory or other unintended fixture, encroaches on the necessary clearance around a water closet (60" x 56").

• *As-Built:* 16" to lavatory, 42.25" to side wall

• *Proposed Solution:*

Remove adjacent fixture and provide new enclosure at accessible water closet.

• *Notes:*

60" needed

PCODE **WB01A**

ADA 2010 **604.3.1; 604.3.2**

CBC 2013 **11B-604.3.1; 11B**

-604.3.2

Priority **3**

Severity **1**

FY 25-26 **Contract Work**

1 JOB \$2,000 **\$2,000**



Total Costs for	Part/floor: Interior	Ground Floor	\$2,000.00
------------------------	-----------------------------	---------------------	-------------------

Facility: **AVENAL LIBRARY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 501 E. KINGS ST.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$2,000.00

Facility: **AVENAL LIBRARY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 501 E. KINGS ST.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: AVENAL LIBRARY					\$2,000.00
------------------------	---------------------------------	--	--	--	--	-------------------

Facility: **CORCORAN LIBRARY**
 Address: 1001 CHITTENDEN AVE.

Area: **Exterior**
 Year to be Completed: **FY 25-26**

Part/Floor: **On-site**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 Exit on Hanna

Handrails

- 4734
- As-Built Description:**
Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).
 - Proposed Solution:**
Provide new handrail for each side including extensions.

PCODE **ED01REF**
 ADAAG **4.8.5 & 4.9.4**
 ADA 2010 **505.2**
 CBC 2010 **1133B.4.1.1 & .5.5**
 CBC 2013 **11B-505.2**
 Priority **3**
 Severity **2**
 FY 25-26 **Contract Work**

REF



Slope

- 4733
- As-Built Description:**
Slope greater than 1:12 (8.3%).
 - As-Built:** 25.2%
 - Proposed Solution:**
Demolish existing and provide new ramp with handrails.
 - Notes:**
14" high

PCODE **EB02**
 ADAAG **4.8.2**
 ADA 2010 **405.2**
 CBC 2010 **1133B.5.3**
 CBC 2013 **11B-405.2**
 Priority **3**
 Severity **1**
 FY 25-26 **Contract Work**

56 SF \$100 **\$5,600**



Total Costs for	Part/floor: Exterior	On-site	\$5,600.00
------------------------	-----------------------------	----------------	-------------------

Facility: **CORCORAN LIBRARY**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1001 CHITTENDEN AVE.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$5,600.00

Facility: **CORCORAN LIBRARY**
 Address: 1001 CHITTENDEN AVE.


Area: **Interior**
 Year to be Completed: **FY 25-26**


Part/Floor: **Ground Floor**
 Priority No: **3**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Main Entrance & Lobby

Drinking Fountain

<p>4741</p> <ul style="list-style-type: none"> As-Built Description: Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping. Proposed Solution: Provide additional fountain or hi-lo combination fountain. 	<p>PCODE IA01A ADAAG 4.1.3(10)(a) ADA 2010 211.1 CBC 2010 1115B.4.6.1 CBC 2013 11B-211.1 Priority 3 Severity 2 FY 25-26 Contract Work</p>	<p>1 JOB \$2,000 \$2,000</p>	
--	--	-------------------------------------	---

<p>4740</p> <ul style="list-style-type: none"> As-Built Description: Drinking fountain is not 18" - 19" in depth. As-Built: 8" - 12" deep Proposed Solution: Provide new, accessible fountain. 	<p>PCODE IA02B ADAAG 4.15.5(1) ADA 2010 602.8 CBC 2010 1115B.4.6.2 CBC 2013 11B-602.8 Priority 3 Severity 1 FY 25-26 Contract Work</p>	<p>1 JOB \$3,200 \$3,200</p>	
--	---	-------------------------------------	--


<p>4739</p> <ul style="list-style-type: none"> As-Built Description: CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. Proposed Solution: Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	<p>PCODE IA04 CBC 2010 1115B.4.6.3; Fig. CBC 2013 11B-602.9 Priority 3 Severity 2 FY 25-26 Contract Work</p>	<p>1 JOB \$3,000 \$3,000</p>	
--	---	-------------------------------------	---

3 Men's Restroom

Facility: **CORCORAN LIBRARY**
 Address: 1001 CHITTENDEN AVE.

Area: **Interior**
 Year to be Completed: **FY 25-26**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Toilet Stall</u>						
4761	<ul style="list-style-type: none"> <i>As-Built Description:</i> The lavatory or other unintended fixture, encroaches on the necessary clearance around a water closet (60" x 56"). <i>As-Built:</i> 14" to urinal, 38" to side wall <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet. 	PCODE WB01A ADA 2010 604.3.1; 604.3.2 CBC 2013 11B-604.3.1; 11B-604.3.2 Priority 3 Severity 1 FY 25-26 Contract Work	1	JOB	\$2,000	\$2,000
						

Total Costs for	Part/floor: Interior	Ground Floor	\$10,200.00
------------------------	-----------------------------	---------------------	--------------------

Facility: **CORCORAN LIBRARY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1001 CHITTENDEN AVE.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$10,200.00

Facility: **CORCORAN LIBRARY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1001 CHITTENDEN AVE.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Facility: CORCORAN LIBRARY \$15,800.00

Facility: **GOVERNMENT CENTER CAMPUS**
 Address: 1400 W. LACEY BLVD.




Area: **Exterior**
 Year to be Completed: **FY 25-26**

Part/Floor: **On-site**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

5 POT from Finance Building #7 to Admin Building #1

Drinking Fountain

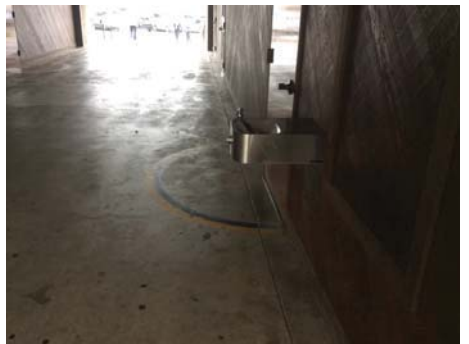511	<ul style="list-style-type: none"> As-Built Description: Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping. Proposed Solution: Relocate and provide additional fountain or hi-lo combination fountain. 	PCODE IA01A ADAAG 4.1.3(10)(a) ADA 2010 211.1 CBC 2010 1115B.4.6.1 CBC 2013 11B-211.1 Priority 3 Severity 2 FY 25-26 Contract Work	1	JOB	\$2,000	\$2,000
						
513	<ul style="list-style-type: none"> As-Built Description: Drinking fountain water flow less than 4" high; unit in good condition. As-Built: 0.25" Proposed Solution: Adjust water flow. 	PCODE IA03D ADAAG 4.15.3 ADA 2010 602.6 CBC 2010 1115B.4.6.5 CBC 2013 11B-602.6 Priority 3 Severity 1 FY 25-26 Contract Work	1	JOB	\$75	\$75
						
512	<ul style="list-style-type: none"> As-Built Description: CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. Proposed Solution: Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	PCODE IA04 CBC 2010 1115B.4.6.3; Fig. CBC 2013 11B-602.9 Priority 3 Severity 2 FY 25-26 Contract Work	1	JOB	\$3,000	\$3,000
						

19 POT from Probation to Law Building

Facility: **GOVERNMENT CENTER CAMPUS**
 Address: 1400 W. LACEY BLVD.

Area: **Exterior**
 Year to be Completed: **FY 25-26**

Part/Floor: **On-site**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Handrail

2593 • *As-Built Description:*
 Guards (42" high) not provided at side of ramp or landing where drop-off to adjacent grade or floor exceeds 30" height (California building code requirement only).
 • *Proposed Solution:*
 Provide new guards along drop-off area.
 • *Notes:*
43" drop at loading zone, extreme hazard

PCODE **ED08B**
CBC 2010 **1013.1**
CBC 2013 **Section 1013.2;**
1013.3
Priority **3**
Severity **2**
FY 25-26 Contract Work

50 LF \$120 **\$6,000**



Total Costs for	Part/floor: Exterior	On-site				\$11,075.00
------------------------	-----------------------------	----------------	--	--	--	--------------------

Facility: **GOVERNMENT CENTER CAMPUS**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$11,075.00

Facility: **GOVERNMENT CENTER CAMPUS**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: GOVERNMENT CENTER CAMPUS	\$11,075.00
------------------------	---	--------------------

Facility: **ADMINISTRATION BUILDING**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 25-26**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

8 Admin & Board of Supervisor Offices

Drinking Fountain

448

- *As-Built Description:*
Drinking fountain is not 18" - 19" in depth.
- *As-Built:* 6.75"
- *Proposed Solution:*
Provide new, accessible fountain.

PCODE **IA02B**
 ADAAG **4.15.5(1)**
 ADA 2010 **602.8**
 CBC 2010 **1115B.4.6.2**
 CBC 2013 **11B-602.8**
 Priority **3**
 Severity **1**
 FY 25-26 **Contract Work**

1 JOB \$3,200 **\$3,200**



Total Costs for	Part/floor: Interior	Ground Floor	\$3,200.00
------------------------	-----------------------------	---------------------	-------------------

Facility: **ADMINISTRATION BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Area: Interior **\$3,200.00**

Facility: **ADMINISTRATION BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: ADMINISTRATION BUILDING					\$3,200.00
------------------------	--	--	--	--	--	-------------------

Facility: **HANFORD LIBRARY**
 Address: 401 N. DOUTY ST.

Area: **Interior**
 Year to be Completed: **FY 25-26**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

3 Mezzanine

Handrail

2995

- *As-Built Description:*
 Open guards does not have balusters or ornamental patterns such that a 4-inch-diameter (102 mm) sphere cannot pass through any opening.
- *As-Built:* 5" at original railing
- *Proposed Solution:*
 Provide new guards which do not allow passage of an 4 inch sphere at any opening.

PCODE **ED08A**
 ADA 2010 **405.9.2**
 CBC 2010 **1013.3**
 CBC 2013 **11B-405.9.2**
 Priority **2**
 Severity **4**
 FY 25-26 **Contract Work**

60 LF \$120 **\$7,200**



Total Costs for	Part/floor: Interior	Ground Floor	\$7,200.00
------------------------	-----------------------------	---------------------	-------------------

Facility: **HANFORD LIBRARY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 401 N. DOUTY ST.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$7,200.00

Facility: **HANFORD LIBRARY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 401 N. DOUTY ST.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: HANFORD LIBRARY					\$7,200.00
------------------------	----------------------------------	--	--	--	--	-------------------

Facility: **STRATFORD LIBRARY**

Area: **Exterior**

Part/Floor: **On-site**

Address: 20300 MAIN ST.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

4 Exit

Accessible Route

4583

- *As-Built Description:*
No walk / sidewalk provided to connect accessible facilities or elements that are on the same site.
- *As-Built:* No exit path, landing 53.5"
- *Proposed Solution:*
Provide new 48" wide walk / sidewalk.

PCODE EF13REF
 ADAAG 4.3.2
 ADA 2010 206.1
 CBC 2010 1114B.1.2
 CBC 2013 11B-206.1
 Priority 3
 Severity 1
 FY 25-26 Contract Work

REF



Total Costs for Part/floor: Exterior On-site

Facility: **STRATFORD LIBRARY**

Area: **Exterior**

Part/Floor: **On-site**

Address: 20300 MAIN ST.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for **Area: Exterior**

Facility: **STRATFORD LIBRARY**

Area: **Exterior**

Part/Floor: **On-site**

Address: 20300 MAIN ST.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Facility: STRATFORD LIBRARY

Facility: **HICKEY PARK**
 Address: 16850 FLINT AVE.

Area: **Exterior**
 Year to be Completed: **FY 25-26**

Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 POT to Areas 1 & 2

Cooking and Grills

- 4944
- *As-Built Description:*
Single cook surface height is not between 28" and 34" above ground surface.
 - *As-Built:* 35"
 - *Proposed Solution:*
Replace with new cook surface.
 - *Notes:*
Adjust. also difficult to open and close

PCODE NJ01A
 ADAAG 16.7.3
 ADA 2010 804.3.2
 CBC 2010 1132B.1
 CBC 2013 11B-804.3.2
 Priority 2
 Severity 4
 FY 25-26 Contract Work

2 JOB \$200 \$400



4 POT From Lot to Area 4 and Drinking Fountain

Accessible Route

- 4950
- *As-Built Description:*
No walk / sidewalk provided to connect accessible facilities or elements that are on the same site.
 - *As-Built:* To Drinking Fountain
 - *Proposed Solution:*
Provide new 48" wide walk / sidewalk.

PCODE EF13
 ADAAG 4.3.2
 ADA 2010 206.1
 CBC 2010 1114B.1.2
 CBC 2013 11B-206.1
 Priority 3
 Severity 1
 FY 25-26 Contract Work

80 LF \$45 \$3,600



6 Accessible Parking Spaces Serving Restroom and Area 32

Drinking Fountain

- 5140
- *As-Built Description:*
Drinking fountain water flow less than 4" high; unit in good condition.
 - *As-Built:* 0"
 - *Proposed Solution:*
Adjust water flow.

PCODE IA03D
 ADAAG 4.15.3
 ADA 2010 602.6
 CBC 2010 1115B.4.6.5
 CBC 2013 11B-602.6
 Priority 3
 Severity 1
 FY 25-26 Contract Work

1 JOB \$75 \$75



Total Costs for	Part/floor: Exterior	On-site	\$4,075.00
------------------------	-----------------------------	----------------	-------------------

Facility: **HICKEY PARK**
Address: 16850 FLINT AVE.

Area: **Exterior**
Year to be Completed: **FY 25-26**

Part/Floor: **On-site**
Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Area: Exterior \$4,075.00

Facility: **HICKEY PARK**
Address: 16850 FLINT AVE.

Area: **Exterior**
Year to be Completed: **FY 25-26**

Part/Floor: **On-site**
Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Facility: HICKEY PARK \$4,075.00

Facility: **BURRIS PARK**
 Address: 6500 CLINTON AVE.

Area: **Exterior**
 Year to be Completed: **FY 25-26**

Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 East Accessible Spaces & Picnic Area B

Changes in Level

5035	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route. <i>As-Built:</i> 0.5-1" <i>Proposed Solution:</i> Remove, replace or repair area of pavement sufficient to correct abrupt change in level. 	PCODE EF03 ADAAG 4.3.8 ADA 2010 403.4 CBC 2010 1133B.7.4 CBC 2013 11B-403.4 Priority 2 Severity 4 FY 25-26 Contract Work	8	SF	\$21	\$168
------	---	---	---	----	------	-------



Public Counter

5033	<ul style="list-style-type: none"> <i>As-Built Description:</i> Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. <i>As-Built:</i> 38" <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. <i>Notes:</i> 34" lower counter provided at side hatch counter. 	PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 2 Severity 4 FY 25-26 Contract Work	1	JOB	\$150	\$150
------	--	--	---	-----	-------	-------



Walk

5032	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk more than 36" but less than 48" wide (required in CA only). <i>As-Built:</i> 40" wide and tables protrude into path. <i>Proposed Solution:</i> Enlarge width of walk to 48". <i>Notes:</i> Acc tables provided along main path. clearance between tables not provided. 	PCODE EF08REF ADA 2010 403.5 CBC 2010 1133B.7.1 CBC 2013 11B-403.5.1.3 Priority 2 Severity 4 FY 25-26 Contract Work		REF		
------	--	---	--	-----	--	--




3 Accessible Parking & Picnic Area Y


Facility: **BURRIS PARK**
 Address: 6500 CLINTON AVE.

Area: **Exterior**
 Year to be Completed: **FY 25-26**

Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Public Counter</u>						
5067	<ul style="list-style-type: none"> <i>As-Built Description:</i> Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. <i>As-Built:</i> 36" counters. <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 2 Severity 4 FY 25-26 Contract Work	1	JOB	\$150	\$150
						

7 Museum Wagon Barn

<u>Changes in Level</u>						
5198	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route. <i>As-Built:</i> 1" <i>Proposed Solution:</i> Remove, replace or repair area of pavement sufficient to correct abrupt change in level. 	PCODE EF03REF ADAAG 4.3.8 ADA 2010 403.4 CBC 2010 1133B.7.4 CBC 2013 11B-403.4 Priority 2 Severity 4 FY 25-26 Contract Work	REF			

Total Costs for Part/floor: Exterior On-site **\$468.00**

Facility: **BURRIS PARK**

Area: **Exterior**

Part/Floor: **On-site**

Address: 6500 CLINTON AVE.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$468.00

Facility: **BURRIS PARK**
 Address: 6500 CLINTON AVE.

Area: **Interior-Multi-Purpose**
 Year to be Completed: **FY 25-26**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Multi-Purpose Bldg.

Ovens

- 5208
- *As-Built Description:*
Oven controls are not on front panel of oven.
 - *As-Built:* 45" - 46"
 - *Proposed Solution:*
Provide oven with accessible controls.

PCODE **KF22**
 ADAAG **13.3.4(7)**
 ADA 2010 **804.6.5.3**
 CBC 2010 **1111B.5.1**
 CBC 2013 **11B-804.6.5.3**
 Priority **2**
 Severity **4**
 FY 25-26 **Contract Work**

1 JOB \$800 **\$800**



Sink

- 5206
- *As-Built Description:*
Sink rim higher than 34" above floor.
 - *As-Built:* 34.25"-34.5" to sink rim
 - *Proposed Solution:*
Remodel sink cabinet to lower sink.

PCODE **IN06**
 ADAAG **4.24.2**
 ADA 2010 **606.3**
 CBC 2010 **1115B.4.7.1**
 CBC 2013 **11B-606.3**
 Priority **2**
 Severity **4**
 FY 25-26 **Contract Work**

2 JOB \$1,750 **\$3,500**



Total Costs for	Part/floor: Interior-Multi-	Ground Floor	\$4,300.00
------------------------	------------------------------------	---------------------	-------------------

Facility: **BURRIS PARK**

Area: **Interior-Multi-Purpose**

Part/Floor: **Ground Floor**

Address: 6500 CLINTON AVE.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Area: Interior-Multi-Purpose					\$4,300.00
------------------------	-------------------------------------	--	--	--	--	-------------------

Facility: **BURRIS PARK**
 Address: 6500 CLINTON AVE.

Area: **Interior-Museum**
 Year to be Completed: **FY 25-26**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 Museum General

Changes in Level

5230

- *As-Built Description:*
 Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route.
- *As-Built:* 0.5"
- *Proposed Solution:*
 Remove, replace or repair area of pavement sufficient to correct abrupt change in level.
- **Notes:**
Maintain transitions.

PCODE **EF03**
 ADAAG **4.3.8**
 ADA 2010 **403.4**
 CBC 2010 **1133B.7.4**
 CBC 2013 **11B-403.4**
 Priority **2**
 Severity **4**
 FY 25-26 **Contract Work**

10 SF \$21 **\$210**



Total Costs for	Part/floor: Interior-Museum	Ground Floor	\$210.00
------------------------	------------------------------------	---------------------	-----------------

Facility: **BURRIS PARK**

Area: **Interior-Museum**

Part/Floor: **Ground Floor**

Address: 6500 CLINTON AVE.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Area: Interior-Museum					\$210.00
------------------------	------------------------------	--	--	--	--	-----------------

Facility: **BURRIS PARK**

Area: **Interior-Museum**

Part/Floor: **Ground Floor**

Address: 6500 CLINTON AVE.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: BURRIS PARK					\$4,978.00
------------------------	------------------------------	--	--	--	--	-------------------

Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 25-26**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 Human Resources

Door

3602	<ul style="list-style-type: none"> <i>As-Built Description:</i> Vision Light at door that permits viewing, does not have bottom of at least one glazed panel located 43 inches maximum above the finish floor. (Exception: More than 66" above finished floor.) <i>As-Built:</i> 47.25" <i>Proposed Solution:</i> Provide new door with vision panel at 43" max. 	<p>PCODE ID06C ADA 2010 404.2.11 CBC 2013 11B-404.2.11 Priority 2 Severity 4 FY 25-26 Maintenance Work</p>	1	JOB	\$2,500	\$2,500
------	---	---	---	-----	---------	---------



3 Restroom Corridor & Credentials

Door Hardware


3613	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door does not have accessible operating hardware. <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	<p>PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 3 Severity 3 FY 25-26 Maintenance Work</p>	5	JOB	\$250	\$1,250
------	--	--	---	-----	-------	---------



4 Conference Room

Door


3621	<ul style="list-style-type: none"> <i>As-Built Description:</i> Vision Light at door that permits viewing, does not have bottom of at least one glazed panel located 43 inches maximum above the finish floor. (Exception: More than 66" above finished floor.) <i>As-Built:</i> 47" <i>Proposed Solution:</i> Provide new door with vision panel at 43" max. 	<p>PCODE ID06C ADA 2010 404.2.11 CBC 2013 11B-404.2.11 Priority 2 Severity 4 FY 25-26 Maintenance Work</p>	1	JOB	\$2,500	\$2,500
------	--	---	---	-----	---------	---------

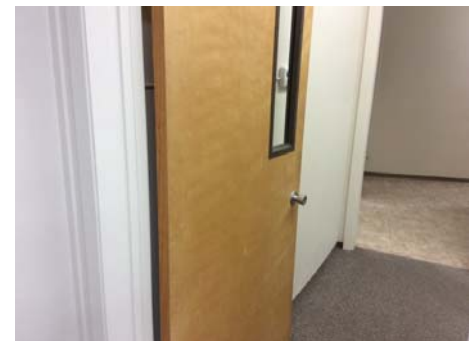


Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **FY 25-26**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door Swing						
3624	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". <i>As-Built:</i> DW + 12" <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID23A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$50	\$50
						

Electrical						
3623	<ul style="list-style-type: none"> <i>As-Built Description:</i> Electric switch or control mounted less than 36" or more than 48" above floor to center. <i>As-Built:</i> Light switch: 53" <i>Proposed Solution:</i> Relocate light switches or control to between 36" and 48" height. 	PCODE IC01 ADAAG 4.2.5 & 6 ADA 2010 308.2.1 & 308.2.2 CBC 2010 1117B.6.3 CBC 2013 11B-308.2.1 & 11B-308.2.2 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$300	\$300
						


6 Large Conference Room


Door						
3635	<ul style="list-style-type: none"> <i>As-Built Description:</i> Vision Light at door that permits viewing, does not have bottom of at least one glazed panel located 43 inches maximum above the finish floor. (Exception: More than 66" above finished floor.) <i>As-Built:</i> 47.5" <i>Proposed Solution:</i> Provide new door with vision panel at 43" max. 	PCODE ID06C ADA 2010 404.2.11 CBC 2013 11B-404.2.11 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$2,500	\$2,500
						

Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **FY 25-26**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Swing</u>						
3646	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). <i>As-Built:</i> Trash bin <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID24A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$50	\$50
						

<u>Signage</u>						
3633	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sign designating a permanent room or space is not centered at 60" above the finished floor. <i>Proposed Solution:</i> Remount signage to 60" o.c., remodel wall as needed. 	PCODE SA07B ADAAG 4.30.6 ADA 2010 703.4.1 CBC 2010 1117B.5.7 CBC 2013 11B-703.4.1 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$150	\$150
						



8 Unisex Staff RR

<u>Coat Hook</u>						
3653	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible coat hook not within reach range. <i>As-Built:</i> 67" <i>Proposed Solution:</i> Adjust existing or provide new coat hook at maximum 48" height. 	PCODE WG03A ADAAG 4.2.5 ADA 2010 603.4 CBC 2010 1118B.5 CBC 2013 11B-603.4 Priority 3 Severity 1 FY 25-26 Maintenance Work	1	JOB	\$50	\$50
						

Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 25-26**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Grab Bars						
3663	<ul style="list-style-type: none"> <i>As-Built Description:</i> The rear wall grab is less than 36" min. or does not extend from the centerline of the water closet 12" min. on one side and 24" min. on the other side. <i>As-Built:</i> 30" RGB <i>Proposed Solution:</i> Provide or relocate accessible rear grab bar. 	PCODE WB07B ADAAG 4.17.6 ADA 2010 604.5.2 CBC 2010 1115B.4.1.3.2 CBC 2013 11B-604.5.2 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$340	\$340
						
3660	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessories/dispensers in accessible stall located closer than 1-1/2" below or 12" above grab bar impedes its use. <i>As-Built:</i> TPD: 4" <i>Proposed Solution:</i> Relocate accessories/dispensers to be no closer than 1-1/2" below and 12" above grab bars (except if accessories are recessed, flush with wall, and have no sharp edges). 	PCODE WB07I ADAAG 4.26.2 ADA 2010 609.3 CBC 2010 1133B.4.2.5 CBC 2013 11B-609.3 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$75	\$75
						

Total Costs for Part/floor: Interior Ground Floor \$9,765.00

Facility: **SUPERINTENDENT OF SCHOOLS**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1144 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$9,765.00

Facility: **SUPERINTENDENT OF SCHOOLS**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1144 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: SUPERINTENDENT OF SCHOOLS					\$9,765.00
------------------------	--	--	--	--	--	-------------------

Facility: **JOB TRAINING OFFICE**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 Lobby Restroom - Women's

Grab Bars

3818

As-Built Description:

Side grab bar less than 42" long, or located more than 12 inches max. from the rear wall, or extending less than 54" from rear wall (CA only: front end min. 24" in front of water closet).

As-Built: 42" @ 43"

Proposed Solution:

Provide or relocate accessible side grab bar.

PCODE **WB07A**
 ADAAG **Fig. 29(b)**
 ADA 2010 **604.5.1**
 CBC 2010 **1115B.4.1.3.1**
 CBC 2013 **11B-604.5.1**
 Priority **3**
 Severity **1**
 FY 25-26 **Maintenance Work**

1 JOB \$260 \$260



4 Career Center

Reach Range

3828

As-Built Description:

Reach height to control or access point, where only forward approach is available, exceeds 48" or is less than 15".

As-Built: 50" to tall printer

Proposed Solution:

Modify equipment or mounting.

PCODE **IE01**
 ADAAG **4.2.5**
 ADA 2010 **308.2.1**
 CBC 2010 **1118B.5**
 CBC 2013 **11B-308.2.1**
 Priority **2**
 Severity **4**
 FY 25-26 **Maintenance Work**

1 JOB \$100 \$100



9 Conference Room

Door

3841

As-Built Description:

Vision Light at door that permits viewing, does not have bottom of at least one glazed panel located 43 inches maximum above the finish floor.

(Exception: More than 66" above finished floor.)


As-Built: 48"

Proposed Solution:

Provide new door with vision panel at 43" max.

PCODE **ID06C**
 ADA 2010 **404.2.11**
 CBC 2013 **11B-404.2.11**
 Priority **2**
 Severity **4**
 FY 25-26 **Maintenance Work**

1 JOB \$2,500 \$2,500

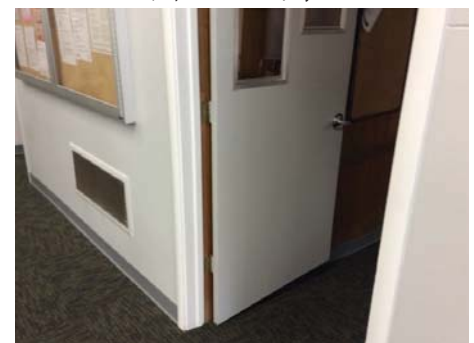

Total Costs for	Part/floor: Interior	Ground Floor	\$2,860.00
------------------------	-----------------------------	---------------------	-------------------

Facility: **JOB TRAINING OFFICE**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$2,860.00

Facility: **JOB TRAINING OFFICE**

Area: **Interior-EDC**

Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

15 EDC Conference Room

Electrical

3878	<ul style="list-style-type: none"> <i>As-Built Description:</i> Electric switch or control mounted less than 36" or more than 48" above floor to center. <i>As-Built:</i> Light switch: 50" <i>Proposed Solution:</i> Relocate light switches or control to between 36" and 48" height. 	<p>PCODE IC01 ADAAG 4.2.5 & 6 ADA 2010 308.2.1 & 308.2.2 CBC 2010 1117B.6.3 CBC 2013 11B-308.2.1 & 11B-308.2.2 Priority 2 Severity 4 FY 25-26 Maintenance Work</p>	1	JOB	\$300	\$300
------	--	---	---	-----	-------	-------



17 JTO Staff Offices

Door Swing

3882	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). <i>Proposed Solution:</i> Remove or relocate furniture or storage items. <i>Notes:</i> Leads to a non marked exit. verify with fire marshal and provide accessible route and door landings etc. 	<p>PCODE ID24A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 4 FY 25-26 Maintenance Work</p>	1	JOB	\$50	\$50
------	--	--	---	-----	------	------



Total Costs for	Part/floor: Interior-EDC	Ground Floor	\$350.00
------------------------	---------------------------------	---------------------	-----------------

Facility: **JOB TRAINING OFFICE**

Area: **Interior-EDC**

Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior-EDC

\$350.00

Facility: **JOB TRAINING OFFICE**

Area: **Interior-EDC**

Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: JOB TRAINING OFFICE					\$3,210.00
------------------------	--------------------------------------	--	--	--	--	-------------------

Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 25-26**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Central Services Lobby

Fire Alarm

945	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled. • <i>As-Built:</i> 61" • <i>Proposed Solution:</i> Remount fire alarm station to be 48" from floor to center. 	PCODE IC03 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 907.4.2 CBC 2013 907.4.2.2 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$275	\$275
-----	--	--	---	-----	-------	-------



3 Minors Advocates Offices

Door Closer

966	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door. • <i>As-Built:</i> 9 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$25	\$25
-----	--	--	---	-----	------	------



4 Central Services Office

Door Closer


971	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Excessive force required to open door. • <i>As-Built:</i> 9 lbs • <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$25	\$25
-----	--	--	---	-----	------	------




Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **FY 25-26**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Fire Alarm</u>						
981	<ul style="list-style-type: none"> As-Built Description: Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled. As-Built: 62" Proposed Solution: Remount fire alarm station to be 48" from floor to center. 	PCODE IC03 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 907.4.2 CBC 2013 907.4.2.2 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$275	\$275
						

<u>Reach Range</u>						
982	<ul style="list-style-type: none"> As-Built Description: Reach height to control or access point, where only forward approach is available, exceeds 48" or is less than 15". As-Built: CH: 69" Proposed Solution: Modify equipment or mounting. 	PCODE IE01 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 1118B.5 CBC 2013 11B-308.2.1 Priority 3 Severity 1 FY 25-26 Maintenance Work	1	JOB	\$100	\$100
						


7 Corridors

<u>Door Closer</u>						
998	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door. As-Built: 9 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$25	\$25
						


Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 25-26**


Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Fire Alarm</u>						
994	<ul style="list-style-type: none"> <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled. <i>As-Built:</i> 61" <i>Proposed Solution:</i> Remount fire alarm station to be 48" from floor to center. 	PCODE IC03 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 907.4.2 CBC 2013 907.4.2.2 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$275	\$275
						

8 Restroom Corridor

<u>Fire Alarm</u>						
1006	<ul style="list-style-type: none"> <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled. <i>As-Built:</i> 61" <i>Proposed Solution:</i> Remount fire alarm station to be 48" from floor to center. 	PCODE IC03 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 907.4.2 CBC 2013 907.4.2.2 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$275	\$275
						

9 Women's Restroom

<u>Accessories</u>						
1015	<ul style="list-style-type: none"> <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 48" (CA only: 40") from floor to highest operating slot or control. <i>As-Built:</i> FND: 52" <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 4.23.7 ADA 2010 308.2.1 CBC 2010 1115B.8.3 CBC 2013 11B-603.5 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$100	\$100
						

Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 25-26**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1027	<ul style="list-style-type: none"> <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 48" (CA only: 40") from floor to highest operating slot or control. <i>As-Built:</i> SCD: 54" <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 4.23.7 ADA 2010 308.2.1 CBC 2010 1115B.8.3 CBC 2013 11B-603.5 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$100	\$100



Coat Hook


1026	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible coat hook not within reach range. <i>As-Built:</i> 68" <i>Proposed Solution:</i> Adjust existing or provide new coat hook at maximum 48" height. 	PCODE WG03A ADAAG 4.2.5 ADA 2010 603.4 CBC 2010 1118B.5 CBC 2013 11B-603.4 Priority 3 Severity 1 FY 25-26 Maintenance Work	1	JOB	\$50	\$50
------	--	---	---	-----	------	------



11 Dispatch Center

Corridor


1055	<ul style="list-style-type: none"> <i>As-Built Description:</i> Corridor less than 44" wide when occupant load 10 or more. <i>As-Built:</i> 40" <i>Proposed Solution:</i> Remove or relocate furniture and storage items. 	PCODE IH01A ADAAG 4.3.3 CBC 2010 1133B.3.1 CBC 2013 11B-403.5.1 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$50	\$50
------	--	--	---	-----	------	------

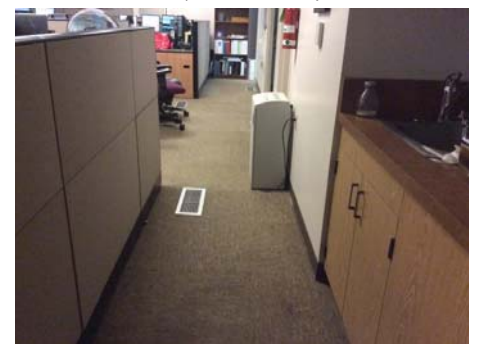

Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 25-26**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Protrusion Limits</u>						
1050	<ul style="list-style-type: none"> <i>As-Built Description:</i> Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor. <i>As-Built:</i> Drop box: 5.75" protrusion at 49" <i>Proposed Solution:</i> Remove/relocate protruding object. Patch existing surface. 	PCODE EG04REF ADAAG 4.4.1 ADA 2010 307.2 CBC 2010 1133B.8.6.1 CBC 2013 11B-307.2 Priority 2 Severity 4 FY 25-26 Maintenance Work				
				REF		

Total Costs for	Part/floor: Interior	Ground Floor	\$1,575.00
------------------------	-----------------------------	---------------------	-------------------

Facility: **COUNTY SERVICES OFFICES**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$1,575.00

Facility: **COUNTY SERVICES OFFICES**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: COUNTY SERVICES OFFICES					\$1,575.00
------------------------	--	--	--	--	--	-------------------

Facility: **ENGINEERING BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Public Works Lobby

Fire Alarm

768

• *As-Built Description:*

Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled.

• *As-Built:* 61"

• *Proposed Solution:*

Remount fire alarm station to be 48" from floor to center.

PCODE IC03

ADAAG 4.2.5

ADA 2010 308.2.1

CBC 2010 907.4.2

CBC 2013 907.4.2.2

Priority 3

Severity 2

FY 25-26 Maintenance Work

1 JOB \$275 \$275



3 Restroom Corridor

Fire Alarm

783

• *As-Built Description:*

Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled.

• *As-Built:* 61"

• *Proposed Solution:*

Remount fire alarm station to be 48" from floor to center.

PCODE IC03

ADAAG 4.2.5

ADA 2010 308.2.1

CBC 2010 907.4.2

CBC 2013 907.4.2.2

Priority 3

Severity 2

FY 25-26 Maintenance Work

1 JOB \$275 \$275



4 Women's Public Restroom

Accessories

800

• *As-Built Description:*

Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 48" (CA only: 40") from floor to highest operating slot or control.

• *As-Built:* SCD: 52"

• *Proposed Solution:*

Relocate existing restroom accessories.

PCODE WG01A

ADAAG 4.23.7

ADA 2010 308.2.1

CBC 2010 1115B.8.3

CBC 2013 11B-603.5

Priority 3

Severity 2

FY 25-26 Maintenance Work

1 JOB \$100 \$100



Facility: **ENGINEERING BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Coat Hook</u>						
805	<ul style="list-style-type: none"> As-Built Description: Accessible coat hook not within reach range. As-Built: 67" Proposed Solution: Adjust existing or provide new coat hook at maximum 48" height. 	PCODE WG03A ADAAG 4.2.5 ADA 2010 603.4 CBC 2010 1118B.5 CBC 2013 11B-603.4 Priority 3 Severity 1 FY 25-26 Maintenance Work	1	JOB	\$50	\$50
						

<u>Grab Bars</u>						
801	<ul style="list-style-type: none"> As-Built Description: Accessories/dispensers in accessible stall located closer than 1-1/2" below or 12" above grab bar impedes its use. As-Built: TPD: 6" Proposed Solution: Relocate accessories/dispensers to be no closer than 1-1/2" below and 12" above grab bars (except if accessories are recessed, flush with wall, and have no sharp edges). 	PCODE WB07I ADAAG 4.26.2 ADA 2010 609.3 CBC 2010 1133B.4.2.5 CBC 2013 11B-609.3 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$75	\$75
						

5 Men's Public Restroom

<u>Accessories</u>						
824	<ul style="list-style-type: none"> As-Built Description: Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 48" (CA only: 40") from floor to highest operating slot or control. As-Built: SCD: 57" Proposed Solution: Relocate existing restroom accessories. 	PCODE WG01A ADAAG 4.23.7 ADA 2010 308.2.1 CBC 2010 1115B.8.3 CBC 2013 11B-603.5 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$100	\$100
						

Facility: **ENGINEERING BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 25-26**

Priority No: **3**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Coat Hook</u>						
827	<ul style="list-style-type: none"> As-Built Description: Accessible coat hook not within reach range. As-Built: 67" Proposed Solution: Adjust existing or provide new coat hook at maximum 48" height. 	PCODE WG03A ADAAG 4.2.5 ADA 2010 603.4 CBC 2010 1118B.5 CBC 2013 11B-603.4 Priority 3 Severity 1 FY 25-26 Maintenance Work	1	JOB	\$50	\$50
						

6 Public Works Office

Door Closer

815	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door. As-Built: 7 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$25	\$25
						

Signage

818	<ul style="list-style-type: none"> As-Built Description: Existing sign designating permanent room or space is noncompliant. Proposed Solution: Provide compliant signage. 	PCODE SA13 ADAAG 4.1.3(16)(a) ADA 2010 216.2 CBC 2010 1117B.5 CBC 2013 11B-216.2 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$150	\$150
						

7 Public Works Office Corridors

Facility: **ENGINEERING BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Closer</u>						
838	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door. As-Built: 10 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$25	\$25
						

<u>Fire Alarm</u>						
834	<ul style="list-style-type: none"> As-Built Description: Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled. As-Built: 61" Proposed Solution: Remount fire alarm station to be 48" from floor to center. 	PCODE IC03 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 907.4.2 CBC 2013 907.4.2.2 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$275	\$275
						

9 Planning Offices

<u>Door Closer</u>						
856	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door. As-Built: 8 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$25	\$25
						

Facility: **ENGINEERING BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**


Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
861	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door. As-Built: 9 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$25	\$25



Door Swing


855	<ul style="list-style-type: none"> As-Built Description: Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". As-Built: 12" Proposed Solution: Provide power door operator. 	PCODE ID23C ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$5,000	\$5,000
-----	---	---	---	-----	---------	---------

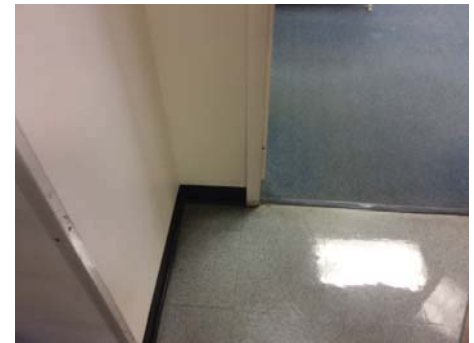

12 IT & Purchasing Lobby

Fire Alarm

882	<ul style="list-style-type: none"> As-Built Description: Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled. As-Built: 61" Proposed Solution: Remount fire alarm station to be 48" from floor to center. 	PCODE IC03 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 907.4.2 CBC 2013 907.4.2.2 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$275	\$275
-----	---	--	---	-----	-------	-------

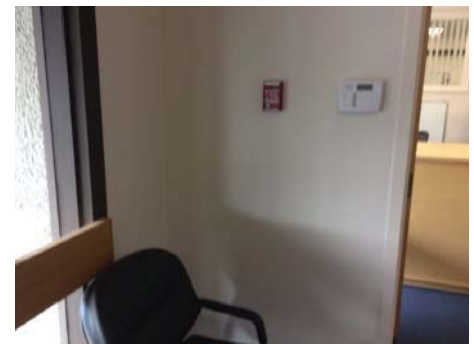

13 IT Offices

Facility: **ENGINEERING BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Closer</u>						
904	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door. As-Built: 7 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$25	\$25
						

<u>Door Swing</u>						
894	<ul style="list-style-type: none"> As-Built Description: Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". As-Built: 3" Proposed Solution: Remove or relocate furniture or storage items. 	PCODE ID23A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$50	\$50
						

14 Server Room & Offices

<u>Door Closer</u>						
909	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door. As-Built: 9 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 4 FY 25-26 Maintenance Work	2	JOB	\$25	\$50
						

Facility: **ENGINEERING BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
915	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door. As-Built: 8 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 4 FY 25-26 Maintenance Work	2	JOB	\$25	\$50



Total Costs for	Part/floor: Interior	Ground Floor				\$6,900.00
------------------------	-----------------------------	---------------------	--	--	--	-------------------

Facility: **ENGINEERING BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$6,900.00

Facility: **ENGINEERING BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: ENGINEERING BUILDING					\$6,900.00
------------------------	---------------------------------------	--	--	--	--	-------------------

Facility: **FINANCE BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 Treasurer Staff Offices

Fire Alarm

585

• *As-Built Description:*

Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled.

• *As-Built:* 61"

• *Proposed Solution:*

Remount fire alarm station to be 48" from floor to center.

PCODE IC03

ADAAG 4.2.5

ADA 2010 308.2.1

CBC 2010 907.4.2

CBC 2013 907.4.2.2

Priority 3

Severity 2

FY 25-26 Maintenance Work

1 JOB \$275 \$275



3 Treasurer Staff Break Room

Fire Alarm

589

• *As-Built Description:*

Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled.

• *As-Built:* 61"

• *Proposed Solution:*

Remount fire alarm station to be 48" from floor to center.

PCODE IC03

ADAAG 4.2.5

ADA 2010 308.2.1

CBC 2010 907.4.2


CBC 2013 907.4.2.2

Priority 3

Severity 2

FY 25-26 Maintenance Work

1 JOB \$275 \$275

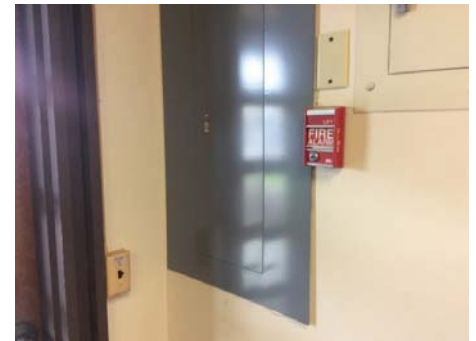

4 Auditor Controller Office

Fire Alarm

609

• *As-Built Description:*

Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled.

• *As-Built:* 61". Furniture items also block clear space.

• *Proposed Solution:*

Remount fire alarm station to be 48" from floor to center.

PCODE IC03

ADAAG 4.2.5

ADA 2010 308.2.1

CBC 2010 907.4.2

CBC 2013 907.4.2.2

Priority 3

Severity 2

FY 25-26 Maintenance Work

1 JOB \$275 \$275



5 Auditor Controller Lobby

Facility: **FINANCE BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Fire Alarm</u>						
611	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled. • <i>As-Built:</i> 61" • <i>Proposed Solution:</i> Remount fire alarm station to be 48" from floor to center. 	PCODE IC03 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 907.4.2 CBC 2013 907.4.2.2 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$275	\$275
						

<u>Reach Range</u>						
617	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Reach height to control or access point, where only forward approach is available, exceeds 48" or is less than 15". • <i>As-Built:</i> Folders bin: 54"-64" • <i>Proposed Solution:</i> Modify equipment or mounting. 	PCODE IE01 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 1118B.5 CBC 2013 11B-308.2.1 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$100	\$100
						

6 Elections Lobby

<u>Fire Alarm</u>						
624	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled. • <i>As-Built:</i> 61" • <i>Proposed Solution:</i> Remount fire alarm station to be 48" from floor to center. 	PCODE IC03 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 907.4.2 CBC 2013 907.4.2.2 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$275	\$275
						

10 Assessor Lobby

Facility: **FINANCE BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**


Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Fire Alarm</u>						
651	<ul style="list-style-type: none"> As-Built Description: Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled. As-Built: 61" Proposed Solution: Remount fire alarm station to be 48" from floor to center. 	PCODE IC03 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 907.4.2 CBC 2013 907.4.2.2 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$275	\$275
						

11 Records Room

<u>Reach Range</u>						
656	<ul style="list-style-type: none"> As-Built Description: Reach height to operable part exceeds 48" AFF. As-Built: Micro film: 64" AFF Proposed Solution: Modify equipment or mounting. 	PCODE IE01NT ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 1118B.5 CBC 2013 11B-308.2.1 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$350	\$350
						

16 Assessors Office - Staff Break Room

<u>Fire Alarm</u>						
722	<ul style="list-style-type: none"> As-Built Description: Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled. As-Built: 61" Proposed Solution: Remount fire alarm station to be 48" from floor to center. 	PCODE IC03 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 907.4.2 CBC 2013 907.4.2.2 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$275	\$275
						

17 Shared Conference Room

Facility: **FINANCE BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**


Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door</u>						
732	<ul style="list-style-type: none"> As-Built Description: Vision Light at door that permits viewing, does not have bottom of at least one glazed panel located 43 inches maximum above the finish floor. (Exception: More than 66" above finished floor.) As-Built: 47" Proposed Solution: Provide new door with vision panel at 43" max. 	PCODE ID06C ADA 2010 404.2.11 CBC 2013 11B-404.2.11 Priority 2 Severity 4 FY 25-26 Maintenance Work	2	JOB	\$2,500	\$5,000
						

18 HR Lobby

<u>Fire Alarm</u>						
738	<ul style="list-style-type: none"> As-Built Description: Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled. As-Built: 61" and obstructed Proposed Solution: Remount fire alarm station to be 48" from floor to center. 	PCODE IC03 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 907.4.2 CBC 2013 907.4.2.2 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$275	\$275
						

19 Training Testing Room

<u>Reach Range</u>							
744	<ul style="list-style-type: none"> As-Built Description: Reach height to control or access point, where only forward approach is available, exceeds 48" or is less than 15". As-Built: White board: 43" Proposed Solution: Modify equipment or mounting. 	PCODE IE01REF ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 1118B.5 CBC 2013 11B-308.2.1 Priority 2 Severity 4 FY 25-26 Maintenance Work	REF				
							

Facility: **FINANCE BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Signage						
740	<ul style="list-style-type: none"> As-Built Description: Existing sign designating permanent room or space is noncompliant. Proposed Solution: Provide compliant signage. 	PCODE SA13 ADAAG 4.1.3(16)(a) ADA 2010 216.2 CBC 2010 1117B.5 CBC 2013 11B-216.2 Priority 2 Severity 4 FY 25-26 Maintenance Work	2	JOB	\$150	\$300
						

21 Staff Offices

Door Swing

755	<ul style="list-style-type: none"> As-Built Description: Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). As-Built: 17" to table Proposed Solution: Remove or relocate furniture or storage items. 	PCODE ID24A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$50	\$50
						

Total Costs for Part/floor: Interior Ground Floor \$8,000.00

Facility: **FINANCE BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$8,000.00

Facility: **FINANCE BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: FINANCE BUILDING					\$8,000.00
------------------------	-----------------------------------	--	--	--	--	-------------------

Facility: **LAW OFFICES BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 DA Offices

Door Closer

1466

As-Built Description:

Excessive force required to open door.

As-Built: 10 lbs

Proposed Solution:

Adjust regular door closer to accessible standards (5 lbs max).

PCODE ID03

ADAAG 4.13.11

ADA 2010 404.2.9

CBC 2010 1133B.2.5

CBC 2013 11B-404.2.9

Priority 2

Severity 4

FY 25-26 Maintenance Work

1 JOB \$25 \$25



2 DA Offices - Conference Room

Protrusion Limits

1471

As-Built Description:

Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor.

As-Built: Lever

Proposed Solution:

Remove/relocate protruding object. Patch existing surface.

PCODE EG04

ADAAG 4.4.1

ADA 2010 307.2

CBC 2010 1133B.8.6.1


CBC 2013 11B-307.2

Priority 2

Severity 4

FY 25-26 Maintenance Work

1 JOB \$100 \$100

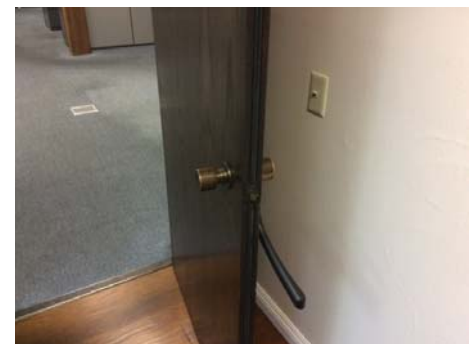

3 Staff Breakroom

Fire Alarm

1480

As-Built Description:

Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled.

As-Built: 60"

Proposed Solution:

Remount fire alarm station to be 48" from floor to center.

PCODE IC03

ADAAG 4.2.5

ADA 2010 308.2.1

CBC 2010 907.4.2

CBC 2013 907.4.2.2

Priority 3

Severity 2

FY 25-26 Maintenance Work

1 JOB \$275 \$275



4 Staff Office West

Facility: **LAW OFFICES BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**


Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Fire Alarm</u>						
1484	<ul style="list-style-type: none"> As-Built Description: Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled. As-Built: 60" Proposed Solution: Remount fire alarm station to be 48" from floor to center. 	PCODE IC03 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 907.4.2 CBC 2013 907.4.2.2 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$275	\$275
						

6 Sexual Assault Lobby

<u>Fire Alarm</u>						
1501	<ul style="list-style-type: none"> As-Built Description: Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled. As-Built: 60" Proposed Solution: Remount fire alarm station to be 48" from floor to center. 	PCODE IC03 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 907.4.2 CBC 2013 907.4.2.2 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$275	\$275
						

7 Sexual Assault Interview Room

<u>Door Swing</u>						
1506	<ul style="list-style-type: none"> As-Built Description: Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). Proposed Solution: Remove or relocate furniture or storage items. 	PCODE ID24A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$50	\$50
						

8 DA Staff Conference Room

Facility: **LAW OFFICES BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**


Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Closer</u>						
1511	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door. As-Built: 8 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$25	\$25
						

10 DA Restroom Corridor - Kitchenette

<u>Door Closer</u>						
1530	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door. As-Built: 9 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$25	\$25
						

13 DA Lobby

<u>Fire Alarm</u>						
1566	<ul style="list-style-type: none"> As-Built Description: Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled. As-Built: 60" Proposed Solution: Remount fire alarm station to be 48" from floor to center. 	PCODE IC03 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 907.4.2 CBC 2013 907.4.2.2 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$275	\$275
						

14 Law Library

Facility: **LAW OFFICES BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Fire Alarm</u>						
1582	<ul style="list-style-type: none"> As-Built Description: Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled. As-Built: 61" Proposed Solution: Remount fire alarm station to be 48" from floor to center. 	PCODE IC03 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 907.4.2 CBC 2013 907.4.2.2 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$275	\$275
						

17 County Council

<u>Fire Alarm</u>						
1599	<ul style="list-style-type: none"> As-Built Description: Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled. As-Built: 61" Proposed Solution: Remount fire alarm station to be 48" from floor to center. 	PCODE IC03 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 907.4.2 CBC 2013 907.4.2.2 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$275	\$275
						

Total Costs for	Part/floor: Interior	Ground Floor	\$1,875.00
------------------------	-----------------------------	---------------------	-------------------

Facility: **LAW OFFICES BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$1,875.00

Facility: **LAW OFFICES BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: LAW OFFICES BUILDING					\$1,875.00
------------------------	---------------------------------------	--	--	--	--	-------------------

Facility: **SHERIFF ADMIN BLDG**
 Address: 1444 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **FY 25-26**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

3 Women's Restroom

Accessories

1824	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 48" (CA only: 40") from floor to highest operating slot or control. • <i>As-Built:</i> PTD: 53" SD: 48" • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	<p>PCODE WG01A ADAAG 4.23.7 ADA 2010 308.2.1 CBC 2010 1115B.8.3 CBC 2013 11B-603.5 Priority 3 Severity 2 FY 25-26 Maintenance Work</p>	2	JOB	\$100	\$200
------	--	---	---	-----	-------	-------



1825	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 48" from floor to highest operating slot or control. • <i>As-Built:</i> FND: 53" • <i>Proposed Solution:</i> Relocate existing restroom accessories. 	<p>PCODE WG01AREF ADAAG 4.23.7 ADA 2010 308.2.1 CBC 2010 1115B.8.3 CBC 2013 11B-603.5 Priority 3 Severity 2 FY 25-26 Maintenance Work</p>	REF			
------	---	--	-----	--	--	--



Coat Hook

1830	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible coat hook not within reach range. • <i>As-Built:</i> 67" • <i>Proposed Solution:</i> Adjust existing or provide new coat hook at maximum 48" height. 	<p>PCODE WG03A ADAAG 4.2.5 ADA 2010 603.4 CBC 2010 1118B.5 CBC 2013 11B-603.4 Priority 3 Severity 1 FY 25-26 Maintenance Work</p>	1	JOB	\$50	\$50
------	--	--	---	-----	------	------



4 Men's Restroom

Facility: **SHERIFF ADMIN BLDG**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.


Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Accessories						
1846	<ul style="list-style-type: none"> <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 48" (CA only: 40") from floor to highest operating slot or control. <i>As-Built:</i> SD: 48" PTD: 53" <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 4.23.7 ADA 2010 308.2.1 CBC 2010 1115B.8.3 CBC 2013 11B-603.5 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$100	\$100
						

Grab Bars						
1853	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessories/dispensers in accessible stall located closer than 1-1/2" below or 12" above grab bar impedes its use. <i>As-Built:</i> TPD: 5" <i>Proposed Solution:</i> Relocate accessories/dispensers to be no closer than 1-1/2" below and 12" above grab bars (except if accessories are recessed, flush with wall, and have no sharp edges). 	PCODE WB07I ADAAG 4.26.2 ADA 2010 609.3 CBC 2010 1133B.4.2.5 CBC 2013 11B-609.3 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$75	\$75
						

9 Restroom Corridor

Fire Alarm						
1886	<ul style="list-style-type: none"> <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled. <i>As-Built:</i> 61" <i>Proposed Solution:</i> Remount fire alarm station to be 48" from floor to center. 	PCODE IC03 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 907.4.2 CBC 2013 907.4.2.2 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$275	\$275
						

Total Costs for Part/floor: Interior Ground Floor \$700.00

Facility: **SHERIFF ADMIN BLDG**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$700.00

Facility: **SHERIFF ADMIN BLDG**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: SHERIFF ADMIN BLDG					\$700.00
------------------------	-------------------------------------	--	--	--	--	-----------------

Facility: **SHERIFF'S ADMINISTRATION**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Administration Entrance & Lobby

Fire Alarm


1744	<ul style="list-style-type: none"> <i>As-Built Description:</i> Fire alarm pull stations not 48" from floor to center. Note: Required only at new construction, or where mounting location was or is to be remodeled. <i>As-Built:</i> 62" <i>Proposed Solution:</i> Remount fire alarm station to be 48" from floor to center. 	<p>PCODE IC03 ADAAG 4.2.5 ADA 2010 308.2.1 CBC 2010 907.4.2 CBC 2013 907.4.2.2 Priority 3 Severity 2 FY 25-26 Maintenance Work</p>	1	JOB	\$275	\$275
------	--	---	---	-----	-------	-------



2 Records & Background


Door Closer

1747	<ul style="list-style-type: none"> <i>As-Built Description:</i> Excessive force required to open door. <i>As-Built:</i> 10 lbs <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). 	<p>PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 4 FY 25-26 Maintenance Work</p>	1	JOB	\$25	\$25
------	---	---	---	-----	------	------

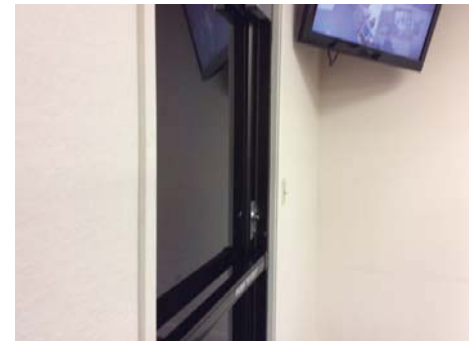

Door Hardware

1748	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door does not have accessible operating hardware. <i>As-Built:</i> 5" <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. 	<p>PCODE ID07 ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 25-26 Maintenance Work</p>	1	JOB	\$250	\$250
------	---	--	---	-----	-------	-------

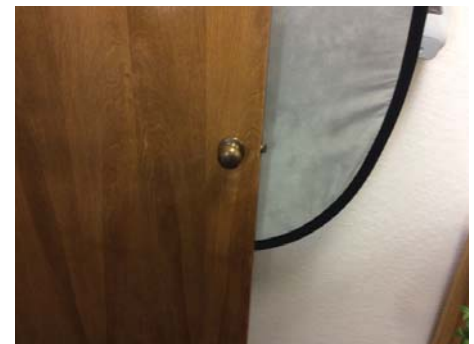

Facility: **SHERIFF'S ADMINISTRATION**


Area: **Interior**

Part/Floor: **Ground Floor**



Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door Swing						
1746	<ul style="list-style-type: none"> <i>As-Built Description:</i> Latch approach: At push side, door does not have clear and level maneuvering space measuring door width plus 24" (starting at hinge) x 42", or 48" if door has closer. <i>As-Built:</i> 45" <i>Proposed Solution:</i> Change door swing. 	PCODE ID28 ADAAG Fig. 25(c) ADA 2010 404.2.4 CBC 2010 11B-26A(c) CBC 2013 11B-404.2.4 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$500	\$500
						

3 General Staff Office Area

Door Swing						
1752	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". <i>As-Built:</i> Provide one meeting room with Acc clearances for wheelchair users. <i>Proposed Solution:</i> Remove or relocate furniture or storage items. 	PCODE ID23A ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$50	\$50
						
1758	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". <i>As-Built:</i> 6.5" <i>Proposed Solution:</i> Provide power door operator. 	PCODE ID23CREF ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 3 FY 25-26 Maintenance Work	REF			
						

Facility: **SHERIFF'S ADMINISTRATION**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1757	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). <i>As-Built:</i> 6.5" <i>Proposed Solution:</i> Provide door operator. 	<p>PCODE ID24C</p> <p>ADAAG Fig. 25(a)</p> <p>ADA 2010 404.2.4</p> <p>CBC 2010 11B-26A(a)</p> <p>CBC 2013 11B-404.2.4</p> <p>Priority 2</p> <p>Severity 3</p> <p>FY 25-26 Maintenance Work</p>	1	JOB	\$5,000	\$5,000



Signage

1753	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sign not located on latch side of door and/or not located at 48" min. above to baseline of the lowest Braille cells and 60" max. to baseline of the highest line of raised characters. <i>Proposed Solution:</i> Provide compliant signage including tactile characters and Grade II Braille on latch side of door located 60" on center from floor. 	<p>PCODE SA07</p> <p>ADAAG 4.30.6</p> <p>ADA 2010 703.4.1</p> <p>CBC 2010 1117B.5.7</p> <p>CBC 2013 11B-703.4.1</p> <p>Priority 2</p> <p>Severity 3</p> <p>FY 25-26 Maintenance Work</p>	5	JOB	\$50	\$250
------	--	--	---	-----	------	-------



1756	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	<p>PCODE SA10A</p> <p>ADAAG 4.1.3(16)</p> <p>ADA 2010 216.4.1</p> <p>CBC 2010 1011.3</p> <p>CBC 2013 11B-216.4.1</p> <p>Priority 2</p> <p>Severity 3</p> <p>FY 25-26 Maintenance Work</p>	1	JOB	\$90	\$90
------	--	---	---	-----	------	------



5 Civil Office

Facility: **SHERIFF'S ADMINISTRATION**


Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Hardware</u>						
1764	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door does not have accessible operating hardware. <i>Proposed Solution:</i> Provide lever handle or other accessible hardware. <i>Notes:</i> And signage 	<p>PCODE ID07REF ADAAG 4.13.9 ADA 2010 404.2.7 CBC 2010 1133B.2.5.2 CBC 2013 11B-404.2.7 Priority 2 Severity 3 FY 25-26 Maintenance Work</p>				
						REF
						

Total Costs for	Part/floor: Interior	Ground Floor	\$6,440.00
------------------------	-----------------------------	---------------------	-------------------

Facility: **SHERIFF'S ADMINISTRATION**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$6,440.00

Facility: **SHERIFF'S ADMINISTRATION**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: SHERIFF'S ADMINISTRATION					\$6,440.00
------------------------	---	--	--	--	--	-------------------

Facility: **ENVIRONMENTAL OFFICES**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **FY 25-26**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Building 1 Corridor

Door Closer

2531	<ul style="list-style-type: none"> <i>As-Built Description:</i> Excessive force required to open door. <i>As-Built:</i> 8 lbs <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). 	<p>PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 4 FY 25-26 Maintenance Work</p>	1	JOB	\$25	\$25
------	--	---	---	-----	------	------



Door Stopper

2527	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	<p>PCODE ID06A ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 2 Severity 3 FY 25-26 Maintenance Work</p>	8	JOB	\$25	\$200
------	---	---	---	-----	------	-------



Signage

2528	<ul style="list-style-type: none"> <i>As-Built Description:</i> Braille symbols: dots are not 1/10" on centers in each cell with 2/10" space between cells. <i>Proposed Solution:</i> CA only - Provide new compliant signage including Contracted Grade 2 Braille with Title 24 spacing requirements - 1/10" on center dots with 2/10" space between cells. 	<p>PCODE SA07C ADA 2010 703.3 CBC 2010 1117B.5.6 CBC 2013 11B-703.3 Priority 2 Severity 3 FY 25-26 Maintenance Work</p>	10	JOB	\$150	\$1,500
------	--	---	----	-----	-------	---------



Facility: **ENVIRONMENTAL OFFICES**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **FY 25-26**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2530	<ul style="list-style-type: none"> <i>As-Built Description:</i> At final exit door to exterior: Where required exit signs are installed, signs to provide exiting information for people with vision impairment are not provided. <i>Proposed Solution:</i> Provide raised letter/Braille "EXIT" sign at door. 	PCODE SA10A ADAAG 4.13(16) ADA 2010 216.4.1 CBC 2010 10113 CBC 2013 11B-216.4.1 Priority 2 Severity 3 FY 25-26 Maintenance Work	1	JOB	\$90	\$90



2 Large Conference Room

Door Stopper

2533	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 2 Severity 3 FY 25-26 Maintenance Work	1	JOB	\$25	\$25
------	---	--	---	-----	------	------



Signage

2532	<ul style="list-style-type: none"> <i>As-Built Description:</i> Braille symbols: dots are not 1/10" on centers in each cell with 2/10" space between cells. <i>Proposed Solution:</i> CA only - Provide new compliant signage including Contracted Grade 2 Braille with Title 24 spacing requirements - 1/10" on center dots with 2/10" space between cells. 	PCODE SA07C ADA 2010 703.3 CBC 2010 1117B.5.6 CBC 2013 11B-703.3 Priority 2 Severity 3 FY 25-26 Maintenance Work	1	JOB	\$150	\$150
------	--	--	---	-----	-------	-------





3 Brauner Conference Room


Facility: **ENVIRONMENTAL OFFICES**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **FY 25-26**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Stopper</u>						
2539	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 2 Severity 3 FY 25-26 Maintenance Work	1	JOB	\$25	\$25
						

<u>Protrusion Limits</u>						
2545	<ul style="list-style-type: none"> <i>As-Built Description:</i> Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor. <i>As-Built:</i> PTD: 8.5" protrusion at 50" <i>Proposed Solution:</i> Remove/relocate protruding object. Patch existing surface. 	PCODE EG04REF ADAAG 4.4.1 ADA 2010 307.2 CBC 2010 1133B.8.6.1 CBC 2013 11B-307.2 Priority 2 Severity 3 FY 25-26 Maintenance Work	REF			

<u>Signage</u>						
2538	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sign not located on latch side of door and/or not located at 48" min. above to baseline of the lowest Braille cells and 60" max. to baseline of the highest line of raised characters. <i>As-Built:</i> Latch side <i>Proposed Solution:</i> Provide compliant signage including tactile characters and Grade II Braille on latch side of door located 60" on center from floor. 	PCODE SA07 ADAAG 4.30.6 ADA 2010 703.4.1 CBC 2010 1117B.5.7 CBC 2013 11B-703.4.1 Priority 2 Severity 3 FY 25-26 Maintenance Work	1	JOB	\$50	\$50
						

Facility: **ENVIRONMENTAL OFFICES**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **FY 25-26**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2537	<ul style="list-style-type: none"> <i>As-Built Description:</i> Braille symbols: dots are not 1/10" on centers in each cell with 2/10" space between cells. <i>Proposed Solution:</i> CA only - Provide new compliant signage including Contracted Grade 2 Braille with Title 24 spacing requirements - 1/10" on center dots with 2/10" space between cells. 	PCODE SA07C ADA 2010 703.3 CBC 2010 1117B.5.6 CBC 2013 11B-703.3 Priority 2 Severity 3 FY 25-26 Maintenance Work	1	JOB	\$150	\$150



4 Copy Room

Door Stopper

2548	<ul style="list-style-type: none"> <i>As-Built Description:</i> At push side of door on accessible route, bottom 10" does not have a smooth, uninterrupted surface. <i>Proposed Solution:</i> Remove door stopper when altering area. Provide rubber wedge. 	PCODE ID06A ADA 2010 404.2.10 CBC 2010 1133B.2.6 CBC 2013 11B-404.2.10 Priority 2 Severity 3 FY 25-26 Maintenance Work	1	JOB	\$25	\$25
------	---	--	---	-----	------	------



Signage

2546	<ul style="list-style-type: none"> <i>As-Built Description:</i> Braille symbols: dots are not 1/10" on centers in each cell with 2/10" space between cells. <i>Proposed Solution:</i> CA only - Provide new compliant signage including Contracted Grade 2 Braille with Title 24 spacing requirements - 1/10" on center dots with 2/10" space between cells. 	PCODE SA07C ADA 2010 703.3 CBC 2010 1117B.5.6 CBC 2013 11B-703.3 Priority 2 Severity 3 FY 25-26 Maintenance Work	1	JOB	\$150	\$150
------	--	--	---	-----	-------	-------





5 Men's Restroom


Facility: **ENVIRONMENTAL OFFICES**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **FY 25-26**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Accessories						
2562	<ul style="list-style-type: none"> <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 48" (CA only: 40") from floor to highest operating slot or control. <i>As-Built:</i> PTD: 44" SD: 62" <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 4.23.7 ADA 2010 308.2.1 CBC 2010 1115B.8.3 CBC 2013 11B-603.5 Priority 3 Severity 1 FY 25-26 Maintenance Work	1	JOB	\$100	\$100
						

Coat Hook						
2560	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible coat hook not within reach range. <i>As-Built:</i> 68" <i>Proposed Solution:</i> Adjust existing or provide new coat hook at maximum 48" height. 	PCODE WG03A ADAAG 4.2.5 ADA 2010 603.4 CBC 2010 1118B.5 CBC 2013 11B-603.4 Priority 3 Severity 1 FY 25-26 Maintenance Work	1	JOB	\$50	\$50
						


Grab Bars						
2564	<ul style="list-style-type: none"> <i>As-Built Description:</i> The rear wall grab is less than 36" min. or does not extend from the centerline of the water closet 12" min. on one side and 24" min. on the other side. <i>As-Built:</i> 18" & 18" <i>Proposed Solution:</i> Provide or relocate accessible rear grab bar. 	PCODE WB07B ADAAG 4.17.6 ADA 2010 604.5.2 CBC 2010 1115B.4.1.3.2 CBC 2013 11B-604.5.2 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$340	\$340
						


6 Women's Restroom

Facility: **ENVIRONMENTAL OFFICES**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **FY 25-26**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Accessories</u>						
2572	<ul style="list-style-type: none"> <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 48" (CA only: 40") from floor to highest operating slot or control. <i>As-Built:</i> PTD: 64" SD: 45" <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 4.23.7 ADA 2010 308.2.1 CBC 2010 1115B.8.3 CBC 2013 11B-603.5 Priority 3 Severity 1 FY 25-26 Maintenance Work	1	JOB	\$100	\$100
						

<u>Grab Bars</u>						
2575	<ul style="list-style-type: none"> <i>As-Built Description:</i> The rear wall grab is less than 36" min. or does not extend from the centerline of the water closet 12" min. on one side and 24" min. on the other side. <i>As-Built:</i> 19" & 17" <i>Proposed Solution:</i> Provide or relocate accessible rear grab bar. 	PCODE WB07B ADAAG 4.17.6 ADA 2010 604.5.2 CBC 2010 1115B.4.1.3.2 CBC 2013 11B-604.5.2 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$340	\$340
						

Total Costs for	Part/floor: Interior	Ground Floor	\$3,320.00
------------------------	-----------------------------	---------------------	-------------------

Facility: **ENVIRONMENTAL OFFICES**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 CAMPUS DR.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$3,320.00

Facility: **ENVIRONMENTAL OFFICES**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 CAMPUS DR.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: ENVIRONMENTAL OFFICES					\$3,320.00
------------------------	--	--	--	--	--	-------------------

Facility: **PARKS/KART BUILDING**
 Address: 710 NORTH DR.

Area: **Interior**
 Year to be Completed: **FY 25-26**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

3 Parks Restroom


Accessories

3511	<ul style="list-style-type: none"> <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 48" (CA only: 40") from floor to highest operating slot or control. <i>As-Built:</i> PTD: 47" First Aid Kit: 68" <i>Proposed Solution:</i> Relocate existing restroom accessories. 	<p>PCODE WG01A ADAAG 4.23.7 ADA 2010 308.2.1 CBC 2010 1115B.8.3 CBC 2013 11B-603.5 Priority 3 Severity 1 FY 25-26 Maintenance Work</p>	1	JOB	\$100	\$100
------	---	---	---	-----	-------	-------



Coat Hook

3507	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible coat hook not within reach range. <i>As-Built:</i> 66" <i>Proposed Solution:</i> Adjust existing or provide new coat hook at maximum 48" height. 	<p>PCODE WG03A ADAAG 4.2.5 ADA 2010 603.4 CBC 2010 1118B.5 CBC 2013 11B-603.4 Priority 3 Severity 1 FY 25-26 Maintenance Work</p>	1	JOB	\$50	\$50
------	--	--	---	-----	------	------

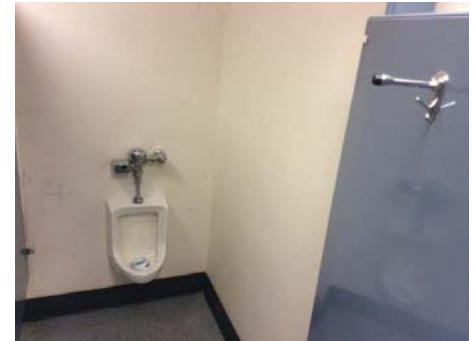

Door Swing

3504	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". <i>As-Built:</i> 2" <i>Proposed Solution:</i> Provide power door operator or relocate fridge and swing door out. 	<p>PCODE ID23C ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 3 Severity 2 FY 25-26 Maintenance Work</p>	1	JOB	\$5,000	\$5,000
------	---	--	---	-----	---------	---------



Facility: **PARKS/KART BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 710 NORTH DR.

Year to be Completed: **FY 25-26**


Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Protrusion Limits</u>						
3512	<ul style="list-style-type: none"> <i>As-Built Description:</i> Protruding objects more than 4" from wall, when bottom of object more than 27" or less than 80" above finished floor. <i>As-Built:</i> First Aid: 7.5" protrusion at 55" PTD: 9" protrusion at 42" <i>Proposed Solution:</i> Remove/relocate protruding object. Patch existing surface. 	PCODE EG04REF ADAAG 4.4.1 ADA 2010 307.2 CBC 2010 1133B.8.6.1 CBC 2013 11B-307.2 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	REF		
						

6 Accounting Corridors

<u>Door Closer</u>						
3527	<ul style="list-style-type: none"> <i>As-Built Description:</i> Excessive force required to open door. <i>As-Built:</i> 15 lbs <i>Proposed Solution:</i> Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 3 FY 25-26 Maintenance Work	1	JOB	\$25	\$25
						

9 CalVans Offices

<u>Carpet/Doormat</u>						
3541	<ul style="list-style-type: none"> <i>As-Built Description:</i> Doormat not securely attached to ground or floor structure. <i>Proposed Solution:</i> Attach doormat to floor surface or remove doormat. 	PCODE ID05A ADAAG 4.5.3 ADA 2010 302.2 CBC 2010 1124B.3 CBC 2013 11B-302.2 Priority 2 Severity 3 FY 25-26 Maintenance Work	2	JOB	\$75	\$150
						

Facility: **PARKS/KART BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 710 NORTH DR.


Year to be Completed: **FY 25-26**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door</u>						
3543	<ul style="list-style-type: none"> As-Built Description: Vision Light at door that permits viewing, does not have bottom of at least one glazed panel located 43 inches maximum above the finish floor. (Exception: More than 66" above finished floor.) As-Built: 47.5" Proposed Solution: Provide new door with vision panel at 43" max. 	PCODE ID06C ADA 2010 404.2.11 CBC 2013 11B-404.2.11 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$2,500	\$2,500
						

<u>Door Closer</u>						
3542	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door. As-Built: 10 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 4 FY 25-26 Maintenance Work	1	JOB	\$25	\$25
						

11 CalVans Restroom Corridor

<u>Door Closer</u>						
3553	<ul style="list-style-type: none"> As-Built Description: Excessive force required to open door. As-Built: 16 lbs Proposed Solution: Adjust regular door closer to accessible standards (5 lbs max). 	PCODE ID03 ADAAG 4.13.11 ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$25	\$25
						

Total Costs for Part/floor: Interior Ground Floor \$7,875.00

Facility: **PARKS/KART BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 710 NORTH DR.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$7,875.00

Facility: **PARKS/KART BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 710 NORTH DR.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: PARKS/KART BUILDING					\$7,875.00
------------------------	--------------------------------------	--	--	--	--	-------------------

Facility: **KINGSTON PARK RESTROOM**
 Address: 13196 DOUGLAS AVE.

Area: **Exterior**
 Year to be Completed: **FY 25-26**

Part/Floor: **On-site**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Men's Restroom

Accessories

4885	<ul style="list-style-type: none"> <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 48" (CA only: 40") from floor to highest operating slot or control. <i>As-Built:</i> PTD: 55" <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 4.23.7 ADA 2010 308.2.1 CBC 2010 1115B.8.3 CBC 2013 11B-603.5 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$100	\$100
------	--	--	---	-----	-------	-------



2 Women's Restroom

Accessories

4898	<ul style="list-style-type: none"> <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 48" (CA only: 40") from floor to highest operating slot or control. <i>As-Built:</i> PTD: 50" <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 4.23.7 ADA 2010 308.2.1 CBC 2010 1115B.8.3 CBC 2013 11B-603.5 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$100	\$100
------	--	--	---	-----	-------	-------



4899	<ul style="list-style-type: none"> <i>As-Built Description:</i> Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles more than 48" (CA only: 40") from floor to highest operating slot or control. <i>As-Built:</i> SCD: 51" <i>Proposed Solution:</i> Relocate existing restroom accessories. 	PCODE WG01A ADAAG 4.23.7 ADA 2010 308.2.1 CBC 2010 1115B.8.3 CBC 2013 11B-603.5 Priority 3 Severity 2 FY 25-26 Maintenance Work	1	JOB	\$100	\$100
------	--	--	---	-----	-------	-------



Total Costs for	Part/floor: Exterior	On-site	\$300.00
------------------------	-----------------------------	----------------	-----------------

Facility: **KINGSTON PARK RESTROOM**

Area: **Exterior**

Part/Floor: **On-site**

Address: 13196 DOUGLAS AVE.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$300.00

Facility: **KINGSTON PARK RESTROOM**

Area: **Exterior**

Part/Floor: **On-site**

Address: 13196 DOUGLAS AVE.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: KINGSTON PARK RESTROOM	\$300.00
------------------------	---	-----------------

Facility: **KINGSTON PARK RESTROOM**

Area: **Exterior**

Part/Floor: **On-site**

Address: 13196 DOUGLAS AVE.

Year to be Completed: **FY 25-26**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Year to be Completed: FY 25-26					\$98,288.00
------------------------	---------------------------------------	--	--	--	--	--------------------

Facility: **AVENAL HEALTH CLINIC**
 Address: 590 SKYLINE BLVD.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Accessible Parking

Changes in Level

5012	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route. <i>As-Built:</i> 0.5"-1" change <i>Proposed Solution:</i> Remove, replace or repair area of pavement sufficient to correct abrupt change in level. 	<p>PCODE EF03REF ADAAG 4.3.8 ADA 2010 403.4 CBC 2010 1133B.7.4 CBC 2013 11B-403.4 Priority 1 Severity 4 TBD Contract Work</p>
------	---	--

REF



Floor or Ground Surfaces

5011	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space has slope greater than 1/4":12" (2%). <i>As-Built:</i> Highly irregular surface. and striping is faded <i>Proposed Solution:</i> Modify slope at accessible parking space. 	<p>PCODE EA05 ADAAG 4.6.3 ADA 2010 502.4 CBC 2010 1129B.3.3 CBC 2013 11B-502.4 Priority 1 Severity 4 TBD Contract Work</p>
------	--	---

470 SF \$12 \$5,640



Parking

5015	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space smaller than 8' wide (CA only: 9' x 18'). <i>As-Built:</i> Faded <i>Proposed Solution:</i> Modify parking space(s) to create accessible space. <i>Notes:</i> Provide Van space with 8' aisle 	<p>PCODE EA02AREF ADAAG 4.6.3 ADA 2010 502.2 CBC 2010 1129B.3.1 CBC 2013 11B-502.2 Priority 1 Severity 4 TBD Contract Work</p>
------	--	---

REF



Facility: **AVENAL HEALTH CLINIC**
 Address: 590 SKYLINE BLVD.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
5009	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space(s) not located close to the nearest possible entrance on an accessible route. <i>Proposed Solution:</i> Relocate accessible parking space(s). <i>Notes:</i> 2 Acc. 13 total 	PCODE EA06 ADAAG 4.6.2 ADA 2010 208.3 CBC 2010 1129B.1 CBC 2013 11B-208.3.1 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$350	\$350



2 Site a entry Near Acc Parking

Slope

5016	<ul style="list-style-type: none"> <i>As-Built Description:</i> Slope greater than 1:12 (8.3%). <i>As-Built:</i> 10.1-11.2% <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails. <i>Notes:</i> Interim. Provide directional signage. 	PCODE EB02 ADAAG 4.8.2 ADA 2010 405.2 CBC 2010 1133B.5.3 CBC 2013 11B-405.2 Priority 1 Severity 3 TBD Contract Work	60	SF	\$100	\$6,000
------	---	--	----	----	-------	---------



3 POT from Parking to Entrance

Walk


5018	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps. <i>As-Built:</i> 9.8%-10.2% <i>Proposed Solution:</i> Modify walk/sidewalk slope to 1:20 or less. 	PCODE EF01 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.3 CBC 2013 11B-403.3 Priority 1 Severity 3 TBD Contract Work	60	SF	\$25	\$1,500
------	--	--	----	----	------	---------



Facility: **AVENAL HEALTH CLINIC**
 Address: 590 SKYLINE BLVD.


Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
5017	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Walk more than 36" but less than 48" wide (required in CA only). • <i>As-Built:</i> Re-set wheel stop. 35" • <i>Proposed Solution:</i> Enlarge width of walk to 48". 	PCODE EF08REF ADA 2010 403.5 CBC 2010 1133B.7.1 CBC 2013 11B-403.5.1.3 Priority 1 Severity 3 TBD Contract Work				
			REF			
						

4 POT from Sidewalk to Entrance

Cross Slope

5019	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Cross slope more than 1":48" (2.083%). • <i>As-Built:</i> 2.7-3.1% • <i>Proposed Solution:</i> Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 4 TBD Contract Work	100	SF	\$25	\$2,500
						

Door

5020	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). • <i>As-Built:</i> 2.8% • <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 1 Severity 4 TBD Contract Work	30	SF	\$40	\$1,200
						

Total Costs for	Part/floor: Exterior	On-site	\$17,190.00
------------------------	-----------------------------	----------------	--------------------

Facility: **AVENAL HEALTH CLINIC**

Area: **Exterior**

Part/Floor: **On-site**

Address: 590 SKYLINE BLVD.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$17,190.00

Facility: **AVENAL HEALTH CLINIC**
 Address: 590 SKYLINE BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Classroom

Assistive Listening

- 4953
- *As-Built Description:*
No portable assistive listening system provided for small meeting room.
 - *Proposed Solution:*
Share existing portable assistive listening system from other facility.

PCODE **GI01E**
 ADAAG **4.1.3(19)(b) & 4.33.7**
 ADA 2010 **219.1 & 706.1**
 CBC 2010 **1104B.2**
 CBC 2013 **11B-219.2**
 Priority **2**
 Severity **3**
 TBD **Contract Work**

REF




3 Staff Offices

Sink

- 4961
- *As-Built Description:*
Sink rim higher than 34" above floor.
 - *As-Built:* 37"
 - *Proposed Solution:*
Remodel sink cabinet to lower sink.
 - *Notes:*
Staff Only

PCODE **IN06**
 ADAAG **4.24.2**
 ADA 2010 **606.3**
 CBC 2010 **1115B.4.7.1**
 CBC 2013 **11B-606.3**
 Priority **4**
 Severity **4**
 TBD **Contract Work**

1 JOB \$1,750 **\$1,750**

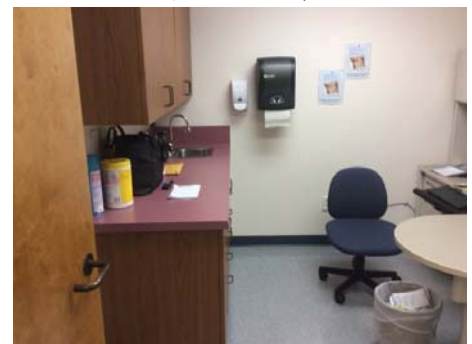

- 4962
- *As-Built Description:*
Sink does not have knee space min. 27" high x 19" deep x 30" wide.
 - *Proposed Solution:*
Remodel sink cabinet.
 - *Notes:*
Staff Only

PCODE **IN06AREF**
 ADAAG **4.24.3**
 ADA 2010 **606.2**
 CBC 2010 **1115B.4.7.1**
 CBC 2013 **11B-606.2**
 Priority **4**
 Severity **2**
 TBD **Contract Work**

REF





4 Staff Restroom


Facility: **AVENAL HEALTH CLINIC**
 Address: 590 SKYLINE BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Clearance</u>						
4966	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 27" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01REF ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 4 Severity 2 TBD Contract Work				
						REF
						

<u>Lavatory</u>						
4968	<ul style="list-style-type: none"> <i>As-Built Description:</i> Wheelchair clearance under lavatory apron or lavatory counter front edge less than 29" high. <i>As-Built:</i> 27.5" <i>Proposed Solution:</i> Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD03 ADAAG 4.19.2 ADA 2010 606.3 CBC 2010 1115B.4.3.3 CBC 2013 11B-606.3 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$3,400	\$3,400
						


<u>Restroom</u>						
4967	<ul style="list-style-type: none"> <i>As-Built Description:</i> Single accommodation restroom not accessible; multiple compliance violations. <i>As-Built:</i> 45" wide <i>Proposed Solution:</i> Remodel area to provide single-occupant accessible restroom. 	PCODE WA01 ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.2 CBC 2013 11B-603 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$30,000	\$30,000
						


5 Staff Breakroom

Facility: **AVENAL HEALTH CLINIC**
 Address: 590 SKYLINE BLVD.

Area: **Interior**
 Year to be Completed: **TBD**


Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Sink						
4970	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 37" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06 ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

4971	<ul style="list-style-type: none"> As-Built Description: Sink does not have knee space min. 27" high x 19" deep x 30" wide. Proposed Solution: Remodel sink cabinet. 	PCODE IN06AREF ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	REF			
------	--	--	-----	--	--	--

6 Entrance Lobby




Drinking Fountain

4978	<ul style="list-style-type: none"> As-Built Description: Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping. Proposed Solution: Provide additional fountain or hi-lo combination fountain. Notes: Children ht. 	PCODE IA01A ADAAG 4.1.3(10)(a) ADA 2010 211.1 CBC 2010 1115B.4.6.1 CBC 2013 11B-211.1 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$2,000	\$2,000
						

Facility: **AVENAL HEALTH CLINIC**
 Address: 590 SKYLINE BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4979	<ul style="list-style-type: none"> <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain). <i>As-Built:</i> 25.5" <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA02 ADAAG 4.15.5(1) ADA 2010 602.2 CBC 2010 1115B.4.6.2 CBC 2013 11B-602.2 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$3,200	\$3,200
						
4977	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	PCODE IA04 CBC 2010 1115B.4.6.3; Fig. CBC 2013 11B-602.9 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$3,000	\$3,000
						
Public Counter						
4976	<ul style="list-style-type: none"> <i>As-Built Description:</i> Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. <i>As-Built:</i> 41" AFF <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$150	\$150
						


7 Men's Restroom

Facility: **AVENAL HEALTH CLINIC**
 Address: 590 SKYLINE BLVD.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Swing</u>						
4987	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". <i>As-Built:</i> 7.5" to lav <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed. 	PCODE ID23B ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$2,600	\$2,600
						

<u>Water Closet</u>						
4992	<ul style="list-style-type: none"> <i>As-Built Description:</i> More than 18" from near side wall to centerline of water closet. <i>As-Built:</i> 22" <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing. 	PCODE WB02A ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$4,500	\$4,500
						


8 Women's Restroom


<u>Desk</u>						
5001	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>Proposed Solution:</i> Provide new fixed accessible table or desk. Notes: Modify 	PCODE IN02 ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$2,500	\$2,500
						


Facility: **AVENAL HEALTH CLINIC**
 Address: 590 SKYLINE BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Swing</u>						
4998	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". • <i>As-Built:</i> 50" to stall • <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed. 	PCODE ID23B ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$2,600	\$2,600
						

<u>Lavatory</u>						
5000	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wheelchair clearance under lavatory apron or lavatory counter front edge less than 29" high. • <i>As-Built:</i> 28.25" • <i>Proposed Solution:</i> Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD03 ADAAG 4.19.2 ADA 2010 606.3 CBC 2010 1115B.4.3.3 CBC 2013 11B-606.3 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$3,400	\$3,400
						

<u>Water Closet</u>						
5005	<ul style="list-style-type: none"> • <i>As-Built Description:</i> More than 18" from near side wall to centerline of water closet. • <i>As-Built:</i> 22" • <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing. 	PCODE WB02A ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$4,500	\$4,500
						

Total Costs for Part/floor: Interior Ground Floor \$65,350.00

Facility: **AVENAL HEALTH CLINIC**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 590 SKYLINE BLVD.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$65,350.00

Facility: **AVENAL HEALTH CLINIC**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 590 SKYLINE BLVD.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Facility: AVENAL HEALTH CLINIC \$82,540.00

Facility: **AVENAL LIBRARY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 501 E. KINGS ST.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

3 Restroom - Unisex

Grab Bars

4500

- *As-Built Description:*
Grab bars not provided or are not code compliant.
- *Proposed Solution:*
Provide accessible grab bars.

PCODE **WB07**
 ADAAG **4.17.6**
 ADA 2010 **604.5**
 CBC 2010 **1115B.4.1.3**
 CBC 2013 **11B-604.5**
 Priority **3**
 Severity **3**
TBD Contract Work

1 JOB \$500 \$500



Lavatory

4503

- *As-Built Description:*
Wheelchair clearance under lavatory apron or lavatory counter front edge less than 29" high.
- *As-Built:* 26.5"
- *Proposed Solution:*
Remount compliant fixture to accessible height.

PCODE **WD03A**
 ADAAG **4.19.2**
 ADA 2010 **606.3**
 CBC 2010 **1115B.4.3.3**
 CBC 2013 **11B-306.3.1**
 Priority **3**
 Severity **3**
TBD Contract Work

1 JOB \$1,500 \$1,500



4 Staff Breakroom & Exit

Door

4526

- *As-Built Description:*
Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%).
- *As-Built:* 3.3%
- *Proposed Solution:*
Modify surface slope at door.

PCODE **ID11**
 ADAAG **4.13.6**
 ADA 2010 **404.2.4.4**
 CBC 2010 **1133B.2.4**
 CBC 2013 **11B-404.2.4**
 Priority **4**
 Severity **4**
TBD Contract Work

10 SF \$40 \$400



Facility: **AVENAL LIBRARY**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 501 E. KINGS ST.

Year to be Completed: **TBD**


Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Sink						
4519	<ul style="list-style-type: none"> As-Built Description: Sink does not have knee space min. 27" high x 19" deep x 30" wide. Proposed Solution: Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

4520	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 35" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work	REF			
------	--	---	-----	--	--	--

5 Staff Restroom - Unisex

Door Swing

4512	<ul style="list-style-type: none"> As-Built Description: Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". As-Built: 7"-14" Proposed Solution: Remodel as needed. 	PCODE ID23BREF ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 4 Severity 3 TBD Contract Work	REF			
------	--	---	-----	---	--	--

Facility: **AVENAL LIBRARY**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 501 E. KINGS ST.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Lavatory</u>						
4513	<ul style="list-style-type: none"> As-Built Description: Wheelchair clearance under lavatory apron or lavatory counter front edge less than 29" high. As-Built: 26" Proposed Solution: Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD03REF ADAAG 4.19.2 ADA 2010 606.3 CBC 2010 1115B.4.3.3 CBC 2013 11B-606.3 Priority 4 Severity 3 TBD Contract Work				
						REF
						

<u>Restroom</u>						
4511	<ul style="list-style-type: none"> As-Built Description: Single accommodation restroom not accessible; multiple compliance violations. Proposed Solution: Remodel area to provide single-occupant accessible restroom. 	PCODE WA01 ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.2 CBC 2013 11B-603 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$30,000	\$30,000
						

<u>Water Closet</u>						
4514	<ul style="list-style-type: none"> As-Built Description: CA only: In single-accommodation restroom less than 48" in front of water closet provided. As-Built: 36.5" Proposed Solution: Remodel restroom to provide at least 48" in front of water closet. Notes: 79" x 65" 	PCODE WB03AREF CBC 2010 1115B.3.2.1 CBC 2013 11B-604.3.1 Priority 4 Severity 3 TBD Contract Work				
						REF
						

Total Costs for Part/floor: Interior Ground Floor \$34,150.00

Facility: **AVENAL LIBRARY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 501 E. KINGS ST.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$34,150.00

Facility: **AVENAL LIBRARY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 501 E. KINGS ST.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: AVENAL LIBRARY					\$34,150.00
------------------------	---------------------------------	--	--	--	--	--------------------

Facility: **AVENAL HUMAN SERVICES**

Area: **Exterior**

Part/Floor: **On-site**

Address: 520 E. FRESNO ST.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Accessible Parking

Floor or Ground Surfaces

4472

- *As-Built Description:*
Accessible parking space has slope greater than 1/4":12" (2%).
- *As-Built:* 2.6-4.1%
- *Proposed Solution:*
Modify slope at accessible parking space.

PCODE **EA05**
 ADAAG **4.6.3**
 ADA 2010 **502.4**
 CBC 2010 **1129B.3.3**
 CBC 2013 **11B-502.4**
 Priority **1**
 Severity **3**
TBD Contract Work

200 SF \$12 **\$2,400**



2 POT from Parking to Building

Change in Direction

4476

- *As-Built Description:*
Landing at change of direction not 60" minimum by 72" minimum in the direction of downward travel from the upper ramp run.
- *As-Built:* 57" to wheel stop
- *Proposed Solution:*
Modify landing at change of direction to 60" x 72" by removing wheel stop.

PCODE **EB08NT**
 ADAAG **4.8.4(3)**
 ADA 2010 **405.7.4**
 CBC 2010 **1133B.5.4**
 CBC 2013 **11B-405.7.4**
 Priority **3**
 Severity **4**
TBD Contract Work

4 SF \$45 **\$180**



Changes in Level

4474

- *As-Built Description:*
Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route.
- *As-Built:* Due to metal grate on ramp.
- *Proposed Solution:*
Remove, replace or repair area of pavement sufficient to correct abrupt change in level.

PCODE **EF03**
 ADAAG **4.3.8**
 ADA 2010 **403.4**
 CBC 2010 **1133B.7.4**
 CBC 2013 **11B-403.4**
 Priority **3**
 Severity **4**
TBD Contract Work

5 SF \$21 **\$105**



Facility: **AVENAL HUMAN SERVICES**


Area: **Exterior**


Part/Floor: **On-site**


Address: 520 E. FRESNO ST.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Ramps						
4475	<ul style="list-style-type: none"> <i>As-Built Description:</i> Ramp: Pavement dislocation creates abrupt change in level exceeding 1/2" in ramp. <i>As-Built:</i> 0.5" <i>Proposed Solution:</i> Remove, replace or repair area of pavement sufficient to correct abrupt change in level. 	PCODE EB04 ADAAG 4.5.2 ADA 2010 303.4 CBC 2010 1133B.7.1 CBC 2013 11B-405.4 Priority 3 Severity 4 TBD Contract Work	10	SF	\$9	\$90
						

Slope						
4477	<ul style="list-style-type: none"> <i>As-Built Description:</i> Level 2% max. landing for ramp not provided. <i>As-Built:</i> 2.8% <i>Proposed Solution:</i> Rebuild ramp to provide landings for each ramp run with slopes no greater than 2% 	PCODE EB05A ADAAG 4.8.4 ADA 2010 405.7.1 CBC 2010 1133B.5.4.1 CBC 2013 11B-405.7.1 Priority 3 Severity 4 TBD Contract Work	30	SF	\$100	\$3,000
						

Walk						
4478	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk (not ramp): Level areas at doors not 60"x60" at swing side or 48"x44" at push side (required in CA only; for ADA requirement see door codes). <i>As-Built:</i> 59" to wheel guide <i>Proposed Solution:</i> Enlarge level areas; demolish existing surface, provide new surface. 	PCODE EF06 ADA 2010 404.2.4 CBC 2010 1133B.7.5 CBC 2013 11B-404.2.4 Priority 3 Severity 4 TBD Contract Work	25	SF	\$45	\$1,125
						

Total Costs for Part/floor: Exterior On-site \$6,900.00

Facility: **AVENAL HUMAN SERVICES**

Area: **Exterior**

Part/Floor: **On-site**

Address: 520 E. FRESNO ST.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Area: Exterior \$6,900.00

Facility: **AVENAL HUMAN SERVICES**
 Address: 520 E. FRESNO ST.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 Multipurpose Room

Non-Fixed Desk

- 4458
- *As-Built Description:*
 Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided.
 - *As-Built:* PC station and table: 26.5"
 - *Proposed Solution:*
 Provide table or desk with accessible dimensions when purchasing new furniture.
 - *Notes:*
Modify tables

PCODE **IN02A**
 ADAAG **4.32.3 & .4**
 ADA 2010 **306.1**
 CBC 2010 **1122B.3 & 4**
 CBC 2013 **11B-306.1 & 11B-902.3**
 Priority **2**
 Severity **2**
TBD Contract Work

2 JOB \$1,600 **\$3,200**




3 Unisex Restroom

Lavatory

- 4461
- *As-Built Description:*
 Toe clearance less than 9" high from floor x 17" deep from front edge of lavatory.
 - *As-Built:* Water heater within toe space
 - *Proposed Solution:*
 Remove or relocate water heater
 - *Notes:*
Remove or relocate water heater

PCODE **WD04BNT**
 ADAAG **Fig. 31**
 ADA 2010 **606.3**
 CBC 2010 **1115B.4.3**
 CBC 2013 **11B-306.3.1**
 Priority **3**
 Severity **2**
TBD Contract Work

1 JOB \$1,500 **\$1,500**

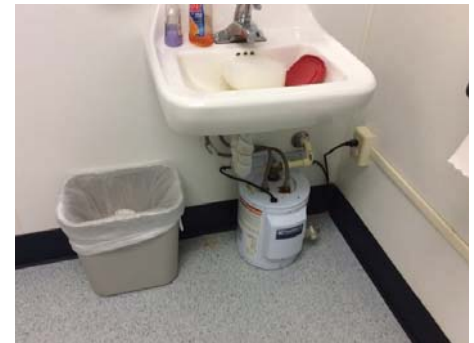

Water Closet

- 4463
- *As-Built Description:*
 Flush Control: Operating handle not mounted toward wide side of stall.
 - *Proposed Solution:*
 Replace flush control with properly mounted accessible type, or install sensor flush.

PCODE **WB10**
 ADAAG **4.16.5**
 ADA 2010 **604.6**
 CBC 2010 **1115B.4.1.5**
 CBC 2013 **11B-604.6**
 Priority **3**
 Severity **3**
TBD Contract Work

1 JOB \$500 **\$500**



Total Costs for	Part/floor: Interior	Ground Floor	\$5,200.00
------------------------	-----------------------------	---------------------	-------------------

Facility: **AVENAL HUMAN SERVICES**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 520 E. FRESNO ST.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$5,200.00

Facility: **AVENAL HUMAN SERVICES**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 520 E. FRESNO ST.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: AVENAL HUMAN SERVICES					\$12,100.00
------------------------	--	--	--	--	--	--------------------

Facility: **CORCORAN LIBRARY**
 Address: 1001 CHITTENDEN AVE.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Main Entrance

Operating Hardware

4731

As-Built Description:

Where push plates are provided, two shall be provided: the centerline of one shall be located between 7-8" above the floor, and the second shall be located between 30-44" above the floor.

- As-Built:** No low push plate provided.
- Proposed Solution:** Remount push plates such that they are compliant.

Notes:

Clear space for both is 4.2%. 38" AFF for top push plate.

PCODE ID29

CBC 2013 11B-404.2.9

Priority 3

Severity 3

TBD Contract Work

1 JOB \$200 \$200



Total Costs for	Part/floor: Exterior	On-site	\$200.00
------------------------	-----------------------------	----------------	-----------------

Facility: **CORCORAN LIBRARY**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1001 CHITTENDEN AVE.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$200.00

Facility: **CORCORAN LIBRARY**
 Address: 1001 CHITTENDEN AVE.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 Women's Restroom

Lavatory

- 4748
- *As-Built Description:*
 Lavatory: Fixture rim or counter height more than 34" above floor.
 - *As-Built:* 34.25"
 - *Proposed Solution:*
 Remount compliant fixture at accessible height.

PCODE **WD02A**
 ADAAG **4.19.2**
 ADA 2010 **606.3**
 CBC 2010 **1115B.4.3**
 CBC 2013 **11B-606.3**
 Priority **3**
 Severity **4**
TBD Contract Work

1 JOB \$900 **\$900**



Surface

- 4749
- *As-Built Description:*
 Drain opening in floor produces a non-flush surface within the water closet.
 - *As-Built:* Not flush
 - *Proposed Solution:*
 Modify drain to be flush with the floor surface.

PCODE **WC06**
 CBC 2013 **11B-608.9**
 Priority **3**
 Severity **3**
TBD Contract Work

1 JOB \$500 **\$500**




3 Men's Restroom

Urinal

- 4760
- *As-Built Description:*
 Urinal flush control lever more than 48" above floor (CA only: 44" max.).
 - *As-Built:* 46"
 - *Proposed Solution:*
 Provide accessible urinal flush control.

PCODE **WE03**
 ADAAG **4.18.4**
 ADA 2010 **605.4**
 CBC 2010 **1115B.4.2.2**
 CBC 2013 **11B-605.4**
 Priority **3**
 Severity **4**
TBD Contract Work


1 JOB \$500 **\$500**

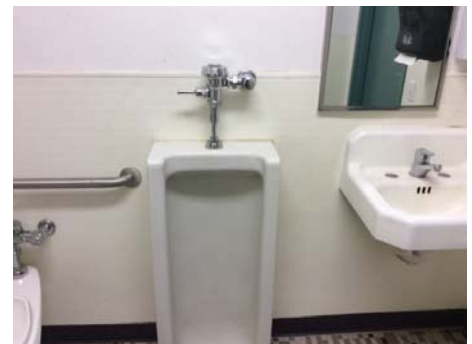


Facility: **CORCORAN LIBRARY**
 Address: 1001 CHITTENDEN AVE.

Area: **Interior**
 Year to be Completed: **TBD**


Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Water Closet</u>						
4762	<ul style="list-style-type: none"> <i>As-Built Description:</i> Water closet not 17"-18" from near side wall to center line of water closet (2010 ADAS: 16"-18"). <i>As-Built:</i> 16.5" o.c. <i>Proposed Solution:</i> Relocate existing water closet and plumbing, remount with offset closet flange to provide 17"-18" from side wall. 	PCODE WB02C ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$500	\$500
						

4758	<ul style="list-style-type: none"> <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall. <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type, or install sensor flush. 	PCODE WB10 ADAAG 4.16.5 ADA 2010 604.6 CBC 2010 1115B.4.1.5 CBC 2013 11B-604.6 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
						

4 Staff Offices

Sink

4771	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink rim higher than 34" above floor. <i>As-Built:</i> 34.75" <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	PCODE IN06 ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

Total Costs for	Part/floor: Interior	Ground Floor	\$4,650.00
------------------------	-----------------------------	---------------------	-------------------

Facility: **CORCORAN LIBRARY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1001 CHITTENDEN AVE.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$4,650.00

Facility: **CORCORAN LIBRARY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1001 CHITTENDEN AVE.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: CORCORAN LIBRARY					\$4,850.00
------------------------	-----------------------------------	--	--	--	--	-------------------

Facility: **CORCORAN HEALTH SERVICES**
 Address: 1002 DAIRY AVE.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Front Parking


Parking

4337	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space smaller than 8' wide (CA only: 9' x 18'). <i>As-Built:</i> Striping missing or faded <i>Proposed Solution:</i> Modify parking space(s) to create accessible space. 	PCODE EA02A ADAAG 4.6.3 ADA 2010 502.2 CBC 2010 1129B.3.1 CBC 2013 11B-502.2 Priority 1 Severity 4 TBD Contract Work	1	JOB	\$200	\$200
						
4341	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space does not have 5' wide access aisle; 8' wide for van accessible aisle. <i>Proposed Solution:</i> Modify parking aisle(s) to create accessible space by restriping. <i>Notes:</i> 8 spaces 	PCODE EA02BREF ADAAG 4.6.3 ADA 2010 502.3 CBC 2010 1129B.3.1 CBC 2013 11B-502.2; 11B-502.3.1 Priority 1 Severity 1 TBD Contract Work				REF
						
4343	<ul style="list-style-type: none"> <i>As-Built Description:</i> Disabled persons must wheel or walk behind parked car(s) other than their own. <i>Proposed Solution:</i> Relocate parking and provide curb ramp to accessible route. <i>Notes:</i> from street, no pot 	PCODE EA03 ADAAG Fig.9 ADA 2010 502.3 CBC 2010 1129B.3.1 CBC 2013 11B-502.7.1 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$730	\$730
						

Facility: **CORCORAN HEALTH SERVICES**
 Address: 1002 DAIRY AVE.


Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4340	<ul style="list-style-type: none"> <i>As-Built Description:</i> International Symbol of Accessibility (36" square, in white on blue) is not painted on the pavement near the rear end of the parking space (required in CA only). <i>Proposed Solution:</i> Apply symbol on parking space pavement when altering area. 	PCODE EA04AREF CBC 2010 1129B.4 CBC 2013 11B-502.6.4 Priority 1 Severity 4 TBD Contract Work				
			REF			
						

2 POT from Front Parking To Entrance

Changes in Level

4359	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route. <i>As-Built:</i> 1" <i>Proposed Solution:</i> Remove, replace or repair area of pavement sufficient to correct abrupt change in level. 	PCODE EF03 ADAAG 4.3.8 ADA 2010 403.4 CBC 2010 1133B.7.4 CBC 2013 11B-403.4 Priority 1 Severity 4 TBD Contract Work	4	SF	\$21	\$84
			REF			
						


Curb or Barrier

4346	<ul style="list-style-type: none"> <i>As-Built Description:</i> Ramp: No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp. <i>Proposed Solution:</i> Provide 2" minimum curb or wheel guide. 	PCODE EB14REF ADAAG 4.8.7 ADA 2010 405.9.2 CBC 2010 1133B.5.6 CBC 2013 11B-405.9.2 Priority 1 Severity 2 TBD Contract Work				
			REF			
						


Facility: **CORCORAN HEALTH SERVICES**
 Address: 1002 DAIRY AVE.

Area: **Exterior**
 Year to be Completed: **TBD**


Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Height						
4345	<ul style="list-style-type: none"> <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. <i>As-Built:</i> 32" <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02 ADAAG 4.9.4(5) ADA 2010 505.4 CBC 2010 1133B.4.2.1 & CBC 2013 11B-505.4 Priority 1 Severity 4 TBD Contract Work	50	LF	\$75	\$3,750
						

Top & Bottom Extension at Stairs

4348	<ul style="list-style-type: none"> <i>As-Built Description:</i> Stair handrail does not extend horizontally 12" minimum beyond top nosing, and one tread width sloped, plus 12" minimum horizontally beyond the bottom nosing. <i>As-Built:</i> 5"-11" <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for each extension piece). 	PCODE ED06 ADAAG 4.9.4(2) ADA 2010 505.10.2; 505.10.3 CBC 2010 1133B.4.2.2 CBC 2013 11B-505.10.2; 11B-505.10.3 Priority 4 Severity 4 TBD Contract Work	4	JOB	\$170	\$680
						

Top and Bottom Extension at Ramps


4347	<ul style="list-style-type: none"> <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). 	PCODE ED05REF ADAAG 4.8.5(2) ADA 2010 505.10.1 CBC 2010 1133B.4.2.2 & CBC 2013 11B-505.10.1 Priority 1 Severity 2 TBD Contract Work	REF			
------	---	--	-----	---	--	--

3 Side Exit


Facility: **CORCORAN HEALTH SERVICES**
 Address: 1002 DAIRY AVE.


Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Top & Bottom Extension at Stairs</u>						
4351	<ul style="list-style-type: none"> <i>As-Built Description:</i> Stair handrail does not extend horizontally 12" minimum beyond top nosing, and one tread width sloped, plus 12" minimum horizontally beyond the bottom nosing. <i>As-Built:</i> 11" <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for each extension piece). 	PCODE ED06 ADAAG 4.9.4(2) ADA 2010 505.10.2; 505.10.3 CBC 2010 1133B.4.2.2 CBC 2013 11B-505.10.2; 11B-505.10.3 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$170	\$170
						

4 Staff Lot & Entrance

<u>Cross Slope</u>						
4357	<ul style="list-style-type: none"> <i>As-Built Description:</i> Cross slope more than 1":48" (2.083%). <i>As-Built:</i> 4.3% <i>Proposed Solution:</i> Modify cross slope. Notes: Not a ramp. <5% 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 3 TBD Contract Work	16	SF	\$25	\$400
						

<u>Curb Ramp</u>						
4355	<ul style="list-style-type: none"> <i>As-Built Description:</i> Slope greater than 1:12 (8.3%). <i>As-Built:</i> 10.2% <i>Proposed Solution:</i> Demolish existing and provide new curb ramp. 	PCODE EH02A ADAAG 4.7.2 ADA 2010 406.1 CBC 2010 1127B.5.3 CBC 2013 11B-406.2.1 Priority 1 Severity 4 TBD Contract Work	1	JOB	\$2,500	\$2,500
						

Facility: **CORCORAN HEALTH SERVICES**
 Address: 1002 DAIRY AVE.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Top and Bottom Extension at Ramps

- 4358
- *As-Built Description:*
 Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.
 - *Proposed Solution:*
 Provide ramp handrail extension (cost for each extension piece).
 - *Notes:*
Not considered a ramp, extensions not required.

PCODE ED05REF
 ADAAG 4.8.5(2)
 ADA 2010 505.10.1
 CBC 2010 1133B.4.2.2 &
 CBC 2013 11B-505.10.1
 Priority 4
 Severity 4
 TBD Contract Work

REF



Total Costs for	Part/floor: Exterior	On-site	\$8,514.00
------------------------	-----------------------------	----------------	-------------------

Facility: **CORCORAN HEALTH SERVICES**
Address: 1002 DAIRY AVE.

Area: **Exterior**
Year to be Completed: **TBD**

Part/Floor: **On-site**
Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Area: Exterior					\$8,514.00
------------------------	-----------------------	--	--	--	--	-------------------

Facility: **CORCORAN HEALTH SERVICES**
 Address: 1002 DAIRY AVE.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Entrance Lobby

Door Threshold

4252

- *As-Built Description:*
 Door inaccessible due to threshold or step at door exceeding 1/2".
- *As-Built:* 1.5"
- *Proposed Solution:*
 Modify threshold to be no more than 1/2" by removing existing paving at door and providing landing with edge ramping (slope 1:20 max).

PCODE **ID02A**
 ADAAG **4.13.8**
 ADA 2010 **404.2.5**
 CBC 2010 **1133B.2.4.1**
 CBC 2013 **11B-404.2.5**
 Priority **1**
 Severity **4**
TBD Contract Work

1 JOB \$400 \$400



Drinking Fountain

4256

- *As-Built Description:*
 Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping.
- *Proposed Solution:*
 Provide additional fountain or hi-lo combination fountain.

PCODE **IA01A**
 ADAAG **4.1.3(10)(a)**
 ADA 2010 **211.1**
 CBC 2010 **1115B.4.6.1**
 CBC 2013 **11B-211.1**
 Priority **3**
 Severity **2**
TBD Contract Work

1 JOB \$2,000 \$2,000



4257

- *As-Built Description:*
 Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain). Unit in good condition.
- *As-Built:* 26.5"
- *Proposed Solution:*
 Remount fountain at accessible height.

PCODE **IA02A**
 ADAAG **4.15.5(1)**
 ADA 2010 **602.2**
 CBC 2010 **1115B.4.6.2**
 CBC 2013 **11B-602.2**
 Priority **3**
 Severity **2**
TBD Contract Work

1 JOB \$1,200 \$1,200



Facility: **CORCORAN HEALTH SERVICES**
 Address: 1002 DAIRY AVE.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4260	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	PCODE IA04 CBC 2010 1115B.4.6.3; Fig. CBC 2013 11B-602.9 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$3,000	\$3,000



2 Lobby Restroom - Women's

Counter

4267	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible counter (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> BCS: no knee space, 37.5" top <i>Proposed Solution:</i> Provide new section of counter at 34" high max. 	PCODE IN02B ADAAG 4.32.3 & .4 ADA 2010 902.3 CBC 2010 1122B.3 & 4 CBC 2013 11B-902.3 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$2,500	\$2,500
------	--	---	---	-----	---------	---------



Lavatory


4272	<ul style="list-style-type: none"> <i>As-Built Description:</i> Knee clearance 27" min. high starting 8" back from the front edge of the lavatory towards the wall is not provided. <i>As-Built:</i> 24.25" <i>Proposed Solution:</i> Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD04 ADAAG Fig. 31 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-306.3.3 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$3,400	\$3,400
------	---	--	---	-----	---------	---------




Facility: **CORCORAN HEALTH SERVICES**
 Address: 1002 DAIRY AVE.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Toilet Stall</u>						
4275	<ul style="list-style-type: none"> As-Built Description: Toilet stall less than 60" wide. As-Built: 58" Proposed Solution: Provide new accessible stall. 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

<u>Water Closet</u>						
4281	<ul style="list-style-type: none"> As-Built Description: Water closet not 17"-18" from near side wall to center line of water closet (2010 ADAS: 16"-18"). As-Built: 18.75" o.c. Proposed Solution: Relocate existing water closet and plumbing, remount with offset closet flange to provide 17"-18" from side wall. 	PCODE WB02C ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$500	\$500
						

3 Lobby Restroom - Men's

<u>Lavatory</u>						
4288	<ul style="list-style-type: none"> As-Built Description: Knee clearance 27" min. high starting 8" back from the front edge of the lavatory towards the wall is not provided. As-Built: 24.5" Proposed Solution: Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD04 ADAAG Fig. 31 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-306.3.3 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$3,400	\$3,400
						

Facility: **CORCORAN HEALTH SERVICES**
 Address: 1002 DAIRY AVE.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Toilet Stall

4297	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet stall less than 60" wide. • <i>As-Built:</i> 58" • <i>Proposed Solution:</i> Provide new accessible stall. 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$1,500	\$1,500
------	--	---	---	-----	---------	----------------




Urinal

4293	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Urinal flush control lever more than 48" above floor (CA only: 44" max.). • <i>As-Built:</i> 45" • <i>Proposed Solution:</i> Provide accessible urinal flush control. 	PCODE WE03 ADAAG 4.18.4 ADA 2010 605.4 CBC 2010 1115B.4.2.2 CBC 2013 11B-605.4 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$500	\$500
------	--	---	---	-----	-------	--------------




4292	<ul style="list-style-type: none"> • <i>As-Built Description:</i> 30" x 48" clear floor space in front of accessible urinal not provided. • <i>As-Built:</i> 29.5" wide • <i>Proposed Solution:</i> Provide clear floor space in front of accessible urinal. Remodel restroom as needed. • Notes: 12" o.c. 	PCODE WE04 ADAAG 4.18.3 ADA 2010 605.3 CBC 2010 1115B.4.2.3 CBC 2013 11B-605.3 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
------	--	---	---	-----	---------	----------------

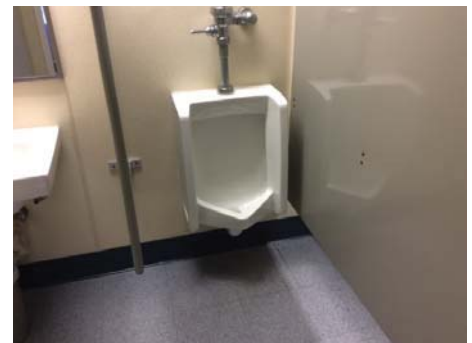


Facility: **CORCORAN HEALTH SERVICES**
 Address: 1002 DAIRY AVE.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Water Closet</u>						
4298	<ul style="list-style-type: none"> <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall. <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type, or install sensor flush. 	PCODE WB10 ADAAG 4.16.5 ADA 2010 604.6 CBC 2010 1115B.4.1.5 CBC 2013 11B-604.6 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
						

4 Breakroom

<u>Sink</u>						
4303	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. <i>Notes:</i> Also fridge 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						


4304	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink rim higher than 34" above floor. <i>As-Built:</i> 35.75" <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work	REF			
						

5 Classroom

Facility: **CORCORAN HEALTH SERVICES**
 Address: 1002 DAIRY AVE.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Assistive Listening</u>						
4309	<ul style="list-style-type: none"> <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	PCODE GI01E ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work				
						REF
						

7 Nurses Office

Sink

4327

- As-Built Description:*
Sink does not have knee space min. 27" high x 19" deep x 30" wide.
- Proposed Solution:*
Remodel sink cabinet.
- Notes:*
Staff Only. top 29.5"

PCODE **IN06A**
 ADAAG **4.24.3**
 ADA 2010 **606.2**
 CBC 2010 **1115B.4.7.1**
 CBC 2013 **11B-606.2**
 Priority **4**
 Severity **2**
 TBD **Contract Work**

1 JOB \$1,750 \$1,750



8 Counselors Office

Non-Fixed Desk

4332

- As-Built Description:*
Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided.
- As-Built:* 10" deep
- Proposed Solution:*
Provide table or desk with accessible dimensions when purchasing new furniture.

PCODE **IN02A**
 ADAAG **4.32.3 & .4**
 ADA 2010 **306.1**
 CBC 2010 **1122B.3 & 4**
 CBC 2013 **11B-306.1 & 11B-902.3**
 Priority **2**
 Severity **2**
 TBD **Contract Work**


1 JOB \$1,600 \$1,600




Facility: **CORCORAN HEALTH SERVICES**
 Address: 1002 DAIRY AVE.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Sink						
4330	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. <i>Notes:</i> Top 36" 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

9 Staff Restroom

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Restroom						
4336	<ul style="list-style-type: none"> <i>As-Built Description:</i> Single accommodation restroom not accessible; multiple compliance violations. <i>Proposed Solution:</i> Remodel area to provide single-occupant accessible restroom. <i>Notes:</i> 39.5"x80" 	PCODE WA01 ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.2 CBC 2013 11B-603 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$30,000	\$30,000
						

Total Costs for Part/floor: Interior On-site **\$58,750.00**

Facility: **CORCORAN HEALTH SERVICES**
Address: 1002 DAIRY AVE.

Area: **Interior**
Year to be Completed: **TBD**

Part/Floor: **On-site**
Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Area: Interior **\$58,750.00**

Facility: **CORCORAN HEALTH SERVICES**

Area: **Interior**

Part/Floor: **On-site**

Address: 1002 DAIRY AVE.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Facility: CORCORAN HEALTH SERVICES \$67,264.00

Facility: **CORCORAN HUMAN SERVICES**
 Address: 951 CHITTENDEN AVE.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Main Entrance & Lobby

Door

4587	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 6.0% at 39" from door <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 1 Severity 3 TBD Contract Work	30	SF	\$40	\$1,200
------	---	---	----	----	------	---------



2 Parking Lot Staff Entrance on Hanna

Door

4711	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 3.3% <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 1 Severity 4 TBD Contract Work	30	SF	\$40	\$1,200
------	--	---	----	----	------	---------



Door Swing

4710	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18"(CA only: 24" at exterior doors)x 60". <i>As-Built:</i> 3" <i>Proposed Solution:</i> Extend maneuvering space. 	PCODE ID23D ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 1 Severity 2 TBD Contract Work	1	JOB	\$800	\$800
------	---	---	---	-----	-------	-------



3 POT from Building 1 to Building 2

Facility: **CORCORAN HUMAN SERVICES**
 Address: 951 CHITTENDEN AVE.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Clear Width						
4723	<ul style="list-style-type: none"> As-Built Description: Walk less than 36" wide. As-Built: 24"-36" Proposed Solution: Enlarge width of walk to 48". 	PCODE EF08A ADAAG 4.3.3 ADA 2010 403.5.1 CBC 2010 1133B.7.1 CBC 2013 11B-403.5.1 Priority 1 Severity 1 TBD Contract Work	72	SF	\$45	\$3,240
						
Cross Slope						
4724	<ul style="list-style-type: none"> As-Built Description: Cross slope more than 1":48" (2.083%). As-Built: Various slope issues 2.4-4.3% Proposed Solution: Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 3 TBD Contract Work	240	SF	\$25	\$6,000
						
4728	<ul style="list-style-type: none"> As-Built Description: Cross slope more than 1":48" (2.083%). As-Built: Portions 3.5-4.4% Proposed Solution: Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 3 TBD Contract Work	200	SF	\$25	\$5,000
						

Facility: **CORCORAN HUMAN SERVICES**
 Address: 951 CHITTENDEN AVE.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Floor or Ground Surfaces

4718 • *As-Built Description:*
 Accessible parking space has slope greater than 1/4":12" (2%).

• *As-Built:* Rear of spaces 2.4%

• *Proposed Solution:*
 Modify slope at accessible parking space.

PCODE EA05
 ADAAG 4.6.3
 ADA 2010 502.4
 CBC 2010 1129B.3.3
 CBC 2013 11B-502.4
 Priority 1
 Severity 4
 TBD Contract Work

34 SF \$12 \$408



Parking

4714 • *As-Built Description:*
 Disabled persons must wheel or walk behind parked car(s) other than their own.

• *As-Built:* Not an accessible POT. Various slope issues.

• *Proposed Solution:*
 Relocate parking and provide curb ramp to accessible route.

• *Notes:*
Recommend using main entrance at street for Bldg 2

PCODE EA03REF
 ADAAG Fig.9
 ADA 2010 502.3
 CBC 2010 1129B.3.1
 CBC 2013 11B-502.7.1
 Priority 1
 Severity 1
 TBD Contract Work

REF



Total Costs for	Part/floor: Exterior	On-site	\$17,848.00
------------------------	-----------------------------	----------------	--------------------

Facility: **CORCORAN HUMAN SERVICES**

Area: **Exterior**

Part/Floor: **On-site**

Address: 951 CHITTENDEN AVE.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$17,848.00

Facility: **CORCORAN HUMAN SERVICES**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 951 CHITTENDEN AVE.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------


1 Main Entrance & Lobby

Door Threshold

- 4590
- *As-Built Description:*
Door inaccessible due to threshold or step at door exceeding 1/2".
 - *As-Built:* 0.75"
 - *Proposed Solution:*
Modify threshold to be no more than 1/2" by removing existing paving at door and providing landing with edge ramping (slope 1:20 max).

PCODE ID02A
 ADAAG 4.13.8
 ADA 2010 404.2.5
 CBC 2010 1133B.2.4.1
 CBC 2013 11B-404.2.5
 Priority 1
 Severity 4
 TBD Contract Work

1 JOB \$400 \$400

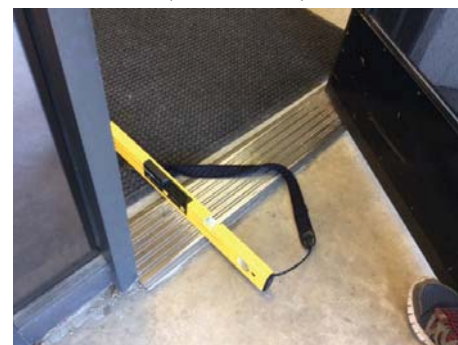

Non-Fixed Desk

- 4593
- *As-Built Description:*
Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided.
 - *As-Built:* 42" top
 - *Proposed Solution:*
Provide table or desk with accessible dimensions when purchasing new furniture.

PCODE IN02A
 ADAAG 4.32.3 & .4
 ADA 2010 306.1
 CBC 2010 1122B.3 & 4
 CBC 2013 11B-306.1 & 11B-902.3
 Priority 1
 Severity 2
 TBD Contract Work

1 JOB \$1,600 \$1,600




3 Central Corridor

Drinking Fountain

- 4603
- *As-Built Description:*
Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping.
 - *Proposed Solution:*
Provide additional fountain or hi-lo combination fountain.

PCODE IA01A
 ADAAG 4.1.3(10)(a)
 ADA 2010 211.1
 CBC 2010 1115B.4.6.1
 CBC 2013 11B-211.1
 Priority 3
 Severity 2
 TBD Contract Work

1 JOB \$2,000 \$2,000

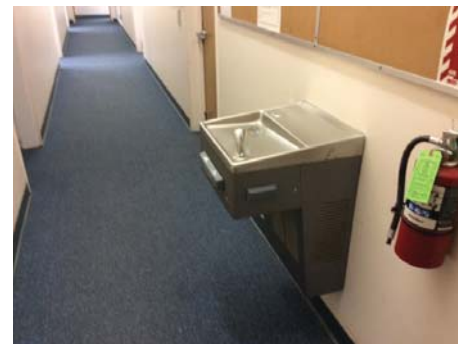

Facility: **CORCORAN HUMAN SERVICES**
 Address: 951 CHITTENDEN AVE.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4602	<ul style="list-style-type: none"> As-Built Description: CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. Proposed Solution: Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	PCODE IA04 CBC 2010 1115B.4.6.3; Fig. CBC 2013 11B-602.9 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$3,000	\$3,000



4 Interview Room Booth 2 & 3

Non-Fixed Desk

4612	<ul style="list-style-type: none"> As-Built Description: Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. As-Built: Booth 2: No knee clearance. Proposed Solution: Provide table or desk with accessible dimensions when purchasing new furniture. Notes: Use booth 3 if writing surface is required for wheelchair user. 	PCODE IN02AREF ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 TBD Contract Work	REF			
------	---	--	-----	--	--	--

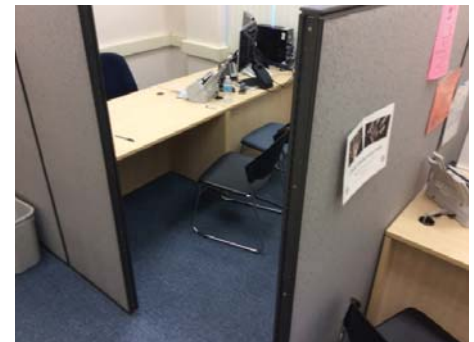

6 Interview Room Booth 5-6

Non-Fixed Desk

4615	<ul style="list-style-type: none"> As-Built Description: Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. As-Built: No knee clearances Proposed Solution: Provide table or desk with accessible dimensions when purchasing new furniture. Notes: Use booth 2. or reverse one desk at booth 6 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
------	--	---	---	-----	---------	---------





7 Unisex Restroom

Facility: **CORCORAN HUMAN SERVICES**
 Address: 951 CHITTENDEN AVE.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Toilet Stall</u>						
4623	<ul style="list-style-type: none"> <i>As-Built Description:</i> The lavatory or other unintended fixture, encroaches on the necessary clearance around a water closet (60" x 56"). <i>As-Built:</i> 58" wide to storage. <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet. <i>Notes:</i> Modify , also relocate bin 	PCODE WB01A ADA 2010 604.3.1; 604.3.2 CBC 2013 11B-604.3.1; 11B-604.3.2 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$2,000	\$2,000
						

<u>Water Closet</u>						
4621	<ul style="list-style-type: none"> <i>As-Built Description:</i> Water closet not 17"-18" from near side wall to center line of water closet (2010 ADAS: 16"-18"). <i>As-Built:</i> 19" o.c. <i>Proposed Solution:</i> Relocate existing water closet and plumbing, remount with offset closet flange to provide 17"-18" from side wall. 	PCODE WB02C ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$500	\$500
						

8 HCL Staff Offices

<u>Door Clearance</u>						
4626	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 27.5" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$2,600	\$2,600
						

9 Staff Break Room

Facility: **CORCORAN HUMAN SERVICES**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 951 CHITTENDEN AVE.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Door Clearance

- 4629
- *As-Built Description:*
Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open.
 - *As-Built:* 27"
 - *Proposed Solution:*
Provide new, larger door and frame with new accessible hardware.

PCODE ID01
 ADAAG 4.13.5
 ADA 2010 404.2.3
 CBC 2010 1133B.1.1.1.1
 CBC 2013 11B-404.2.3
 Priority 4
 Severity 2
 TBD Contract Work

2 JOB \$2,600 \$5,200



Non-Fixed Desk

- 4632
- *As-Built Description:*
Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided.
 - *As-Built:* 24.5"
 - *Proposed Solution:*
Provide table or desk with accessible dimensions when purchasing new furniture.

PCODE IN02A
 ADAAG 4.32.3 & .4
 ADA 2010 306.1
 CBC 2010 1122B.3 & 4
 CBC 2013 11B-306.1 & 11B-902.3
 Priority 4
 Severity 2
 TBD Contract Work

1 JOB \$1,600 \$1,600



Sink

- 4631
- *As-Built Description:*
Sink does not have knee space min. 27" high x 19" deep x 30" wide.
 - *Proposed Solution:*
Remodel sink cabinet.

PCODE IN06A
 ADAAG 4.24.3
 ADA 2010 606.2
 CBC 2010 1115B.4.7.1
 CBC 2013 11B-606.2
 Priority 4
 Severity 2
 TBD Contract Work

1 JOB \$1,750 \$1,750



Facility: **CORCORAN HUMAN SERVICES**
 Address: 951 CHITTENDEN AVE.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4630	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 35.5" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work				



10 Staff Restroom

Door Clearance

4634	<ul style="list-style-type: none"> As-Built Description: Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. As-Built: 27" Proposed Solution: Provide new, larger door and frame with new accessible hardware. 	PCODE ID01REF ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 4 Severity 2 TBD Contract Work				
------	--	--	--	--	--	--



Grab Bars

4643	<ul style="list-style-type: none"> As-Built Description: Grab bars not provided or are not code compliant. Proposed Solution: Provide accessible grab bars. 	PCODE WB07REF ADAAG 4.17.6 ADA 2010 604.5 CBC 2010 1115B.4.1.3 CBC 2013 11B-604.5 Priority 4 Severity 3 TBD Contract Work				
------	---	--	--	--	--	--



Facility: **CORCORAN HUMAN SERVICES**
 Address: 951 CHITTENDEN AVE.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Lavatory

4636 • *As-Built Description:*
 Knee clearance 27" min. high starting 8" back from the front edge of the lavatory towards the wall is not provided.

• *Proposed Solution:*
 Provide new accessible lavatory. Remodel restroom as needed.

• *Notes:*
Top 36"

PCODE **WD04REF**
ADAAG **Fig. 31**
ADA 2010 **606.3**
CBC 2010 **1115B.4.3**
CBC 2013 **11B-306.3.3**
Priority **4**
Severity **2**
TBD Contract Work

REF



Restroom

4633 • *As-Built Description:*
 Single accommodation restroom not accessible; multiple compliance violations.

• *As-Built:* 40" wide

• *Proposed Solution:*
 Remodel area to provide single-occupant accessible restroom.

PCODE **WA01**
ADAAG **4.22**
ADA 2010 **603**
CBC 2010 **1115B.3.2**
CBC 2013 **11B-603**
Priority **4**
Severity **2**
TBD Contract Work

1 JOB \$30,000 **\$30,000**



Total Costs for	Part/floor: Interior	Ground Floor	\$52,250.00
------------------------	-----------------------------	---------------------	--------------------

Facility: **CORCORAN HUMAN SERVICES**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 951 CHITTENDEN AVE.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$52,250.00

Facility: **CORCORAN HUMAN SERVICES**
 Address: 951 CHITTENDEN AVE.

Area: **Interior-Bldg 2**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Entrance from Parking Lot

Door

4647	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 3.2% <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 1 Severity 4 TBD Contract Work	30	SF	\$40	\$1,200
------	--	---	----	----	------	---------



Door Threshold

4649	<ul style="list-style-type: none"> <i>As-Built Description:</i> Existing threshold at door is 1/2" high or less but without a beveled edge on both sides. <i>As-Built:</i> 0.75" <i>Proposed Solution:</i> Modify threshold to have beveled edge on each side. 	PCODE ID02 ADAAG 4.1.6(3)(d)(ii) ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 1 Severity 4 TBD Contract Work	1	JOB	\$250	\$250
------	---	--	---	-----	-------	-------



2 Kitchen

Sink

4654	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
------	--	--	---	-----	---------	---------



Facility: **CORCORAN HUMAN SERVICES**
 Address: 951 CHITTENDEN AVE.

Area: **Interior-Bldg 2**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4653	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sink rim higher than 34" above floor. • <i>As-Built:</i> 35.5" • <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work				



3 Unisex Restroom

Door Swing

4666	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60"). • <i>As-Built:</i> Stall 45" to wall • <i>Proposed Solution:</i> Remodel restroom as needed. 	PCODE ID27BNT ADAAG Fig. 25(c) ADA 2010 404.2.4 CBC 2010 11B-26A(c) CBC 2013 11B-404.2.4 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$1,600	\$1,600
------	--	---	---	-----	---------	----------------



Lavatory


4663	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lavatory: Fixture rim or counter height more than 34" above floor. • <i>As-Built:</i> 34.75" • <i>Proposed Solution:</i> Remount compliant fixture at accessible height. 	PCODE WD02A ADAAG 4.19.2 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$900	\$900
------	---	--	---	-----	-------	--------------





Facility: **CORCORAN HUMAN SERVICES**
 Address: 951 CHITTENDEN AVE.

Area: **Interior-Bldg 2**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Lavatory</u>						
4662	<ul style="list-style-type: none"> <i>As-Built Description:</i> Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory. <i>Proposed Solution:</i> Provide accessible faucet at accessible lavatory. 	PCODE WD06 ADAAG 4.19.5 ADA 2010 606.4 CBC 2010 1115B.4.3 CBC 2013 11B-606.4 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$600	\$600
						




<u>Restroom</u>							
4656	<ul style="list-style-type: none"> <i>As-Built Description:</i> Multiple accommodation restroom not accessible; multiple compliance violations. <i>Proposed Solution:</i> Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens). 	PCODE WA01AREF ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.1 CBC 2013 11B-603 Priority 3 Severity 1 TBD Contract Work	REF				

<u>Toilet Stall</u>						
4670	<ul style="list-style-type: none"> <i>As-Built Description:</i> Toilet stall less than 60" wide. <i>As-Built:</i> 57.5" <i>Proposed Solution:</i> Provide new accessible stall. 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

Facility: **CORCORAN HUMAN SERVICES**
 Address: 951 CHITTENDEN AVE.

Area: **Interior-Bldg 2**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Water Closet</u>						
4672	<ul style="list-style-type: none"> <i>As-Built Description:</i> Water closet not 17"-18" from near side wall to center line of water closet (2010 ADAS: 16"-18"). <i>As-Built:</i> 19" o.c. <i>Proposed Solution:</i> Relocate existing water closet and plumbing, remount with offset closet flange to provide 17"-18" from side wall. 	PCODE WB02C ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$500	\$500
						
4667	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: In single-accommodation restroom less than 48" in front of water closet provided. <i>As-Built:</i> 28" <i>Proposed Solution:</i> Remodel restroom to provide at least 48" in front of water closet. <i>Notes:</i> out swing door 	PCODE WB03A CBC 2010 1115B.3.2.1 CBC 2013 11B-604.3.1 Priority 3 Severity 1 TBD Contract Work	1	JOB	\$5,000	\$5,000
						
4671	<ul style="list-style-type: none"> <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall. <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type, or install sensor flush. 	PCODE WB10 ADAAG 4.16.5 ADA 2010 604.6 CBC 2010 1115B.4.1.5 CBC 2013 11B-604.6 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
						


5 Classroom 2

Facility: **CORCORAN HUMAN SERVICES**
 Address: 951 CHITTENDEN AVE.

Area: **Interior-Bldg 2**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Threshold</u>						
4682	<ul style="list-style-type: none"> As-Built Description: Door inaccessible due to threshold or step at door exceeding 1/2". As-Built: sandbags Proposed Solution: Modify threshold to be no more than 1/2" by removing existing paving at door and providing landing with edge ramping (slope 1:20 max). 	PCODE ID02A ADAAG 4.13.8 ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 2 Severity 4 TBD Contract Work	1	JOB	\$400	\$400
						

<u>Non-Fixed Desk</u>						
4685	<ul style="list-style-type: none"> As-Built Description: Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. As-Built: 26.5" Proposed Solution: Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

Total Costs for	Part/floor: Interior-Bldg 2	Ground Floor	\$15,800.00
------------------------	------------------------------------	---------------------	--------------------

Facility: **CORCORAN HUMAN SERVICES**

Area: **Interior-Bldg 2**

Part/Floor: **Ground Floor**

Address: 951 CHITTENDEN AVE.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior-Bldg 2

\$15,800.00

Facility: **CORCORAN HUMAN SERVICES**
 Address: 951 CHITTENDEN AVE.

Area: **Interior-Bldg 3**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Modular Ramp 1 - Eligibility

Slope

4687

- *As-Built Description:*
Slope greater than 1:12 (8.3%).
- *As-Built:* T bottom transition 10.5%
- *Proposed Solution:*
Demolish existing and provide new ramp with handrails.
- *Notes:*
Provide landing at bottom and feather out

PCODE **EB02**
 ADAAG **4.8.2**
 ADA 2010 **405.2**
 CBC 2010 **1133B.5.3**
 CBC 2013 **11B-405.2**
 Priority **1**
 Severity **4**
TBD Contract Work

24 SF \$100 **\$2,400**



Top and Bottom Extension at Ramps

4688

- *As-Built Description:*
Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.
- *Proposed Solution:*
Provide ramp handrail extension (cost for each extension piece).

PCODE **ED05**
 ADAAG **4.8.5(2)**
 ADA 2010 **505.10.1**
 CBC 2010 **1133B.4.2.2 &**
 CBC 2013 **11B-505.10.1**
 Priority **1**
 Severity **2**
TBD Contract Work

1 JOB \$170 **\$170**



4686

- *As-Built Description:*
Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.
- *As-Built:* Not at landing
- *Proposed Solution:*
Provide ramp handrail extension (cost for each extension piece).
- *Notes:*
Provide landing at bottom and feather out

PCODE **ED05NT**
 ADAAG **4.8.5(2)**
 ADA 2010 **505.10.1**
 CBC 2010 **1133B.4.2.2 &**
 CBC 2013 **11B-505.10.1**
 Priority **1**
 Severity **4**
TBD Contract Work

1 JOB \$170 **\$170**





2 Modular Ramp 2


Facility: **CORCORAN HUMAN SERVICES**
 Address: 951 CHITTENDEN AVE.

Area: **Interior-Bldg 3**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Handrail</u>						
4692	<ul style="list-style-type: none"> <i>As-Built Description:</i> Handrail: Gripping surface (rail top and sides) interrupted by support or other obstruction. <i>As-Built:</i> Not continuous <i>Proposed Solution:</i> Provide additional handrail as needed. <i>Notes:</i> This interruption was done to provide 60" for door clearance 	PCODE ED10 ADAAG 4.9.4(4) ADA 2010 505.3 CBC 2010 1133B.4.2.6 CBC 2013 11B-505.3 Priority 1 Severity 3 TBD Contract Work	5	LF	\$75	\$375
						

<u>Slope</u>						
4690	<ul style="list-style-type: none"> <i>As-Built Description:</i> Slope greater than 1:12 (8.3%). <i>As-Built:</i> 9.8% <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails. <i>Notes:</i> Provide landing at bottom and feather out 	PCODE EB02 ADAAG 4.8.2 ADA 2010 405.2 CBC 2010 1133B.5.3 CBC 2013 11B-405.2 Priority 1 Severity 4 TBD Contract Work	24	SF	\$100	\$2,400
						
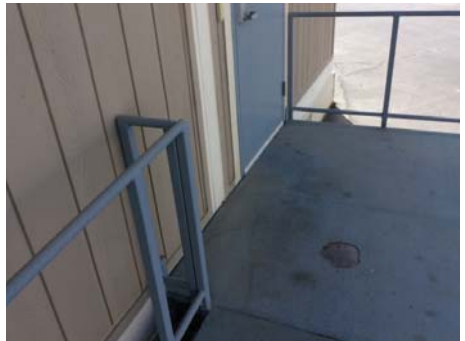
<u>Top and Bottom Extension at Ramps</u>						
4691	<ul style="list-style-type: none"> <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). 	PCODE ED05 ADAAG 4.8.5(2) ADA 2010 505.10.1 CBC 2010 1133B.4.2.2 & CBC 2013 11B-505.10.1 Priority 1 Severity 2 TBD Contract Work	1	JOB	\$170	\$170
						

Facility: **CORCORAN HUMAN SERVICES**
 Address: 951 CHITTENDEN AVE.

Area: **Interior-Bldg 3**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4689	<ul style="list-style-type: none"> <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. <i>As-Built:</i> Not at landing <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). 	PCODE ED05REF ADAAG 4.8.5(2) ADA 2010 505.10.1 CBC 2010 1133B.4.2.2 & CBC 2013 11B-505.10.1 Priority 1 Severity 4 TBD Contract Work				



5 Unisex Restrooms - Staff

Toilet Stall

4706	<ul style="list-style-type: none"> <i>As-Built Description:</i> The lavatory or other unintended fixture, encroaches on the necessary clearance around a water closet (60" x 56"). <i>As-Built:</i> 30" to lavatory, 54" to side wall <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet. 	PCODE WB01A ADA 2010 604.3.1; 604.3.2 CBC 2013 11B-604.3.1; 11B-604.3.2 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$2,000	\$2,000
------	--	--	---	-----	---------	---------



Water Closet

4708	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: In single-accommodation restroom less than 48" in front of water closet provided. <i>As-Built:</i> storage items 30" <i>Proposed Solution:</i> Remodel restroom to provide at least 48" in front of water closet. <i>Notes:</i> relocate items if requested 	PCODE WB03AREF CBC 2010 1115B.3.2.1 CBC 2013 11B-604.3.1 Priority 4 Severity 1 TBD Contract Work				
------	--	---	--	--	--	--



Total Costs for	Part/floor: Interior-Bldg 3	Ground Floor	\$7,685.00
------------------------	------------------------------------	---------------------	-------------------

Facility: **CORCORAN HUMAN SERVICES**

Area: **Interior-Bldg 3**

Part/Floor: **Ground Floor**

Address: 951 CHITTENDEN AVE.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior-Bldg 3

\$7,685.00

Facility: **CORCORAN HUMAN SERVICES**

Area: **Interior-Bldg 3**

Part/Floor: **Ground Floor**

Address: 951 CHITTENDEN AVE.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: CORCORAN HUMAN SERVICES					\$93,583.00
------------------------	--	--	--	--	--	--------------------

Facility: **HISTORICAL SOCIETY**
 Address: 14068 HACKETT ST.

Area: **Exterior**
 Year to be Completed: **TBD**


Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Parking


Changes in Level

4212	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route. <i>As-Built:</i> 0.5" <i>Proposed Solution:</i> Remove, replace or repair area of pavement sufficient to correct abrupt change in level. 	PCODE EF03 ADAAG 4.3.8 ADA 2010 403.4 CBC 2010 1133B.7.4 CBC 2013 11B-403.4 Priority 1 Severity 4 TBD Contract Work	4	SF	\$21	\$84
------	---	--	---	----	------	------




Parking

4209	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space does not have 5' wide access aisle; 8' wide for van accessible aisle. <i>Proposed Solution:</i> Modify parking aisle(s) to create accessible space by restriping. 	PCODE EA02B ADAAG 4.6.3 ADA 2010 502.3 CBC 2010 1129B.3.1 CBC 2013 11B-502.2; 11B-502.3.1 Priority 1 Severity 1 TBD Contract Work	1	JOB	\$200	\$200
------	--	--	---	-----	-------	-------



4210	<ul style="list-style-type: none"> <i>As-Built Description:</i> International Symbol of Accessibility (36" square, in white on blue) is not painted on the pavement near the rear end of the parking space (required in CA only). <i>Proposed Solution:</i> Apply symbol on parking space pavement when altering area. 	PCODE EA04A CBC 2010 1129B.4 CBC 2013 11B-502.6.4 Priority 1 Severity 4 TBD Contract Work	1	JOB	\$120	\$120
------	--	--	---	-----	-------	-------

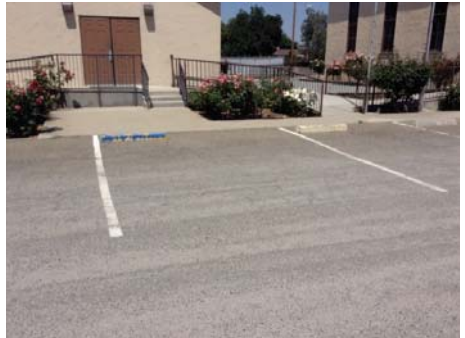

2 POT from Parking to Church

Facility: **HISTORICAL SOCIETY**
 Address: 14068 HACKETT ST.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Change in Direction

- 4214
- *As-Built Description:*
 Landing at change of direction not 60" minimum by 72" minimum in the direction of downward travel from the upper ramp run.
 - *As-Built:* 48"
 - *Proposed Solution:*
 Modify landing at change of direction to 60" x 72".

PCODE **EB08REF**
 ADAAG **4.8.4(3)**
 ADA 2010 **405.7.4**
 CBC 2010 **1133B.5.4**
 CBC 2013 **11B-405.7.4**
 Priority **1**
 Severity **2**
TBD Contract Work

REF



Cross Slope

- 4216
- *As-Built Description:*
 Ramp: Cross slope more than 1/4":12" (2%).
 - *As-Built:* 4.2%
 - *Proposed Solution:*
 Modify ramp's cross slope.

PCODE **EB15**
 ADAAG **4.8.6**
 ADA 2010 **405.3**
 CBC 2010 **1133B.5.3.1**
 CBC 2013 **11B-405.3**
 Priority **1**
 Severity **3**
TBD Contract Work

40 SF \$100 **\$4,000**



Handrails

- 4219
- *As-Built Description:*
 Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).
 - *Proposed Solution:*
 Provide new handrail for each side including extensions.

PCODE **ED01**
 ADAAG **4.8.5 & 4.9.4**
 ADA 2010 **505.2**
 CBC 2010 **1133B.4.1.1 & .5.5**
 CBC 2013 **11B-505.2**
 Priority **1**
 Severity **2**
TBD Contract Work


12 LF \$95 **\$1,140**





Facility: **HISTORICAL SOCIETY**
 Address: 14068 HACKETT ST.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Height						
4217	<ul style="list-style-type: none"> As-Built Description: Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. As-Built: 38.5" Proposed Solution: Remove existing and provide new handrail. 	PCODE ED02 ADAAG 4.9.4(5) ADA 2010 505.4 CBC 2010 1133B.4.2.1 & CBC 2013 11B-505.4 Priority 1 Severity 4 TBD Contract Work	68	LF	\$75	\$5,100
						


Slope						
4215	<ul style="list-style-type: none"> As-Built Description: Slope greater than 1:12 (8.3%). As-Built: 8.7% upper part of ramp Proposed Solution: Demolish existing and provide new ramp with handrails. 	PCODE EB02 ADAAG 4.8.2 ADA 2010 405.2 CBC 2010 1133B.5.3 CBC 2013 11B-405.2 Priority 1 Severity 4 TBD Contract Work	32	SF	\$100	\$3,200
						


4213	<ul style="list-style-type: none"> As-Built Description: Level 2% max. landing for ramp not provided. As-Built: 3.9-4.9% Proposed Solution: Rebuild ramp to provide landings for each ramp run with slopes no greater than 2% 	PCODE EB05A ADAAG 4.8.4 ADA 2010 405.7.1 CBC 2010 1133B.5.4.1 CBC 2013 11B-405.7.1 Priority 1 Severity 3 TBD Contract Work	126	SF	\$100	\$12,600
						

Facility: **HISTORICAL SOCIETY**
 Address: 14068 HACKETT ST.


Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Top & Bottom Extension at Stairs</u>						
4220	<ul style="list-style-type: none"> <i>As-Built Description:</i> Stair handrail does not extend horizontally 12" minimum beyond top nosing, and one tread width sloped, plus 12" minimum horizontally beyond the bottom nosing. <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for each extension piece). 	PCODE ED06 ADAAG 4.9.4(2) ADA 2010 505.10.2; 505.10.3 CBC 2010 1133B.4.2.2 CBC 2013 11B-505.10.2; 11B-505.10.3 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$170	\$170
						

<u>Top and Bottom Extension at Ramps</u>						
4218	<ul style="list-style-type: none"> <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). 	PCODE ED05REF ADAAG 4.8.5(2) ADA 2010 505.10.1 CBC 2010 1133B.4.2.2 & CBC 2013 11B-505.10.1 Priority 1 Severity 2 TBD Contract Work	REF			
						


3 POT from Parking to Dining Hall

<u>Change in Direction</u>						
4227	<ul style="list-style-type: none"> <i>As-Built Description:</i> Landing at change of direction not 60" minimum by 72" minimum in the direction of downward travel from the upper ramp run. <i>As-Built:</i> 54" <i>Proposed Solution:</i> Modify landing at change of direction to 60" x 72". 	PCODE EB08REF ADAAG 4.8.4(3) ADA 2010 405.7.4 CBC 2010 1133B.5.4 CBC 2013 11B-405.7.4 Priority 1 Severity 3 TBD Contract Work	REF			
						


Facility: **HISTORICAL SOCIETY**
 Address: 14068 HACKETT ST.

Area: **Exterior**
 Year to be Completed: **TBD**


Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4222	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Landing at change of direction not 60" minimum by 72" minimum in the direction of downward travel from the upper ramp run. • <i>As-Built:</i> 57" • <i>Proposed Solution:</i> Modify landing at change of direction to 60" x 72". 	PCODE EB08REF ADAAG 4.8.4(3) ADA 2010 405.7.4 CBC 2010 1133B.5.4 CBC 2013 11B-405.7.4 Priority 1 Severity 4 TBD Contract Work				
			REF			

Door

4230	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). • <i>As-Built:</i> 2.4% • <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 1 Severity 4 TBD Contract Work	60	SF	\$40	\$2,400
						


Height


4224	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-Built:</i> 38.5" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02 ADAAG 4.9.4(5) ADA 2010 505.4 CBC 2010 1133B.4.2.1 & CBC 2013 11B-505.4 Priority 1 Severity 4 TBD Contract Work	30	LF	\$75	\$2,250
						

Facility: **HISTORICAL SOCIETY**
 Address: 14068 HACKETT ST.


Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Slope						
4226	<ul style="list-style-type: none"> <i>As-Built Description:</i> Slope greater than 1:12 (8.3%). <i>As-Built:</i> Left Ramp 12.7% <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails. <i>Notes:</i> Provide directional sign to other ramp. 	PCODE EB02 ADAAG 4.8.2 ADA 2010 405.2 CBC 2010 1133B.5.3 CBC 2013 11B-405.2 Priority 1 Severity 3 TBD Contract Work	48	SF	\$100	\$4,800
						

4223	<ul style="list-style-type: none"> <i>As-Built Description:</i> Level 2% max. landing for ramp not provided. <i>As-Built:</i> 5.4% <i>Proposed Solution:</i> Rebuild ramp to provide landings for each ramp run with slopes no greater than 2% 	PCODE EB05AREF ADAAG 4.8.4 ADA 2010 405.7.1 CBC 2010 1133B.5.4.1 CBC 2013 11B-405.7.1 Priority 1 Severity 3 TBD Contract Work	REF			
------	---	---	-----	--	--	--

Top & Bottom Extension at Stairs

4232	<ul style="list-style-type: none"> <i>As-Built Description:</i> Stair handrail does not extend horizontally 12" minimum beyond top nosing, and one tread width sloped, plus 12" minimum horizontally beyond the bottom nosing. <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for each extension piece). 	PCODE ED06 ADAAG 4.9.4(2) ADA 2010 505.10.2; 505.10.3 CBC 2010 1133B.4.2.2 CBC 2013 11B-505.10.2; 11B-505.10.3 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$170	\$170
						

Facility: **HISTORICAL SOCIETY**
 Address: 14068 HACKETT ST.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Top and Bottom Extension at Ramps

- 4225
- *As-Built Description:*
Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.
 - *Proposed Solution:*
Provide ramp handrail extension (cost for each extension piece).

PCODE ED05REF
 ADAAG 4.8.5(2)
 ADA 2010 505.10.1
 CBC 2010 1133B.4.2.2 &
 CBC 2013 11B-505.10.1
 Priority 1
 Severity 2
 TBD Contract Work


REF



- 4228
- *As-Built Description:*
Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.
 - *Proposed Solution:*
Provide ramp handrail extension (cost for each extension piece).

PCODE ED05REF
 ADAAG 4.8.5(2)
 ADA 2010 505.10.1
 CBC 2010 1133B.4.2.2 &
 CBC 2013 11B-505.10.1
 Priority 1
 Severity 2
 TBD Contract Work

REF

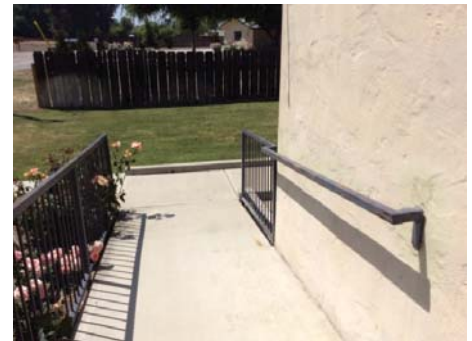


4 Church Exit Ramp

Door

- 4233
- *As-Built Description:*
Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%).
 - *As-Built:* 4.4%
 - *Proposed Solution:*
Modify surface slope at door.

PCODE ID11
 ADAAG 4.13.6
 ADA 2010 404.2.4.4
 CBC 2010 1133B.2.4
 CBC 2013 11B-404.2.4
 Priority 3
 Severity 3
 TBD Contract Work

30 SF \$40 \$1,200

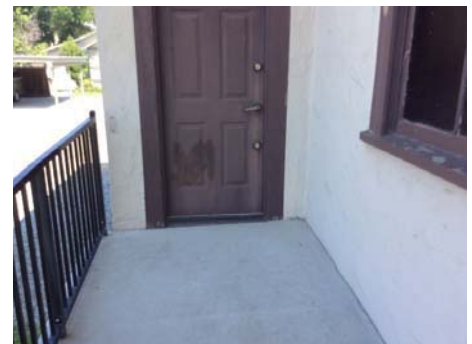

Facility: **HISTORICAL SOCIETY**
 Address: 14068 HACKETT ST.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Door Swing

4235 • *As-Built Description:*
 Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18"(CA only: 24" at exterior doors)x 60".
 • *As-Built:* 13.5"
 • *Proposed Solution:*
 Change door swing and enlarge landing.
 • *Notes:*
To staff office

PCODE ID23D
 ADAAG Fig. 25(a)
 ADA 2010 404.2.4
 CBC 2010 11B-26A(a)
 CBC 2013 11B-404.2.4
 Priority 3
 Severity 4
 TBD Contract Work

1 JOB \$800 \$800



Door Threshold

4234 • *As-Built Description:*
 Door inaccessible due to threshold or step at door exceeding 1/2".
 • *As-Built:* 1.25"
 • *Proposed Solution:*
 Modify threshold to be no more than 1/2" by removing existing paving at door and providing landing with edge ramping (slope 1:20 max).

PCODE ID02AREF
 ADAAG 4.13.8
 ADA 2010 404.2.5
 CBC 2010 1133B.2.4.1
 CBC 2013 11B-404.2.5
 Priority 3
 Severity 4
 TBD Contract Work

REF



Handrail

4237 • *As-Built Description:*
 Handrail: Gripping surface (rail top and sides) interrupted by support or other obstruction.
 • *As-Built:* Gripping surface has interruptions
 • *Proposed Solution:*
 Provide additional handrail as needed.

PCODE ED10
 ADAAG 4.9.4(4)
 ADA 2010 505.3
 CBC 2010 1133B.4.2.6
 CBC 2013 11B-505.3
 Priority 3
 Severity 3
 TBD Contract Work


23 LF \$75 \$1,725




Facility: **HISTORICAL SOCIETY**
 Address: 14068 HACKETT ST.


Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Handrails</u>						
4236	<ul style="list-style-type: none"> <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas). <i>Proposed Solution:</i> Provide new handrail for each side including extensions. <i>Notes:</i> Handrails abruptly end on one side 	PCODE ED01 ADAAG 4.8.5 & 4.9.4 ADA 2010 505.2 CBC 2010 1133B.4.1.1 & .5.5 CBC 2013 11B-505.2 Priority 3 Severity 2 TBD Contract Work	23	LF	\$95	\$2,185
						

<u>Top and Bottom Extension at Ramps</u>						
4238	<ul style="list-style-type: none"> <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). 	PCODE ED05 ADAAG 4.8.5(2) ADA 2010 505.10.1 CBC 2010 1133B.4.2.2 & CBC 2013 11B-505.10.1 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$170	\$170
						


5 Dining Hall Exit


<u>Handrails</u>						
4243	<ul style="list-style-type: none"> <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas). <i>Proposed Solution:</i> Provide new handrail for each side including extensions. 	PCODE ED01 ADAAG 4.8.5 & 4.9.4 ADA 2010 505.2 CBC 2010 1133B.4.1.1 & .5.5 CBC 2013 11B-505.2 Priority 2 Severity 2 TBD Contract Work	12	LF	\$95	\$1,140
						


Facility: **HISTORICAL SOCIETY**
 Address: 14068 HACKETT ST.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Slope</u>						
4240	<ul style="list-style-type: none"> <i>As-Built Description:</i> Slope greater than 1:12 (8.3%). <i>As-Built:</i> 9.1-10.1% <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails. 	PCODE EB02 ADAAG 4.8.2 ADA 2010 405.2 CBC 2010 1133B.5.3 CBC 2013 11B-405.2 Priority 2 Severity 4 TBD Contract Work	48	SF	\$100	\$4,800
						

<u>Top & Bottom Extension at Stairs</u>						
4245	<ul style="list-style-type: none"> <i>As-Built Description:</i> Stair handrail does not extend horizontally 12" minimum beyond top nosing, and one tread width sloped, plus 12" minimum horizontally beyond the bottom nosing. <i>As-Built:</i> lower <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for each extension piece). 	PCODE ED06 ADAAG 4.9.4(2) ADA 2010 505.10.2; 505.10.3 CBC 2010 1133B.4.2.2 CBC 2013 11B-505.10.2; 11B-505.10.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$170	\$170
						


<u>Top and Bottom Extension at Ramps</u>						
4241	<ul style="list-style-type: none"> <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). 	PCODE ED05REF ADAAG 4.8.5(2) ADA 2010 505.10.1 CBC 2010 1133B.4.2.2 & CBC 2013 11B-505.10.1 Priority 2 Severity 2 TBD Contract Work	REF			
						


6 POT from Parking to Restrooms

Facility: **HISTORICAL SOCIETY**
 Address: 14068 HACKETT ST.


Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Changes in Level</u>						
4242	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route. <i>As-Built:</i> 1.5" <i>Proposed Solution:</i> Remove, replace or repair area of pavement sufficient to correct abrupt change in level. 	PCODE EF03 ADAAG 4.3.8 ADA 2010 403.4 CBC 2010 1133B.7.4 CBC 2013 11B-403.4 Priority 3 Severity 3 TBD Contract Work	4	SF	\$21	\$84
						

<u>Cross Slope</u>						
4239	<ul style="list-style-type: none"> <i>As-Built Description:</i> Cross slope more than 1":48" (2.083%). <i>As-Built:</i> 3.2%-5.4% <i>Proposed Solution:</i> Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 3 Severity 3 TBD Contract Work	224	SF	\$25	\$5,600
						

7 Dining Hall Exit Stairs

<u>Handrails</u>						
4248	<ul style="list-style-type: none"> <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas). <i>Proposed Solution:</i> Provide new handrail for each side including extensions. 	PCODE ED01 ADAAG 4.8.5 & 4.9.4 ADA 2010 505.2 CBC 2010 1133B.4.1.1 & .5.5 CBC 2013 11B-505.2 Priority 3 Severity 2 TBD Contract Work	5	LF	\$95	\$475
						

Facility: **HISTORICAL SOCIETY**

Area: **Exterior**

Part/Floor: **On-site**

Address: 14068 HACKETT ST.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Top & Bottom Extension at Stairs

4250

• *As-Built Description:*

Stair handrail does not extend horizontally 12" minimum beyond top nosing, and one tread width sloped, plus 12" minimum horizontally beyond the bottom nosing.

• *Proposed Solution:*

Extend stair handrail at top and bottom (cost for each extension piece).

PCODE ED06

ADAAG 4.9.4(2)

ADA 2010 505.10.2; 505.10.3

CBC 2010 1133B.4.2.2

CBC 2013 11B-505.10.2; 11B-505.10.3

Priority 3

Severity 2

TBD Contract Work

1 JOB \$170 \$170



Total Costs for	Part/floor: Exterior	On-site	\$54,753.00
------------------------	-----------------------------	----------------	--------------------

Facility: **HISTORICAL SOCIETY**

Area: **Exterior**

Part/Floor: **On-site**

Address: 14068 HACKETT ST.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$54,753.00

Facility: **HISTORICAL SOCIETY**
 Address: 14068 HACKETT ST.

Area: **Interior**
 Year to be Completed: **TBD**


Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Church Main Entrance

Door Pair

<p>4153</p> <ul style="list-style-type: none"> <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. <i>As-Built:</i> 27.5" <i>Proposed Solution:</i> Provide new door leaves, unequal in width, to existing frame for pair of doors. <i>Notes:</i> two door vestibule 	<p><i>PCODE</i> ID08A <i>ADAAG</i> 4.13.4 <i>ADA 2010</i> 404.2.2 <i>CBC 2010</i> 1133B.2.3.1 <i>CBC 2013</i> 11B-404.2.2 Priority 1 Severity 2 TBD Contract Work</p>	<p>2 JOB \$1,500 \$3,000</p>
--	--	-------------------------------------

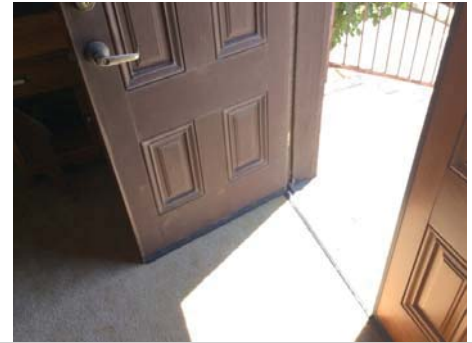

Door Threshold

<p>4152</p> <ul style="list-style-type: none"> <i>As-Built Description:</i> Door inaccessible due to threshold or step at door exceeding 1/2". <i>As-Built:</i> 0.75" <i>Proposed Solution:</i> Modify threshold to be no more than 1/2" by removing existing paving at door and providing landing with edge ramping (slope 1:20 max). 	<p><i>PCODE</i> ID02A <i>ADAAG</i> 4.13.8 <i>ADA 2010</i> 404.2.5 <i>CBC 2010</i> 1133B.2.4.1 <i>CBC 2013</i> 11B-404.2.5 Priority 1 Severity 4 TBD Contract Work</p>	<p>1 JOB \$400 \$400</p>
---	--	---------------------------------




<p>4156</p> <ul style="list-style-type: none"> <i>As-Built Description:</i> Door inaccessible due to threshold or step at door exceeding 1/2". <i>As-Built:</i> 0.75" <i>Proposed Solution:</i> Modify threshold to be no more than 1/2" by removing existing paving at door and providing landing with edge ramping (slope 1:20 max). 	<p><i>PCODE</i> ID02A <i>ADAAG</i> 4.13.8 <i>ADA 2010</i> 404.2.5 <i>CBC 2010</i> 1133B.2.4.1 <i>CBC 2013</i> 11B-404.2.5 Priority 1 Severity 4 TBD Contract Work</p>	<p>1 JOB \$400 \$400</p>
---	--	---------------------------------




Facility: **HISTORICAL SOCIETY**
 Address: 14068 HACKETT ST.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Ramps						
4158	<ul style="list-style-type: none"> <i>As-Built Description:</i> Ramp needed to provide disabled access at steps or change of level along path of travel. <i>As-Built:</i> 12" rise <i>Proposed Solution:</i> Provide new concrete ramp with handrails [slope more than 1:20 (5.0%) needed]. 	PCODE EB01A ADAAG 4.1.1 ADA 2010 303.4 CBC 2010 1127B.1 CBC 2013 11B-303.4 Priority 2 Severity 1 TBD Contract Work	48	SF	\$100	\$4,800
						

Vestibule						
4154	<ul style="list-style-type: none"> <i>As-Built Description:</i> Vestibule length in direction of travel less than width(es) of door(s) swinging into vestibule, plus 48". <i>As-Built:</i> DW + 36" <i>Proposed Solution:</i> At vestibule with standard pairs of doors, remodel area to provide required length. Notes: vestibule 	PCODE IF02A ADAAG 4.13.7 ADA 2010 404.2.6 CBC 2010 1133B.2.4.4 CBC 2013 11B-404.2.6 Priority 1 Severity 2 TBD Contract Work	1	JOB	\$5,000	\$5,000
						

2 Church Office & Exit


Door						
4161	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 5.8% <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 1 Severity 3 TBD Contract Work	30	SF	\$40	\$1,200
						


3 Historical Society Building


Facility: **HISTORICAL SOCIETY**
 Address: 14068 HACKETT ST.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Clearance</u>						
4175	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 29.5" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. <i>Notes:</i> Provide directional sign to Acc exit. to restrooms 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 2 Severity 3 TBD Contract Work	1	JOB	\$2,600	\$2,600
						




<u>Door Threshold</u>						
4168	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door inaccessible due to threshold or step at door exceeding 1/2". <i>As-Built:</i> 1.5" <i>Proposed Solution:</i> Modify threshold to be no more than 1/2" by removing existing paving at door and providing landing with edge ramping (slope 1:20 max). 	PCODE ID02A ADAAG 4.13.8 ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 1 Severity 4 TBD Contract Work	1	JOB	\$400	\$400
						

<u>Public Counter</u>						
4166	<ul style="list-style-type: none"> <i>As-Built Description:</i> Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. <i>As-Built:</i> 40" <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$150	\$150
						

Facility: **HISTORICAL SOCIETY**
 Address: 14068 HACKETT ST.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Sink						
4169	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						
4177	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink is more than 6 1/2" deep. <i>As-Built:</i> 7" <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed. 	PCODE IN06BREF ADAAG 4.24.4 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.7 Priority 3 Severity 4 TBD Contract Work				REF
						
4170	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink rim higher than 34" above floor. <i>As-Built:</i> 36" <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work				REF
						


4 Men's Restroom


Facility: **HISTORICAL SOCIETY**
 Address: 14068 HACKETT ST.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Threshold</u>						
4182	<ul style="list-style-type: none"> As-Built Description: Door inaccessible due to threshold or step at door exceeding 1/2". As-Built: 2" Proposed Solution: Modify threshold to be no more than 1/2" by removing existing paving at door and providing landing with edge ramping (slope 1:20 max). 	PCODE ID02A ADAAG 4.13.8 ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$400	\$400
						


<u>Lavatory</u>						
4185	<ul style="list-style-type: none"> As-Built Description: Knee clearance 27" min. high starting 8" back from the front edge of the lavatory towards the wall is not provided. As-Built: 23.5" Proposed Solution: Remount compliant fixture to accessible height. 	PCODE WD04A ADAAG Fig. 31 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-306.3.3 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
						


<u>Toilet Stall</u>						
4188	<ul style="list-style-type: none"> As-Built Description: Toilet stall less than 60" wide. As-Built: 59.5" Proposed Solution: Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). Notes: Repair partition 	PCODE WB06NT ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$150	\$150
						


Facility: **HISTORICAL SOCIETY**
 Address: 14068 HACKETT ST.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Urinal						
4187	<ul style="list-style-type: none"> <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor. <i>As-Built:</i> 24" <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. <i>Notes:</i> Flush 45.5" 	PCODE WE02 ADAAG 4.18.2 ADA 2010 605.2 CBC 2010 1115B.4.2.1 CBC 2013 11B-605.2 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$2,400	\$2,400
						

Water Closet						
4193	<ul style="list-style-type: none"> <i>As-Built Description:</i> Water closet not 17"-18" from near side wall to center line of water closet (2010 ADAS: 16"-18"). <i>As-Built:</i> 18.5" o.c. <i>Proposed Solution:</i> Relocate existing water closet and plumbing, remount with offset closet flange to provide 17"-18" from side wall. 	PCODE WB02C ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$500	\$500
						


4189	<ul style="list-style-type: none"> <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall. <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type, or install sensor flush. 	PCODE WB10 ADAAG 4.16.5 ADA 2010 604.6 CBC 2010 1115B.4.1.5 CBC 2013 11B-604.6 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
						


5 Women's Restroom


Facility: **HISTORICAL SOCIETY**
 Address: 14068 HACKETT ST.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Threshold</u>						
4197	<ul style="list-style-type: none"> <i>As-Built Description:</i> Existing threshold at door is 1/2" high or less but without a beveled edge on both sides. <i>As-Built:</i> 2" <i>Proposed Solution:</i> Modify threshold to have beveled edge on each side. 	PCODE ID02 ADAAG 4.1.6(3)(d)(ii) ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$250	\$250
						

<u>Lavatory</u>						
4201	<ul style="list-style-type: none"> <i>As-Built Description:</i> Wheelchair clearance under lavatory apron or lavatory counter front edge less than 29" high. <i>As-Built:</i> 27.5" <i>Proposed Solution:</i> Remount compliant fixture to accessible height. 	PCODE WD03A ADAAG 4.19.2 ADA 2010 606.3 CBC 2010 1115B.4.3.3 CBC 2013 11B-306.3.1 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

<u>Water Closet</u>						
4206	<ul style="list-style-type: none"> <i>As-Built Description:</i> Water closet not 17"-18" from near side wall to center line of water closet (2010 ADAS: 16"-18"). <i>As-Built:</i> 19" o.c. <i>Proposed Solution:</i> Relocate existing water closet and plumbing, remount with offset closet flange to provide 17"-18" from side wall. 	PCODE WB02C ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$500	\$500
						

Facility: **HISTORICAL SOCIETY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 14068 HACKETT ST.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Wheelchair Clearance

4199	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Clear passage width (except doorways) from rest room entry to accessible water closet compartment less than 36" (CA only: 44" wide). • <i>As-Built:</i> 36" wide to lavatory • <i>Proposed Solution:</i> Modify facility passage to be min. 44" wide. Demolish existing partition and replace. 	<p>PCODE WC02A ADAAG 4.3.3 ADA 2010 403.5.1 CBC 2010 1115B.3.2.4 CBC 2013 11B-403.5.1 Priority 3 Severity 2 TBD Contract Work</p>	5	LF	\$170	\$850
------	---	--	---	----	-------	-------



Total Costs for	Part/floor: Interior	Ground Floor					\$28,250.00
------------------------	-----------------------------	---------------------	--	--	--	--	--------------------

Facility: **HISTORICAL SOCIETY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 14068 HACKETT ST.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$28,250.00

Facility: **HISTORICAL SOCIETY**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 14068 HACKETT ST.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: HISTORICAL SOCIETY					\$83,003.00
------------------------	-------------------------------------	--	--	--	--	--------------------

Facility: **GOVERNMENT CENTER CAMPUS**
 Address: 1400 W. LACEY BLVD.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 Ramp & Stairs at NE Serving Engineering Building #6

Slope

- 488
- *As-Built Description:*
Slope greater than 1:12 (8.3%).
 - *As-Built:* 6.1-9.3%
 - *Proposed Solution:*
Demolish existing and provide new ramp with handrails.

PCODE **EB02**
 ADAAG **4.8.2**
 ADA 2010 **405.2**
 CBC 2010 **1133B.5.3**
 CBC 2013 **11B-405.2**
 Priority **1**
 Severity **4**
 TBD Contract Work

560 SF \$100 **\$56,000**



4 Ramp at NE Serving Finance Building #7

Slope

- 507
- *As-Built Description:*
Slope greater than 1:12 (8.3%).
 - *As-Built:* 6.1-9.2%
 - *Proposed Solution:*
Demolish existing and provide new ramp with handrails.

PCODE **EB02**
 ADAAG **4.8.2**
 ADA 2010 **405.2**
 CBC 2010 **1133B.5.3**
 CBC 2013 **11B-405.2**
 Priority **1**
 Severity **4**
 TBD Contract Work

560 SF \$100 **\$56,000**



6 South Site Entry Serving Finance Building #7

Handrails

- 521
- *As-Built Description:*
Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).
 - *Proposed Solution:*
Provide new handrail for each side including extensions.

PCODE **ED01**
 ADAAG **4.8.5 & 4.9.4**
 ADA 2010 **505.2**
 CBC 2010 **1133B.4.1.1 & .5.5**
 CBC 2013 **11B-505.2**
 Priority **4**
 Severity **2**
 TBD Contract Work

16 LF \$95 **\$1,520**



12 Courts Plaza

Facility: **GOVERNMENT CENTER CAMPUS**


Area: **Exterior**

Part/Floor: **On-site**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Handrails						
571	<ul style="list-style-type: none"> <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas). <i>Proposed Solution:</i> Provide new handrail for each side including extensions. 	PCODE ED01 ADAAG 4.8.5 & 4.9.4 ADA 2010 505.2 CBC 2010 1133B.4.1.1 & .5.5 CBC 2013 11B-505.2 Priority 4 Severity 2 TBD Contract Work	12	LF	\$95	\$1,140
						


15 POT West Parking Lot to B Building

Top & Bottom Extension at Stairs

1088	<ul style="list-style-type: none"> <i>As-Built Description:</i> Stair handrail does not extend horizontally 12" minimum beyond top nosing, and one tread width sloped, plus 12" minimum horizontally beyond the bottom nosing. <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for each extension piece). 	PCODE ED06 ADAAG 4.9.4(2) ADA 2010 505.10.2; 505.10.3 CBC 2010 1133B.4.2.2 CBC 2013 11B-505.10.2; 11B-505.10.3 Priority 4 Severity 2 TBD Contract Work	4	JOB	\$170	\$680
						

18 POT from Building #6 to Victim Witness Building

Height

1709	<ul style="list-style-type: none"> <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. <i>As-Built:</i> 32" <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02 ADAAG 4.9.4(5) ADA 2010 505.4 CBC 2010 1133B.4.2.1 & CBC 2013 11B-505.4 Priority 4 Severity 4 TBD Contract Work	18	LF	\$75	\$1,350
						

Facility: **GOVERNMENT CENTER CAMPUS**
 Address: 1400 W. LACEY BLVD.


Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Top & Bottom Extension at Stairs

1704	<ul style="list-style-type: none"> <i>As-Built Description:</i> Stair handrail does not extend horizontally 12" minimum beyond top nosing, and one tread width sloped, plus 12" minimum horizontally beyond the bottom nosing. <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for each extension piece). 	PCODE ED06	4	JOB	\$170	\$680
		ADAAG 4.9.4(2)				
		ADA 2010 505.10.2; 505.10.3				
		CBC 2010 1133B.4.2.2				
		CBC 2013 11B-505.10.2; 11B-505.10.3				
		Priority 4				
		Severity 2				

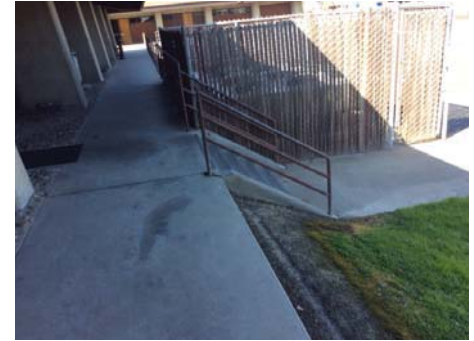


1707	<ul style="list-style-type: none"> <i>As-Built Description:</i> Stair handrail does not extend horizontally 12" minimum beyond top nosing, and one tread width sloped, plus 12" minimum horizontally beyond the bottom nosing. <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for each extension piece). 	PCODE ED06REF				
		ADAAG 4.9.4(2)				
		ADA 2010 505.10.2; 505.10.3				
		CBC 2010 1133B.4.2.2				
		CBC 2013 11B-505.10.2; 11B-505.10.3				
		Priority 4				
		Severity 2				



19 POT from Probation to Law Building

Height

2587	<ul style="list-style-type: none"> <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. <i>As-Built:</i> 33" <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02	20	LF	\$75	\$1,500
		ADAAG 4.9.4(5)				
		ADA 2010 505.4				
		CBC 2010 1133B.4.2.1 &				
		CBC 2013 11B-505.4				
		Priority 4				
		Severity 4				

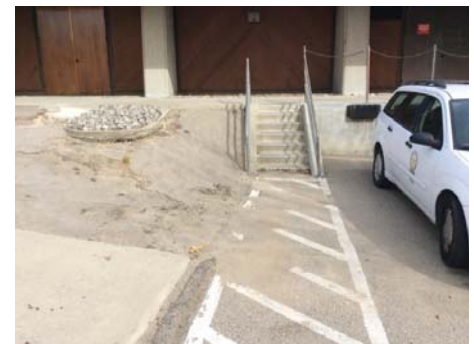

Facility: **GOVERNMENT CENTER CAMPUS**
 Address: 1400 W. LACEY BLVD.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Top & Bottom Extension at Stairs

- 2588
- *As-Built Description:*
 Stair handrail does not extend horizontally 12" minimum beyond top nosing, and one tread width sloped, plus 12" minimum horizontally beyond the bottom nosing.
 - *Proposed Solution:*
 Extend stair handrail at top and bottom (cost for each extension piece).

PCODE ED06REF
 ADAAG 4.9.4(2)
 ADA 2010 505.10.2; 505.10.3
 CBC 2010 1133B.4.2.2
 CBC 2013 11B-505.10.2; 11B-505.10.3
 Priority 4
 Severity 2
 TBD Contract Work

REF



Total Costs for	Part/floor: Exterior	On-site	\$118,870.00
------------------------	-----------------------------	----------------	---------------------

Facility: **GOVERNMENT CENTER CAMPUS**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$118,870.00

Facility: **GOVERNMENT CENTER CAMPUS**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: GOVERNMENT CENTER CAMPUS					\$118,870.00
------------------------	---	--	--	--	--	---------------------

Facility: **ANIMAL CONTROL**
 Address: 10909 BONNEYVIEW DR.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Accessible Parking

Accessible Route

- 2841
- As-Built Description:**
No walk / sidewalk provided to connect accessible facilities or elements that are on the same site.
 - Proposed Solution:**
Provide new 48" wide walk / sidewalk.
 - Notes:**
No sidewalk to location, shoulder only.

PCODE **EF13REF**
 ADAAG **4.3.2**
 ADA 2010 **206.1**
 CBC 2010 **1114B.1.2**
 CBC 2013 **11B-206.1**
 Priority **1**
 Severity **1**
TBD Contract Work

REF



Changes in Level

- 2840
- As-Built Description:**
Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route.
 - As-Built:** 1"
 - Proposed Solution:**
Remove, replace or repair area of pavement sufficient to correct abrupt change in level.
 - Notes:**
Extend concrete to 18'

PCODE **EF03**
 ADAAG **4.3.8**
 ADA 2010 **403.4**
 CBC 2010 **1133B.7.4**
 CBC 2013 **11B-403.4**
 Priority **1**
 Severity **4**
TBD Contract Work

36 SF \$21 \$756



Total Costs for	Part/floor: Exterior	On-site	\$756.00
------------------------	-----------------------------	----------------	-----------------

Facility: **ANIMAL CONTROL**

Area: **Exterior**

Part/Floor: **On-site**

Address: 10909 BONNEYVIEW DR.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$756.00

Facility: **ANIMAL CONTROL**
 Address: 10909 BONNEYVIEW DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Entrance & Lobby

Door

2849	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 4.6% <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 1 Severity 3 TBD Contract Work	30	SF	\$40	\$1,200
------	--	---	----	----	------	---------



Door Clearance

2847	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 27" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 1 Severity 2 TBD Contract Work	1	JOB	\$2,600	\$2,600
------	---	---	---	-----	---------	---------



Door Threshold




2843	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door inaccessible due to threshold or step at door exceeding 1/2". <i>As-Built:</i> 1" <i>Proposed Solution:</i> Modify threshold to be no more than 1/2" by removing existing paving at door and providing landing with edge ramping (slope 1:20 max). 	PCODE ID02A ADAAG 4.13.8 ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 1 Severity 4 TBD Contract Work	1	JOB	\$400	\$400
------	--	--	---	-----	-------	-------



Facility: **ANIMAL CONTROL**
 Address: 10909 BONNEYVIEW DR.

Area: **Interior**
 Year to be Completed: **TBD**


Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Drinking Fountain</u>						
2850	<ul style="list-style-type: none"> <i>As-Built Description:</i> Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping. <i>Proposed Solution:</i> Provide additional fountain or hi-lo combination fountain. 	PCODE IA01A ADAAG 4.1.3(10)(a) ADA 2010 211.1 CBC 2010 1115B.4.6.1 CBC 2013 11B-211.1 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$2,000	\$2,000
						
2851	<ul style="list-style-type: none"> <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain). Unit in good condition. <i>As-Built:</i> 25.25" <i>Proposed Solution:</i> Remount fountain at accessible height. 	PCODE IA02A ADAAG 4.15.5(1) ADA 2010 602.2 CBC 2010 1115B.4.6.2 CBC 2013 11B-602.2 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$1,200	\$1,200
						
2852	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	PCODE IA04 CBC 2010 1115B.4.6.3; Fig. CBC 2013 11B-602.9 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$3,000	\$3,000
						


Facility: **ANIMAL CONTROL**
 Address: 10909 BONNEYVIEW DR.

Area: **Interior**
 Year to be Completed: **TBD**


Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Public Counter						
2844	<ul style="list-style-type: none"> <i>As-Built Description:</i> Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. <i>As-Built:</i> 45" <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$150	\$150
						

2 Staff Office Area

Door Clearance						
2869	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 27" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$2,600	\$2,600
						


3 Public Restroom


Door Clearance							
2861	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 27" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01REF ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 3 Severity 2 TBD Contract Work	REF				
							

Facility: **ANIMAL CONTROL**
 Address: 10909 BONNEYVIEW DR.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Restroom</u>						
2860	<ul style="list-style-type: none"> <i>As-Built Description:</i> Single accommodation restroom not accessible; multiple compliance violations. <i>Proposed Solution:</i> Remodel area to provide single-occupant accessible restroom. 	PCODE WA01 ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.2 CBC 2013 11B-603 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$30,000	\$30,000
						

<u>Turning Space</u>							
2862	<ul style="list-style-type: none"> <i>As-Built Description:</i> Wheelchair clearance: Clear space, floor to 27" high with a diameter of 60", not provided (space 56" x 63" acceptable). <i>As-Built:</i> 47.5" <i>Proposed Solution:</i> Provide wheelchair clearance space in restroom. 	PCODE WC01REF ADAAG 4.22.3 ADA 2010 603.2.1 CBC 2010 1115B.3.2 CBC 2013 11B-603.2.1; 11B-304.3 Priority 3 Severity 2 TBD Contract Work	REF				

4 Staff Restroom

<u>Door Clearance</u>							
2865	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 27.5" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01REF ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 4 Severity 2 TBD Contract Work	REF				

Facility: **ANIMAL CONTROL**
 Address: 10909 BONNEYVIEW DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Restroom

2866 • *As-Built Description:*
 Single accommodation restroom not accessible; multiple compliance violations.

• *Proposed Solution:*
 Remodel area to provide single-occupant accessible restroom.

PCODE **WA01**
 ADAAG **4.22**
 ADA 2010 **603**
 CBC 2010 **1115B.3.2**
 CBC 2013 **11B-603**
 Priority **4**
 Severity **2**
TBD Contract Work



1 JOB \$30,000 **\$30,000**


Turning Space

2867 • *As-Built Description:*
 Wheelchair clearance: Clear space, floor to 27" high with a diameter of 60", not provided (space 56" x 63" acceptable).

• *As-Built:* 43"

• *Proposed Solution:*
 Provide wheelchair clearance space in restroom.

PCODE **WC01**
 ADAAG **4.22.3**
 ADA 2010 **603.2.1**
 CBC 2010 **1115B.3.1**
 CBC 2013 **11B-603.2.1; 11B-304.3**
 Priority **4**
 Severity **2**
TBD Contract Work

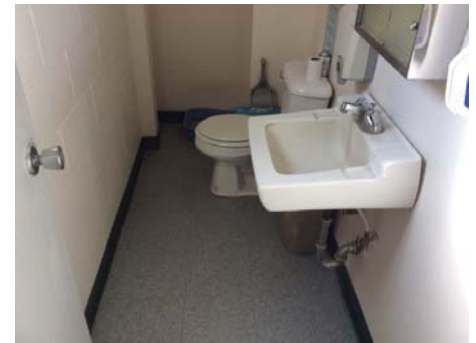

1 JOB \$1,190 **\$1,190**

5 Intake Room

Sink

2871 • *As-Built Description:*
 Sink does not have knee space min. 27" high x 19" deep x 30" wide.

• *Proposed Solution:*
 Remodel sink cabinet.

PCODE **IN06A**
 ADAAG **4.24.3**
 ADA 2010 **606.2**
 CBC 2010 **1115B.4.7.1**
 CBC 2013 **11B-606.2**
 Priority **2**
 Severity **2**
TBD Contract Work



1 JOB \$1,750 **\$1,750**

Facility: **ANIMAL CONTROL**
 Address: 10909 BONNEYVIEW DR.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2873	<ul style="list-style-type: none"> As-Built Description: Sink is more than 6 1/2" deep. As-Built: 12" deep Proposed Solution: Provide new sink remodel and cabinet as needed. 	PCODE IN06BREF ADAAG 4.24.4 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.7 Priority 3 Severity 2 TBD Contract Work				
						REF
						
2872	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 36.5" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work				
						REF
						

6 Main Walkway

Cross Slope

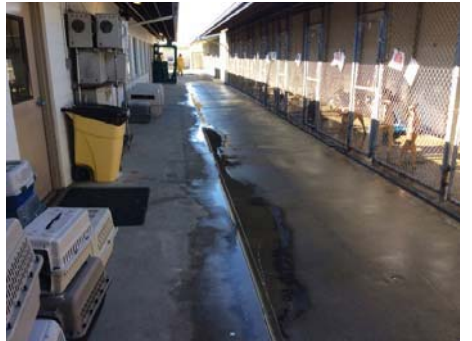
2878	<ul style="list-style-type: none"> As-Built Description: Cross slope more than 1":48" (2.083%). As-Built: 2.9-9.5% Proposed Solution: Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 2 TBD Contract Work	400	SF	\$25	\$10,000
						


7 Bite Ward

Facility: **ANIMAL CONTROL**
 Address: 10909 BONNEYVIEW DR.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door						
2882	<ul style="list-style-type: none"> As-Built Description: Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). As-Built: 8.3% Proposed Solution: Modify surface slope at door. Notes: Staff Only 	PCODE ID11REF ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 4 Severity 2 TBD Contract Work				
						REF
						

2879	<ul style="list-style-type: none"> As-Built Description: Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). As-Built: 4.3% Proposed Solution: Modify surface slope at door. Notes: Staff Only 	PCODE ID11REF ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 4 Severity 3 TBD Contract Work				
						REF
						

8 Cattery


Door						
2883	<ul style="list-style-type: none"> As-Built Description: Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). As-Built: 5.9% Proposed Solution: Modify surface slope at door. 	PCODE ID11REF ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 3 TBD Contract Work				
						REF
						


9 Lost & Found Cats


Facility: **ANIMAL CONTROL**
 Address: 10909 BONNEYVIEW DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door						
2884	<ul style="list-style-type: none"> As-Built Description: Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). As-Built: 5.8% Proposed Solution: Modify surface slope at door. 	PCODE ID11REF ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 3 TBD Contract Work				
						REF
						

Sink						
2891	<ul style="list-style-type: none"> As-Built Description: Sink does not have knee space min. 27" high x 19" deep x 30" wide. Proposed Solution: Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

2892	<ul style="list-style-type: none"> As-Built Description: Sink faucet controls not accessible. Proposed Solution: Provide accessible sink faucet controls. 	PCODE IN07 ADAAG 4.24.7 ADA 2010 606.4 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.4 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$600	\$600
						

10 Staff Only Holding Room

Facility: **ANIMAL CONTROL**
 Address: 10909 BONNEYVIEW DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Door

2894

- *As-Built Description:*
 Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%).
- *As-Built:* 7.2%
- *Proposed Solution:*
 Modify surface slope at door.

PCODE ID11REF
 ADAAG 4.13.6
 ADA 2010 404.2.4.4
 CBC 2010 1133B.2.4
 CBC 2013 11B-404.2.4
 Priority 2
 Severity 2
 TBD Contract Work

REF



11 Main Kennels

Cross Slope

2898

- *As-Built Description:*
 Cross slope more than 1":48" (2.083%).
- *As-Built:* 2.3-5.0%
- *Proposed Solution:*
 Modify cross slope.

PCODE EF07
 ADAAG 4.3.7
 ADA 2010 403.3
 CBC 2010 1133B.7.1.3
 CBC 2013 11B-403.3
 Priority 1
 Severity 3
 TBD Contract Work

400 SF \$25 \$10,000



2896

- *As-Built Description:*
 Cross slope more than 1":48" (2.083%).
- *As-Built:* 2.2-4.2% along kennels
- *Proposed Solution:*
 Modify cross slope.
- **Notes:**
Photo not available


PCODE EF07
 ADAAG 4.3.7
 ADA 2010 403.3
 CBC 2010 1133B.7.1.3
 CBC 2013 11B-403.3
 Priority 2
 Severity 3
 TBD Contract Work


340 SF \$25 \$8,500

Facility: **ANIMAL CONTROL**
 Address: 10909 BONNEYVIEW DR.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door Swing						
2905	<ul style="list-style-type: none"> As-Built Description: Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". As-Built: 13" to drainage Proposed Solution: Provide grating along drainage extending 60" back. Notes: Provide grating extending 60" back. 	PCODE ID23BNT ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 4 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

Sink						
2909	<ul style="list-style-type: none"> As-Built Description: Sink does not have knee space min. 27" high x 19" deep x 30" wide. Proposed Solution: Remodel sink cabinet. Notes: Staff Only 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						


12 Play Area

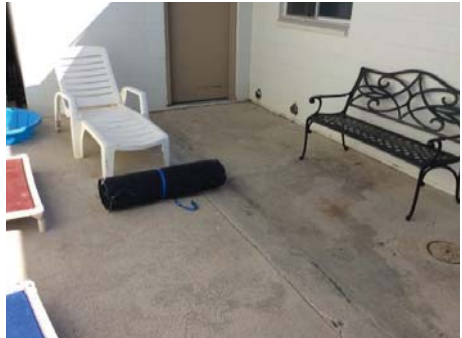
Cross Slope						
2901	<ul style="list-style-type: none"> As-Built Description: Cross slope more than 1":48" (2.083%). As-Built: 13.5% Proposed Solution: Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 2 Severity 1 TBD Contract Work	100	SF	\$25	\$2,500
						

Facility: **ANIMAL CONTROL**
 Address: 10909 BONNEYVIEW DR.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door						
2902	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 13.8% <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11REF ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 1 TBD Contract Work				
						REF
						

Door Threshold						
2903	<ul style="list-style-type: none"> <i>As-Built Description:</i> Existing threshold at door is 1/2" high or less but without a beveled edge on both sides. <i>As-Built:</i> 1.5" <i>Proposed Solution:</i> Modify threshold to have beveled edge on each side. Notes: No door hardware 	PCODE ID02 ADAAG 4.1.6(3)(d)(ii) ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 2 Severity 4 TBD Contract Work	1	JOB	\$250	\$250
						

13 Puppy Ward

Door Swing						
2904	<ul style="list-style-type: none"> <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60"). <i>As-Built:</i> 47.5" <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed. Notes: Staff Only 	PCODE ID27B ADAAG Fig. 25(c) ADA 2010 404.2.4 CBC 2010 11B-26A(c) CBC 2013 11B-404.2.4 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$2,600	\$2,600
						

Total Costs for Part/floor: Interior Ground Floor \$115,640.00

Facility: **ANIMAL CONTROL**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 10909 BONNEYVIEW DR.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$115,640.00

Facility: **ANIMAL CONTROL**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 10909 BONNEYVIEW DR.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: ANIMAL CONTROL					\$116,396.00
------------------------	---------------------------------	--	--	--	--	---------------------

Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Exterior**
 Year to be Completed: **TBD**


Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Accessible Parking

Changes in Level

3705	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route. <i>As-Built:</i> 0.75" <i>Proposed Solution:</i> Remove, replace or repair area of pavement sufficient to correct abrupt change in level. 	PCODE EF03 ADAAG 4.3.8 ADA 2010 403.4 CBC 2010 1133B.7.4 CBC 2013 11B-403.4 Priority 1 Severity 4 TBD Contract Work	17	SF	\$21	\$357
------	--	--	----	----	------	--------------

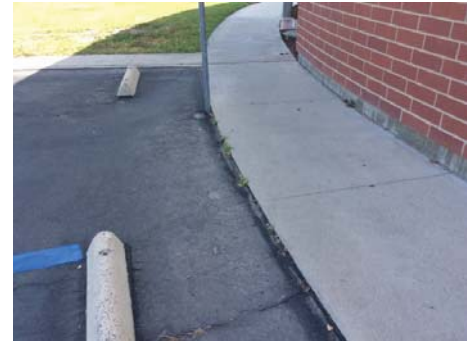

Parking

3701	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space does not have 5' wide access aisle; 8' wide for van accessible aisle. <i>Proposed Solution:</i> Modify parking aisle(s) to create accessible space by restriping. 	PCODE EA02B ADAAG 4.6.3 ADA 2010 502.3 CBC 2010 1129B.3.1 CBC 2013 11B-502.2; 11B-502.3.1 Priority 1 Severity 1 TBD Contract Work	1	JOB	\$200	\$200
------	--	--	---	-----	-------	--------------



3 POT from Bus Stop to Entrance

Changes in Level

3708	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route. <i>As-Built:</i> 3" <i>Proposed Solution:</i> Remove, replace or repair area of pavement sufficient to correct abrupt change in level. 	PCODE EF03 ADAAG 4.3.8 ADA 2010 403.4 CBC 2010 1133B.7.4 CBC 2013 11B-403.4 Priority 1 Severity 1 TBD Contract Work	70	SF	\$21	\$1,470
------	---	--	----	----	------	----------------



4 Staff Entrance - Breakroom

Facility: **SUPERINTENDENT OF SCHOOLS**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1144 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Curb Ramp

3709	<ul style="list-style-type: none"> As-Built Description: Slope greater than 1:12 (8.3%). As-Built: 9.4% Proposed Solution: Demolish existing and provide new curb ramp. 	PCODE EH02A ADAAG 4.7.2 ADA 2010 406.1 CBC 2010 1127B.5.3 CBC 2013 11B-406.2.1 Priority 1 Severity 4 TBD Contract Work	1	JOB	\$2,500	\$2,500
------	--	---	---	-----	---------	---------



Door Swing


3711	<ul style="list-style-type: none"> As-Built Description: Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18"(CA only: 24" at exterior doors)x 60". As-Built: 2" x 47" not level. Proposed Solution: Provide and extend level maneuvering space. 	PCODE ID23D ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$800	\$800
------	---	---	---	-----	-------	-------



5 Conference Room Door

Curb Ramp

3712	<ul style="list-style-type: none"> As-Built Description: Slope greater than 1:12 (8.3%). As-Built: 13.1% Proposed Solution: Demolish existing and provide new curb ramp. 	PCODE EH02A ADAAG 4.7.2 ADA 2010 406.1 CBC 2010 1127B.5.3 CBC 2013 11B-406.2.1 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$2,500	\$2,500
------	---	---	---	-----	---------	---------

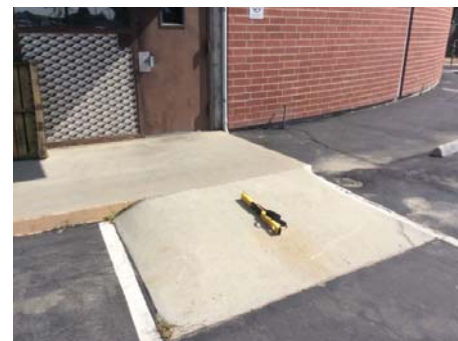

Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3714	<ul style="list-style-type: none"> <i>As-Built Description:</i> Curb ramp: Side slopes more than 1:10 (10%). <i>As-Built:</i> 25-30% <i>Proposed Solution:</i> Modify curb ramp. Demolish side slopes and replace with 1:10 side slopes if 48" level top landing is provided. 	PCODE EH05AREF ADAAG 4.7.5 ADA 2010 406.3 CBC 2010 1127B.5.3 CBC 2013 11B-406.2.2 Priority 1 Severity 1 TBD Contract Work				



6 Office Exit to Lacey Blvd

Cross Slope

3716	<ul style="list-style-type: none"> <i>As-Built Description:</i> Cross slope more than 1":48" (2.083%). <i>As-Built:</i> 2.8% <i>Proposed Solution:</i> Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 2 Severity 4 TBD Contract Work	20	SF	\$25	\$500
3717	<ul style="list-style-type: none"> <i>As-Built Description:</i> Cross slope more than 1":48" (2.083%). <i>As-Built:</i> 3.5% <i>Proposed Solution:</i> Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 2 Severity 4 TBD Contract Work	60	SF	\$25	\$1,500

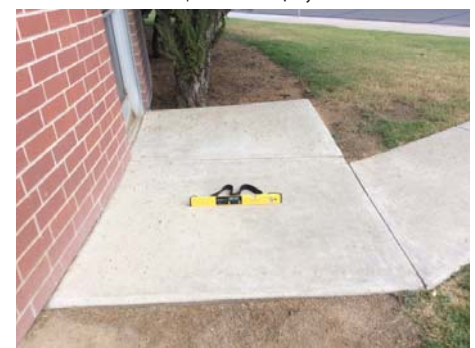

Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Door

3718 • *As-Built Description:*
 Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%).
 • *As-Built:* 2.3%
 • *Proposed Solution:*
 Modify surface slope at door.

PCODE **ID11REF**
 ADAAG **4.13.6**
 ADA 2010 **404.2.4.4**
 CBC 2010 **1133B.2.4**
 CBC 2013 **11B-404.2.4**
 Priority **2**
 Severity **4**
TBD Contract Work

REF



Walk

3715 • *As-Built Description:*
 Walk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps.
 • *As-Built:* 6.9-8.1%
 • *Proposed Solution:*
 Modify walk/sidewalk slope to 1:20 or less.

PCODE **EF01**
 ADAAG **4.3.7**
 ADA 2010 **403.3**
 CBC 2010 **1133B.7.3**
 CBC 2013 **11B-403.3**
 Priority **2**
 Severity **4**
TBD Contract Work

40 SF \$25 \$1,000



Total Costs for	Part/floor: Exterior	On-site	\$10,827.00
------------------------	-----------------------------	----------------	--------------------

Facility: **SUPERINTENDENT OF SCHOOLS**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1144 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$10,827.00

Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Main Entrance & Lobby

Corridor

3628	<ul style="list-style-type: none"> <i>As-Built Description:</i> Corridor less than 36" wide. <i>As-Built:</i> 32" <i>Proposed Solution:</i> Enlarge corridor to 36" wide; relocate stud wall. 	PCODE IH03 ADAAG 4.3.3 ADA 2010 403.5.1 CBC 2010 1133B.3.1 CBC 2013 11B-403.5.1 Priority 1 Severity 2 TBD Contract Work	4	LF	\$140	\$560
------	--	---	---	----	-------	-------



Door Clearance

3596	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> Offices: 28.75" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 1 Severity 3 TBD Contract Work	2	JOB	\$2,600	\$5,200
------	---	--	---	-----	---------	---------



Door Swing

3585	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18"(CA only: 24" at exterior doors)x 60". <i>As-Built:</i> 18" <i>Proposed Solution:</i> Extend maneuvering space. 	PCODE ID23D ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 1 Severity 4 TBD Contract Work	1	JOB	\$800	\$800
------	--	--	---	-----	-------	-------



Facility: **SUPERINTENDENT OF SCHOOLS**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1144 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Non-Fixed Desk

- 3589
- *As-Built Description:*
Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided.
 - *As-Built:* Due to table legs
 - *Proposed Solution:*
Provide table or desk with accessible dimensions when purchasing new furniture.

PCODE **IN02A**
 ADAAG **4.32.3 & .4**
 ADA 2010 **306.1**
 CBC 2010 **1122B.3 & 4**
 CBC 2013 **11B-306.1 & 11B-902.3**
 Priority **1**
 Severity **2**
 TBD **Contract Work**

1 JOB \$1,600 **\$1,600**



Public Counter

- 3588
- *As-Built Description:*
Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.
 - *As-Built:* 42"
 - *Proposed Solution:*
Provide auxiliary shelf, clipboard, or table as equivalent facilitation.

PCODE **IN03**
 ADAAG **7.2(2)**
 ADA 2010 **904.4**
 CBC 2010 **1122B.4**
 CBC 2013 **11B-904.4**
 Priority **1**
 Severity **3**
 TBD **Contract Work**

1 JOB \$150 **\$150**



2 Human Resources

Door

- 3605
- *As-Built Description:*
Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%).
 - *As-Built:* 2.4%
 - *Proposed Solution:*
Modify surface slope at door.

PCODE **ID11**
 ADAAG **4.13.6**
 ADA 2010 **404.2.4.4**
 CBC 2010 **1133B.2.4**
 CBC 2013 **11B-404.2.4**
 Priority **1**
 Severity **4**
 TBD **Contract Work**




30 SF \$40 **\$1,200**



Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door Clearance						
3603	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 27" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$2,600	\$2,600
						
3610	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 27" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$2,600	\$2,600
						
3612	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> Live scan: 28" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$2,600	\$2,600
						

Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3607	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> Door does not open all the way due to tree <i>Proposed Solution:</i> Remove tree. 	PCODE ID01NT ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 1 Severity 4 TBD Contract Work	1	JOB	\$2,600	\$2,600



Public Counter

3599	<ul style="list-style-type: none"> <i>As-Built Description:</i> Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. <i>As-Built:</i> 43.25" <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$150	\$150
------	---	---	---	-----	-------	-------



3 Restroom Corridor & Credentials

Door Clearance




3615	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 27" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01REF ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 3 Severity 2 TBD Contract Work	REF			
------	---	--	-----	--	--	--



Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Restroom</u>						
3614	<ul style="list-style-type: none"> <i>As-Built Description:</i> Single accommodation restroom not accessible; multiple compliance violations. <i>Proposed Solution:</i> Remodel area to provide single-occupant accessible restroom. 	PCODE WA01 ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.2 CBC 2013 11B-603 Priority 3 Severity 2 TBD Contract Work	2	JOB	\$30,000	\$60,000
						
3617	<ul style="list-style-type: none"> <i>As-Built Description:</i> Single accommodation restroom not accessible; multiple compliance violations. <i>As-Built:</i> Women's <i>Proposed Solution:</i> Remodel area to provide single-occupant accessible restroom. 	PCODE WA01REF ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.2 CBC 2013 11B-603 Priority 3 Severity 2 TBD Contract Work				
			REF 			
<u>Water Closet</u>						
3616	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: In single-accommodation restroom less than 48" in front of water closet provided. <i>As-Built:</i> 34" <i>Proposed Solution:</i> Remodel restroom to provide at least 48" in front of water closet. 	PCODE WB03AREF CBC 2010 1115B.3.2.1 CBC 2013 11B-604.3.1 Priority 3 Severity 2 TBD Contract Work				
			REF 			

4 Conference Room


Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Assistive Listening</u>						
3622	<ul style="list-style-type: none"> <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	PCODE GI01E ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work				
						REF
						

6 Large Conference Room

<u>Assistive Listening</u>						
3638	<ul style="list-style-type: none"> <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	PCODE GI01E ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work				
						REF
						

<u>Sink</u>						
3640	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3639	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 37" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work				



8 Unisex Staff RR

Door Clearance

3649	<ul style="list-style-type: none"> As-Built Description: Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. As-Built: 27" Proposed Solution: Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 3 Severity 2 TBD Contract Work				
------	--	---	--	--	--	--



Lavatory


3657	<ul style="list-style-type: none"> As-Built Description: Wheelchair clearance under lavatory apron or lavatory counter front edge less than 29" high. As-Built: 26.75" Proposed Solution: Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD03 ADAAG 4.19.2 ADA 2010 606.3 CBC 2010 1115B.4.3.3 CBC 2013 11B-606.3 Priority 3 Severity 3 TBD Contract Work				
------	---	---	--	--	--	--





Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Toilet Stall</u>						
3659	<ul style="list-style-type: none"> • <i>As-Built Description:</i> The lavatory or other unintended fixture, encroaches on the necessary clearance around a water closet (60" x 56"). • <i>As-Built:</i> 47.5" from wall 21" from side • <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet. 	PCODE WB01A ADA 2010 604.3.1; 604.3.2 CBC 2013 11B-604.3.1; 11B-604.3.2 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$2,000	\$2,000
						

<u>Water Closet</u>						
3664	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Water closet not 17"-18" from near side wall to center line of water closet (2010 ADAS: 16"-18"). • <i>As-Built:</i> 19" o.c. at front • <i>Proposed Solution:</i> Relocate existing water closet and plumbing, remount with offset closet flange to provide 17"-18" from side wall. 	PCODE WB02C ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$500	\$500
						

3662	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor. • <i>As-Built:</i> 16.5" AFF • <i>Proposed Solution:</i> Provide new accessible water closet. 	PCODE WB08 ADAAG 4.16.3 ADA 2010 604.4 CBC 2010 1115B.4.1.4 CBC 2013 11B-604.4 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$1,400	\$1,400
						

Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3658	<ul style="list-style-type: none"> <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall. <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type, or install sensor flush. 	PCODE WB10 ADAAG 4.16.5 ADA 2010 604.6 CBC 2010 1115B.4.1.5 CBC 2013 11B-604.6 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$500	\$500



9 Women's Staff RR

Door Clearance

3668	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 27" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01REF ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 3 Severity 2 TBD Contract Work	2	REF		
------	---	--	---	-----	--	--



Grab Bars


3670	<ul style="list-style-type: none"> <i>As-Built Description:</i> Grab bars not provided or are not code compliant. <i>Proposed Solution:</i> Provide accessible grab bars. 	PCODE WB07REF ADAAG 4.17.6 ADA 2010 604.5 CBC 2010 1115B.4.1.3 CBC 2013 11B-604.5 Priority 3 Severity 3 TBD Contract Work		REF		
------	---	--	--	-----	--	--




Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Restroom</u>						
3667	<ul style="list-style-type: none"> <i>As-Built Description:</i> Single accommodation restroom not accessible; multiple compliance violations. <i>Proposed Solution:</i> Remodel area to provide single-occupant accessible restroom. <i>Notes:</i> Demolish door frames and provide compliant restroom. 	PCODE WA01 ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.2 CBC 2013 11B-603 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$30,000	\$30,000
						

<u>Water Closet</u>						
3671	<ul style="list-style-type: none"> <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor. <i>As-Built:</i> 16.5" <i>Proposed Solution:</i> Provide new accessible water closet. 	PCODE WB08 ADAAG 4.16.3 ADA 2010 604.4 CBC 2010 1115B.4.1.4 CBC 2013 11B-604.4 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$1,400	\$1,400
						

10 Break Room

<u>Door</u>						
3691	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 8.2% at 49" from door <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 4 Severity 2 TBD Contract Work	64	SF	\$40	\$2,560
						

Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Door Clearance

3682	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 27" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$2,600	\$2,600
------	---	---	---	-----	---------	---------




3673	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 29" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$2,600	\$2,600
------	---	---	---	-----	---------	---------



Door Threshold


3692	<ul style="list-style-type: none"> <i>As-Built Description:</i> Existing threshold at door is 1/2" high or less but without a beveled edge on both sides. <i>As-Built:</i> 0.5" <i>Proposed Solution:</i> Modify threshold to have beveled edge on each side. 	PCODE ID02REF ADAAG 4.1.6(3)(d)(ii) ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 4 Severity 4 TBD Contract Work	REF			
------	--	---	-----	--	--	--



Facility: **SUPERINTENDENT OF SCHOOLS**
 Address: 1144 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Sink						
3677	<ul style="list-style-type: none"> As-Built Description: Sink does not have knee space min. 27" high x 19" deep x 30" wide. Proposed Solution: Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						
3676	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 36.5" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work		REF		
						

Total Costs for Part/floor: Interior Ground Floor \$133,120.00

Facility: **SUPERINTENDENT OF SCHOOLS**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1144 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$133,120.00

Facility: **SUPERINTENDENT OF SCHOOLS**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1144 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: SUPERINTENDENT OF SCHOOLS					\$143,947.00
------------------------	--	--	--	--	--	---------------------

Facility: **JOB TRAINING OFFICE**
 Address: 124 N. IRWIN ST.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Job Center Entrance & Lobby

Door

3807	<ul style="list-style-type: none"> As-Built Description: Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). As-Built: 2.3-5.2% starting at 48" from door. Public sidewalk Proposed Solution: Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 1 Severity 3 TBD Contract Work	30	SF	\$40	\$1,200
------	---	---	----	----	------	---------



Door Clearance

3808	<ul style="list-style-type: none"> As-Built Description: Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. As-Built: Difficult to open 90 degrees Proposed Solution: Provide new, larger door and frame with new accessible hardware. Notes: change inside door sign to "push" 	PCODE ID01REF ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 1 Severity 4 TBD Contract Work	REF			
------	---	--	-----	--	--	--



Drinking Fountain

3812	<ul style="list-style-type: none"> As-Built Description: Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain). Unit in good condition. As-Built: 26.5" high knee space Proposed Solution: Remount fountain at accessible height. 	PCODE IA02A ADAAG 4.15.5(1) ADA 2010 602.2 CBC 2010 1115B.4.6.2 CBC 2013 11B-602.2 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$1,200	\$1,200
------	---	---	---	-----	---------	---------



Facility: **JOB TRAINING OFFICE**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3827	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain water flow less than 4" high; unit in good condition. • <i>As-Built:</i> 1" • <i>Proposed Solution:</i> Adjust water flow. 	<p>PCODE IA03D ADAAG 4.15.3 ADA 2010 602.6 CBC 2010 1115B.4.6.5 CBC 2013 11B-602.6 Priority 3 Severity 3 TBD Contract Work</p>	1	JOB	\$75	\$75



Public Counter

3810	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. • <i>As-Built:</i> 42" • <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	<p>PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 3 TBD Contract Work</p>	1	JOB	\$150	\$150
------	--	---	---	-----	-------	-------



3811	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Public Counter (Seated Service): Accessible section not provided (knee space min. 27" high x 19" deep x 30" wide, top 28" to 34" high, min. 36" counter wide). • <i>As-Built:</i> Testing: 12" deep • <i>Proposed Solution:</i> Retrofit existing counter to provide accessible seating section. Interim solution: Provide auxiliary counter or table. • <i>Notes:</i> Tables on other side are accessible. 	<p>PCODE IN03A ADAAG 4.32.3 & 4 ADA 2010 306.3; 904.4 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.3; 11B-904.4 Priority 1 Severity 2 TBD Contract Work</p>	1	JOB	\$1,200	\$1,200
------	---	--	---	-----	---------	---------



2 Lobby Restroom - Women's

Facility: **JOB TRAINING OFFICE**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 124 N. IRWIN ST.


Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Lavatory</u>						
3815	<ul style="list-style-type: none"> As-Built Description: Knee clearance 27" min. high starting 8" back from the front edge of the lavatory towards the wall is not provided. As-Built: 26" Proposed Solution: Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD04 ADAAG Fig. 31 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-306.3.3 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$3,400	\$3,400
						

3 Lobby Restroom - Men's

<u>Lavatory</u>						
3821	<ul style="list-style-type: none"> As-Built Description: Knee clearance 27" min. high starting 8" back from the front edge of the lavatory towards the wall is not provided. As-Built: 26" Proposed Solution: Remount compliant fixture to accessible height. 	PCODE WD04A ADAAG Fig. 31 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-306.3.3 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

<u>Water Closet</u>						
3825	<ul style="list-style-type: none"> As-Built Description: Flush Control: Operating handle not mounted toward wide side of stall. Proposed Solution: Replace flush control with properly mounted accessible type, or install sensor flush. 	PCODE WB10 ADAAG 4.16.5 ADA 2010 604.6 CBC 2010 1115B.4.1.5 CBC 2013 11B-604.6 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
						

6 JTO Staff Area

Facility: **JOB TRAINING OFFICE**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 124 N. IRWIN ST.

Year to be Completed: **TBD**


Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door Swing						
3832	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". <i>As-Built:</i> 17.5" <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed. 	PCODE ID23BNT ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 4 TBD Contract Work	1	JOB	\$2,600	\$2,600
						

7 Youth Offices

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door						
3833	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 10.5% <i>Proposed Solution:</i> Modify surface slope at door. <i>Notes:</i> Build up floor in corridors and provide 5% max slope in direction of travel. avoid creating x slopes along circulation path. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 1 TBD Contract Work	90	SF	\$40	\$3,600
						

8 Staff Entrance on 7th st.

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door						
3836	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 3.6% <i>Proposed Solution:</i> Modify surface slope at door. <i>Notes:</i> Provide door opener. 	PCODE ID11REF ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 1 Severity 4 TBD Contract Work	REF			
						

Facility: **JOB TRAINING OFFICE**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.


Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Vestibule</u>						
3846	<ul style="list-style-type: none"> <i>As-Built Description:</i> Vestibule length in direction of travel less than width(es) of door(s) swinging into vestibule, plus 48". <i>As-Built:</i> 40" <i>Proposed Solution:</i> At vestibule with standard pairs of doors, remodel area to provide required length. <i>Notes:</i> Remove double doors or lock open. 	PCODE IF02A ADAAG 4.13.7 ADA 2010 404.2.6 CBC 2010 1133B.2.4.4 CBC 2013 11B-404.2.6 Priority 1 Severity 2 TBD Contract Work	1	JOB	\$5,000	\$5,000
						

<u>Walk</u>						
3837	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps. <i>As-Built:</i> 5.3-6.2% <i>Proposed Solution:</i> Modify walk/sidewalk slope to 1:20 or less. <i>Notes:</i> Modify area to provide 5% max slope along with compliant landing at conference door. Remove inside double doors at entrance. Use right side for sloped walk. 	PCODE EF01 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.3 CBC 2013 11B-403.3 Priority 1 Severity 4 TBD Contract Work	60	SF	\$25	\$1,500
						

9 Conference Room

<u>Assistive Listening</u>						
3845	<ul style="list-style-type: none"> <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	PCODE GI01EREF ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work	REF			
						

Facility: **JOB TRAINING OFFICE**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Door


3842	<ul style="list-style-type: none"> As-Built Description: Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). As-Built: 13.6% Proposed Solution: Modify surface slope at door. Notes: Ramp needed: Interim solution, provide directional signage and identify street entrance as Acc. entrance with ISA. 	<p>PCODE ID11REF ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 1 TBD Contract Work</p>				
------	--	--	--	--	--	--



10 Staff Break Room


Clear Width

3847	<ul style="list-style-type: none"> As-Built Description: Concrete ramp: Width (between handrails) less than 36" min. (CA only: 48" min.) As-Built: 40" at top Proposed Solution: Modify ramp width to minimum 48" wide. Notes: Verify if structural column 	<p>PCODE EB10 ADAAG 4.8.3 ADA 2010 405.5 CBC 2010 1133B.5.2 CBC 2013 11B-405.5 Priority 4 Severity 4 TBD Contract Work</p>	1	LF	\$75	\$75
------	---	--	---	----	------	------

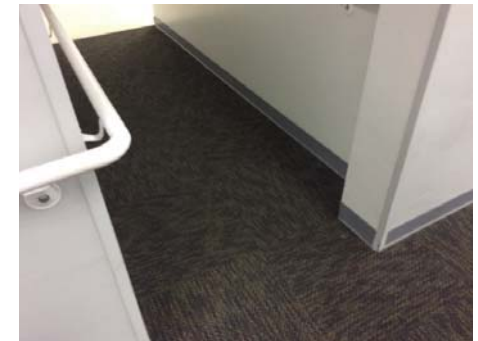

Non-Fixed Desk

3853	<ul style="list-style-type: none"> As-Built Description: Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. As-Built: 26.75" high at sides. 6" deep at ends. Proposed Solution: Provide table or desk with accessible dimensions when purchasing new furniture. 	<p>PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 4 Severity 2 TBD Contract Work</p>	1	JOB	\$1,600	\$1,600
------	---	---	---	-----	---------	---------

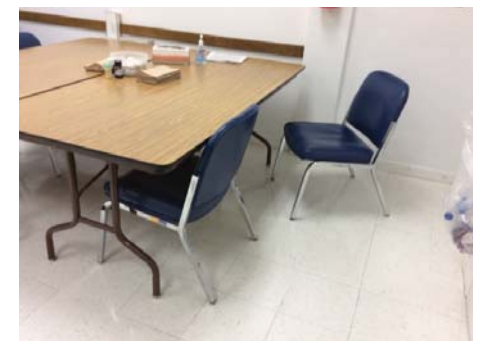

Facility: **JOB TRAINING OFFICE**
 Address: 124 N. IRWIN ST.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Operable Part

- 3851
- *As-Built Description:*
Operable part(s) require tight grasping, pinching, or twisting of the wrist with one hand.
 - *Proposed Solution:*
Modify or replace the operable part(s) to not require tight grasping, pinching, or twisting of the wrist with one hand.

PCODE **IC02REF**
 ADAAG **4.27.4**
 ADA 2010 **309.4**
 CBC 2010 **1117B.6.4**
 CBC 2013 **11B-309.4**
 Priority **4**
 Severity **3**
TBD Contract Work

REF



Sink

- 3852
- *As-Built Description:*
Sink does not have knee space min. 27" high x 19" deep x 30" wide.
 - *As-Built:* Storage items
 - *Proposed Solution:*
Remodel sink cabinet.
 - **Notes:**
Staff Only. if requested as reasonable accommodation. disposal 8" deep at 14" high to bottom.

PCODE **IN06AREF**
 ADAAG **4.24.3**
 ADA 2010 **606.2**
 CBC 2010 **1115B.4.7.1**
 CBC 2013 **11B-606.2**
 Priority **4**
 Severity **2**
TBD Contract Work

REF



Top and Bottom Extension at Ramps

- 3848
- *As-Built Description:*
Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp.
 - *Proposed Solution:*
Provide ramp handrail extension (cost for each extension piece).
 - **Notes:**
Modify slope to under 5%.

PCODE **ED05REF**
 ADAAG **4.8.5(2)**
 ADA 2010 **505.10.1**
 CBC 2010 **1133B.4.2.2 &**
 CBC 2013 **11B-505.10.1**
 Priority **4**
 Severity **4**
TBD Contract Work


REF



Facility: **JOB TRAINING OFFICE**
 Address: 124 N. IRWIN ST.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Walk						
3849	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps. <i>As-Built:</i> Upper portion: 5.5% <i>Proposed Solution:</i> Modify walk/sidewalk slope to 1:20 or less. <i>Notes:</i> Lower: 4.5% 	PCODE EF01 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.3 CBC 2013 11B-403.3 Priority 4 Severity 4 TBD Contract Work	20	SF	\$25	\$500
						

11 Staff Restroom JTO - Women's

Lavatory

3859	<ul style="list-style-type: none"> <i>As-Built Description:</i> Knee clearance 27" min. high starting 8" back from the front edge of the lavatory towards the wall is not provided. <i>As-Built:</i> 24" <i>Proposed Solution:</i> Remount compliant fixture to accessible height. 	PCODE WD04AREF ADAAG Fig. 31 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-306.3.3 Priority 4 Severity 2 TBD Contract Work	REF			
						

Restroom

3860	<ul style="list-style-type: none"> <i>As-Built Description:</i> Multiple accommodation restroom not accessible; multiple compliance violations. <i>Proposed Solution:</i> Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens). <i>Notes:</i> Provide directional sign as interim solution. 	PCODE WA01AREF ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.1 CBC 2013 11B-603 Priority 4 Severity 1 TBD Contract Work	REF			
						

Facility: **JOB TRAINING OFFICE**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Toilet Stall

- 3857
- *As-Built Description:*
Toilet stall less than 60" wide.
 - *As-Built:* 37"
 - *Proposed Solution:*
Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).

PCODE **WB06REF**
 ADAAG **4.17.3**
 ADA 2010 **604.8.1.1**
 CBC 2010 **1115B.3.1.4.1**
 CBC 2013 **11B-604.8.1.1**
 Priority **4**
 Severity **2**
 TBD **Contract Work**

REF



12 Staff Restroom JTO - Men's

Lavatory

- 3866
- *As-Built Description:*
Knee clearance 27" min. high starting 8" back from the front edge of the lavatory towards the wall is not provided.
 - *As-Built:* 24.75"
 - *Proposed Solution:*
Provide new accessible lavatory. Remodel restroom as needed.

PCODE **WD04REF**
 ADAAG **Fig. 31**
 ADA 2010 **606.3**
 CBC 2010 **1115B.4.3**
 CBC 2013 **11B-306.3.3**
 Priority **4**
 Severity **2**
 TBD **Contract Work**

REF



Restroom

- 3861
- *As-Built Description:*
Multiple accommodation restroom not accessible; multiple compliance violations.
 - *Proposed Solution:*
Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens).
 - *Notes:*
Provide directional sign as interim solution.

PCODE **WA01AREF**
 ADAAG **4.22**
 ADA 2010 **603**
 CBC 2010 **1115B.3.1**
 CBC 2013 **11B-603**
 Priority **4**
 Severity **1**
 TBD **Contract Work**

REF



Facility: **JOB TRAINING OFFICE**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.


Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Toilet Stall</u>						
3865	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet stall less than 60" wide. • <i>As-Built:</i> 37.5" • <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	<p>PCODE WB06REF ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 4 Severity 2 TBD Contract Work</p>				
						REF
						

<u>Urinal</u>						
3864	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor. • <i>As-Built:</i> 20" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	<p>PCODE WE02REF ADAAG 4.18.2 ADA 2010 605.2 CBC 2010 1115B.4.2.1 CBC 2013 11B-605.2 Priority 4 Severity 3 TBD Contract Work</p>				
						REF
						

13 Copy Area

<u>Non-Fixed Desk</u>						
3868	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Recommended only: Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. • <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. • <i>Notes:</i> Staff Only 	<p>PCODE IN02AREF ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 4 Severity 2 TBD Contract Work</p>				
						REF
						

Total Costs for Part/floor: Interior Ground Floor \$24,100.00

Facility: **JOB TRAINING OFFICE**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$24,100.00

Facility: **JOB TRAINING OFFICE**

Area: **Interior-EDC**

Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

14 EDC Entrance

Door

3870	<ul style="list-style-type: none"> As-Built Description: Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). As-Built: 3.9% Proposed Solution: Modify surface slope at door. 	<p>PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 1 Severity 4 TBD Contract Work</p>	40	SF	\$40	\$1,600
------	--	--	----	----	------	---------



Public Counter

3875	<ul style="list-style-type: none"> As-Built Description: Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. Proposed Solution: Relocate chairs to encroach into clear space of accessible counter. 	<p>PCODE IN03REF ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 4 TBD Contract Work</p>				
------	---	---	--	--	--	--



15 EDC Conference Room

Non-Fixed Desk

3877	<ul style="list-style-type: none"> As-Built Description: Recommended only: Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. As-Built: End is 12" deep. No clearance at sides Proposed Solution: Provide table or desk with accessible dimensions when purchasing new furniture. Notes: Relocate chairs and slide table over to allow side access when needed. 	<p>PCODE IN02AREF ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 TBD Contract Work</p>				
------	--	---	--	--	--	--



16 EDC Restroom Corridor

Facility: **JOB TRAINING OFFICE**


Area: **Interior-EDC**

Part/Floor: **Ground Floor**


Address: 124 N. IRWIN ST.


Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door						
3879	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 2.6% <i>Proposed Solution:</i> Modify surface slope at door. <i>Notes:</i> Feather out landing at door 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 3 Severity 4 TBD Contract Work	25	SF	\$40	\$1,000
						

18 EDC Men's Restroom

Door Clearance						
3885	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 30" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01REF ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 3 Severity 3 TBD Contract Work	REF			

Restroom						
3883	<ul style="list-style-type: none"> <i>As-Built Description:</i> Multiple accommodation restroom not accessible; multiple compliance violations. <i>Proposed Solution:</i> Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens). <i>Notes:</i> Interim solution provide directional sign to Acc. JToO RRs 	PCODE WA01A ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.1 CBC 2013 11B-603 Priority 3 Severity 1 TBD Contract Work	1	JOB	\$35,000	\$35,000
						

Facility: **JOB TRAINING OFFICE**

Area: **Interior-EDC**

Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Turning Space

- 3884
- *As-Built Description:*
Wheelchair clearance: Clear space, floor to 27" high with a diameter of 60", not provided (space 56" x 63" acceptable).
 - *Proposed Solution:*
Provide wheelchair clearance space in restroom.

PCODE WC01REF
 ADAAG 4.22.3
 ADA 2010 603.2.1
 CBC 2010 1115B.3.2
 CBC 2013 11B-603.2.1; 11B-304.3
 Priority 3
 Severity 2
 TBD Contract Work

REF




19 EDC Women's Restroom

Door Clearance

- 3887
- *As-Built Description:*
Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open.
 - *As-Built:* 31"
 - *Proposed Solution:*
Provide new, larger door and frame with new accessible hardware.

PCODE ID01REF
 ADAAG 4.13.5
 ADA 2010 404.2.3
 CBC 2010 1133B.1.1.1.1
 CBC 2013 11B-404.2.3
 Priority 3
 Severity 3
 TBD Contract Work

REF

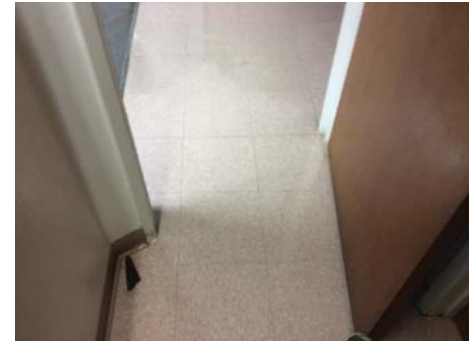

Door Swing

- 3888
- *As-Built Description:*
Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60".
 - *As-Built:* 27" to angled wall
 - *Proposed Solution:*
Provide relocated new door and frame; remodel walls as needed.

PCODE ID23BREF
 ADAAG Fig. 25(a)
 ADA 2010 404.2.4
 CBC 2010 11B-26A(a)
 CBC 2013 11B-404.2.4
 Priority 3
 Severity 2
 TBD Contract Work


REF




Facility: **JOB TRAINING OFFICE**
 Address: 124 N. IRWIN ST.

Area: **Interior-EDC**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Restroom</u>						
3886	<ul style="list-style-type: none"> <i>As-Built Description:</i> Multiple accommodation restroom not accessible; multiple compliance violations. <i>Proposed Solution:</i> Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens). <i>Notes:</i> Interim solution provide directional sign to Acc. JTO RRs 	PCODE WA01A ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.1 CBC 2013 11B-603 Priority 3 Severity 1 TBD Contract Work	1	JOB	\$35,000	\$35,000
						

<u>Turning Space</u>						
3890	<ul style="list-style-type: none"> <i>As-Built Description:</i> Wheelchair clearance: Clear space, floor to 27" high with a diameter of 60", not provided (space 56" x 63" acceptable). <i>As-Built:</i> 36" <i>Proposed Solution:</i> Provide wheelchair clearance space in restroom. 	PCODE WC01REF ADAAG 4.22.3 ADA 2010 603.2.1 CBC 2010 1115B.3.2 CBC 2013 11B-603.2.1; 11B-304.3 Priority 3 Severity 2 TBD Contract Work	REF			
						

Total Costs for	Part/floor: Interior-EDC	Ground Floor	\$72,600.00
------------------------	---------------------------------	---------------------	--------------------

Facility: **JOB TRAINING OFFICE**

Area: **Interior-EDC**

Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior-EDC

\$72,600.00

Facility: **JOB TRAINING OFFICE**

Area: **Interior-EDC**

Part/Floor: **Ground Floor**

Address: 124 N. IRWIN ST.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Facility: JOB TRAINING OFFICE \$96,700.00

Facility: **MENTAL HEALTH**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Van Accessible Space

Floor or Ground Surfaces

3775	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space has slope greater than 1/4":12" (2%). <i>As-Built:</i> 2.7-3.0% along rear portion. <i>Proposed Solution:</i> Modify slope at accessible parking space. 	<p>PCODE EA05</p> <p>ADAAG 4.6.3</p> <p>ADA 2010 502.4</p> <p>CBC 2010 1129B.3.3</p> <p>CBC 2013 11B-502.4</p> <p>Priority 1</p> <p>Severity 4</p> <p>TBD Contract Work</p>	72	SF	\$12	\$864
------	---	---	----	----	------	-------



Parking

3777	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space does not have 5' wide access aisle; 8' wide for van accessible aisle. <i>As-Built:</i> 48" o.c. <i>Proposed Solution:</i> Modify parking aisle(s) to create accessible space by restriping. 	<p>PCODE EA02BNT</p> <p>ADAAG 4.6.3</p> <p>ADA 2010 502.3</p> <p>CBC 2010 1129B.3.1</p> <p>CBC 2013 11B-502.2; 11B-502.3.1</p> <p>Priority 1</p> <p>Severity 4</p> <p>TBD Contract Work</p>	1	JOB	\$200	\$200
------	---	---	---	-----	-------	-------



2 POT from Lot to Main Entrance

Cross Slope

3786	<ul style="list-style-type: none"> <i>As-Built Description:</i> Cross slope more than 1":48" (2.083%). <i>As-Built:</i> 3.8% <i>Proposed Solution:</i> Modify cross slope. 	<p>PCODE EF07</p> <p>ADAAG 4.3.7</p> <p>ADA 2010 403.3</p> <p>CBC 2010 1133B.7.1.3</p> <p>CBC 2013 11B-403.3</p> <p>Priority 1</p> <p>Severity 4</p> <p>TBD Contract Work</p>	128	SF	\$25	\$3,200
------	---	---	-----	----	------	---------



Facility: **MENTAL HEALTH**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1393 BAILEY DR.


Year to be Completed: **TBD**

Priority No: **1**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Cross Slope (PAR)

3780	<ul style="list-style-type: none"> <i>As-Built Description:</i> The cross slope of the pedestrian access route exceeds the maximum required slope (1:48 max). <i>As-Built:</i> PRow 2.4-3.0% <i>Proposed Solution:</i> Modify existing route as necessary to not exceed the required 1:48 (2%) maximum cross slope. 	<p>PCODE PR05A ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 4 TBD Contract Work</p>	50	SF	\$40	\$2,000
------	--	--	----	----	------	---------




3781	<ul style="list-style-type: none"> <i>As-Built Description:</i> The cross slope of the pedestrian access route exceeds the maximum required slope (1:48 max). <i>As-Built:</i> 2.4-2.6% <i>Proposed Solution:</i> Modify existing route as necessary to not exceed the required 1:48 (2%) maximum cross slope. 	<p>PCODE PR05A ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 4 TBD Contract Work</p>	100	SF	\$40	\$4,000
------	---	--	-----	----	------	---------



Curb Ramp

3782	<ul style="list-style-type: none"> <i>As-Built Description:</i> No curb ramp available where an accessible route crosses a curb. <i>As-Built:</i> At loading zone <i>Proposed Solution:</i> Provide new curb ramp. 	<p>PCODE EH01 ADAAG 4.7.1 ADA 2010 303.4 CBC 2010 1127B.5.1 CBC 2013 11B-402.2 Priority 1 Severity 1 TBD Contract Work</p>	1	JOB	\$2,500	\$2,500
------	---	---	---	-----	---------	---------



Facility: **MENTAL HEALTH**


Area: **Exterior**


Part/Floor: **On-site**


Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door</u>						
3787	<ul style="list-style-type: none"> As-Built Description: Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). As-Built: 8.3% Proposed Solution: Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 1 Severity 2 TBD Contract Work	64	SF	\$40	\$2,560
						

<u>Passenger Loading Zone</u>						
3783	<ul style="list-style-type: none"> As-Built Description: Aisle at passenger drop-off, adjacent to the vehicle pull-up space is not 60x 240" and/or slopes more than 1/4":12" (2%). Proposed Solution: Modify passenger drop-off such that slope does not exceed (2%) in any direction, and provide curb ramp between vehicle pull-up space and access aisle, as needed. 	PCODE PS71 ADAAG 4.6.6 ADA 2010 503.3 CBC 2010 1131B.2 CBC 2013 11B-503.3 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$600	\$600
						

<u>Walk</u>						
3785	<ul style="list-style-type: none"> As-Built Description: Walk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps. As-Built: 5.6-6.2% Proposed Solution: Modify walk/sidewalk slope to 1:20 or less. 	PCODE EF01 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.3 CBC 2013 11B-403.3 Priority 1 Severity 4 TBD Contract Work	72	SF	\$25	\$1,800
						

3 Accessible Parking at Staff Entrance

Facility: **MENTAL HEALTH**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Floor or Ground Surfaces

3789	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible parking space has slope greater than 1/4":12" (2%). • <i>As-Built:</i> 3.2% along back • <i>Proposed Solution:</i> Modify slope at accessible parking space. 	<p>PCODE EA05 ADAAG 4.6.3 ADA 2010 502.4 CBC 2010 1129B.3.3 CBC 2013 11B-502.4 Priority 1 Severity 4 TBD Contract Work</p>	68	SF	\$12	\$816
------	--	---	----	----	------	-------



Parking


3788	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible parking space does not have 5' wide access aisle; 8' wide for van accessible aisle. • <i>As-Built:</i> no aisle • <i>Proposed Solution:</i> Modify parking aisle(s) to create accessible space by restriping. 	<p>PCODE EA02B ADAAG 4.6.3 ADA 2010 502.3 CBC 2010 1129B.3.1 CBC 2013 11B-502.2; 11B-502.3.1 Priority 1 Severity 1 TBD Contract Work</p>	1	JOB	\$200	\$200
------	---	---	---	-----	-------	-------



5 Staff Entrance West

Cross Slope

3800	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Cross slope more than 1":48" (2.083%). • <i>As-Built:</i> 2.7-4.0% • <i>Proposed Solution:</i> Modify cross slope. • <i>Notes:</i> Ref the railing items 	<p>PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 3 TBD Contract Work</p>	90	SF	\$25	\$2,250
------	--	---	----	----	------	---------

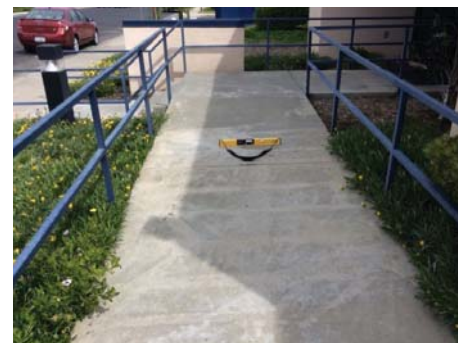

Facility: **MENTAL HEALTH**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Curb or Barrier

3795	<ul style="list-style-type: none"> <i>As-Built Description:</i> No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp. <i>Proposed Solution:</i> Provide 2" minimum curb or wheel guide. 	PCODE EB14 ADAAG 4.8.7 ADA 2010 405.9.2 CBC 2010 1133B.5.6 CBC 2013 11B-405.9.2 Priority 1 Severity 2 TBD Contract Work	46	LF	\$17	\$782
------	--	--	----	----	------	-------



Height

3794	<ul style="list-style-type: none"> <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. <i>As-Built:</i> 30"-33" <i>Proposed Solution:</i> Remove existing and provide new handrail. 	PCODE ED02 ADAAG 4.9.4(5) ADA 2010 505.4 CBC 2010 1133B.4.2.1 & CBC 2013 11B-505.4 Priority 4 Severity 3 TBD Contract Work	12	LF	\$75	\$900
------	--	---	----	----	------	-------



Ramps

3798	<ul style="list-style-type: none"> <i>As-Built Description:</i> Ramp: Pavement dislocation creates abrupt change in level exceeding 1/2" in ramp. <i>As-Built:</i> 0.75" <i>Proposed Solution:</i> Remove, replace or repair area of pavement sufficient to correct abrupt change in level. 	PCODE EB04REF ADAAG 4.5.2 ADA 2010 303.4 CBC 2010 1133B.7.1 CBC 2013 11B-405.4 Priority 1 Severity 4 TBD Contract Work	REF			
------	--	---	-----	--	--	--



Facility: **MENTAL HEALTH**


Area: **Exterior**


Part/Floor: **On-site**

Address: 1393 BAILEY DR.


Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Slope						
3797	<ul style="list-style-type: none"> <i>As-Built Description:</i> Slope greater than 1:12 (8.3%). <i>As-Built:</i> Lower ramp: 8.6-9.5% <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails. 	PCODE EB02 ADAAG 4.8.2 ADA 2010 405.2 CBC 2010 1133B.5.3 CBC 2013 11B-405.2 Priority 1 Severity 4 TBD Contract Work	48	SF	\$100	\$4,800
						

3799	<ul style="list-style-type: none"> <i>As-Built Description:</i> Level 2% max. landing for ramp not provided. <i>As-Built:</i> 3.6% <i>Proposed Solution:</i> Rebuild ramp to provide landings for each ramp run with slopes no greater than 2% 	PCODE EB05A ADAAG 4.8.4 ADA 2010 405.7.1 CBC 2010 1133B.5.4.1 CBC 2013 11B-405.7.1 Priority 1 Severity 4 TBD Contract Work	36	SF	\$100	\$3,600
						

Top and Bottom Extension at Ramps

3796	<ul style="list-style-type: none"> <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. <i>As-Built:</i> 0"-5" <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). Notes: Provide bent ext 	PCODE ED05 ADAAG 4.8.5(2) ADA 2010 505.10.1 CBC 2010 1133B.4.2.2 & CBC 2013 11B-505.10.1 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$170	\$170
						

6 Oak Wellness Entrance

Facility: **MENTAL HEALTH**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Cross Slope

- 3804
- *As-Built Description:*
Cross slope more than 1":48" (2.083%).
 - *As-Built:* 2.7-3.6%
 - *Proposed Solution:*
Modify cross slope.

PCODE EF07
 ADAAG 4.3.7
 ADA 2010 403.3
 CBC 2010 1133B.7.1.3
 CBC 2013 11B-403.3
 Priority 1
 Severity 4
 TBD Contract Work

80 SF \$25 **\$2,000**



Non-Fixed Desk

- 3803
- *As-Built Description:*
Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided.
 - *As-Built:* 25" high knee space
 - *Proposed Solution:*
Provide table or desk with accessible dimensions when purchasing new furniture.

PCODE IN02A
 ADAAG 4.32.3 & .4
 ADA 2010 306.1
 CBC 2010 1122B.3 & 4
 CBC 2013 11B-306.1 & 11B-902.3
 Priority 2
 Severity 2
 TBD Contract Work

1 JOB \$1,600 **\$1,600**



Picnic Area

- 3805
- *As-Built Description:*
Knee clearance at minimums 27" high, 30" wide, and 19" deep is not provided.
 - *As-Built:* 11" deep
 - *Proposed Solution:*
Modify picnic table as required to provide knee clearance.

PCODE NH11A
 ADAAG 16.5.4.
 ADA 2010 902.2
 CBC 2010 1132B.1
 CBC 2013 11-902.2
 Priority 2
 Severity 2
 TBD Contract Work

1 JOB \$850 **\$850**



Facility: **MENTAL HEALTH**


Area: **Exterior**

Part/Floor: **On-site**


Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3806	<ul style="list-style-type: none"> <i>As-Built Description:</i> Knee clearance at minimums 27" high, 30" wide, and 19" deep is not provided. <i>As-Built:</i> 13" deep <i>Proposed Solution:</i> Modify picnic table as required to provide knee clearance. 	<p>PCODE NH11A ADAAG 16.5.4. ADA 2010 902.2 CBC 2010 1132B.1 CBC 2013 11-902.2 Priority 2 Severity 2 TBD Contract Work</p>	1	JOB	\$850	\$850
						

Walk

3801	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps. <i>As-Built:</i> 8.7-9.4% <i>Proposed Solution:</i> Provide ramp with handrails on both (2) sides. Notes: And landings 	<p>PCODE EF01A ADAAG 4.8.1 ADA 2010 405.1 CBC 2010 1133B.7.3 CBC 2013 11B-405.1 Priority 1 Severity 3 TBD Contract Work</p>	30	LF	\$260	\$7,800
						

Total Costs for	Part/floor: Exterior	On-site	\$44,342.00
------------------------	-----------------------------	----------------	--------------------

Facility: **MENTAL HEALTH**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$44,342.00

Facility: **MENTAL HEALTH**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Oak Wellness Center

Door Swing

3729

As-Built Description:

Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18"(CA only: 24" at exterior doors)x 60".


• **As-Built:** 46"

Proposed Solution:

Change door swing and expand clear floor space to DW + 24".

PCODE **ID23D**
 ADAAG **Fig. 25(a)**
 ADA 2010 **404.2.4**
 CBC 2010 **11B-26A(a)**
 CBC 2013 **11B-404.2.4**
 Priority **1**
 Severity **3**
TBD Contract Work

1 JOB \$800 \$800

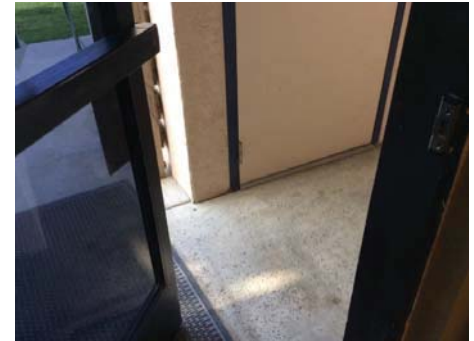

Non-Fixed Desk

3730

As-Built Description:

Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided.

• **As-Built:** 13" deep

Proposed Solution:

Provide table or desk with accessible dimensions when purchasing new furniture.

PCODE **IN02A**
 ADAAG **4.32.3 & .4**
 ADA 2010 **306.1**
 CBC 2010 **1122B.3 & 4**
 CBC 2013 **11B-306.1 & 11B-902.3**
 Priority **2**
 Severity **2**
TBD Contract Work

1 JOB \$1,600 \$1,600



Ovens

3737

As-Built Description:

Oven controls are not on front panel of oven.

Proposed Solution:

Provide oven with accessible controls.

PCODE **KF22**
 ADAAG **13.3.4(7)**
 ADA 2010 **804.6.5.3**
 CBC 2010 **1111B.5.1**
 CBC 2013 **11B-804.6.5.3**
 Priority **3**
 Severity **3**
TBD Contract Work

1 JOB \$800 \$800



Facility: **MENTAL HEALTH**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Public Counter						
3723	<ul style="list-style-type: none"> <i>As-Built Description:</i> Public Counter (Seated Service): Accessible section not provided (knee space min. 27" high x 19" deep x 30" wide, top 28" to 34" high, min. 36" counter wide). <i>As-Built:</i> Sign in sheet. 6.5" deep, 30" high <i>Proposed Solution:</i> Retrofit existing counter to provide accessible seating section. Interim solution: Provide auxiliary counter or table. 	PCODE IN03A ADAAG 4.32.3 & 4 ADA 2010 306.3; 904.4 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.3; 11B-904.4 Priority 1 Severity 2 TBD Contract Work	1	JOB	\$1,200	\$1,200
						

Sink						
3732	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

3735	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

Facility: **MENTAL HEALTH**



Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1393 BAILEY DR.


Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3731	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 36" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work				
						REF
						
3734	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 36" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work				
						REF
						

3 Oak Wellness Corridors

Door Pair

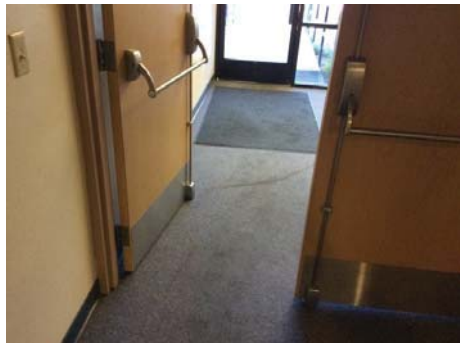3743	<ul style="list-style-type: none"> As-Built Description: Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. As-Built: 31.5" Proposed Solution: Provide new door leaves, unequal in width, to existing frame for pair of doors. 	PCODE ID08A ADAAG 4.13.4 ADA 2010 404.2.2 CBC 2010 1133B.2.3.1 CBC 2013 11B-404.2.2 Priority 2 Severity 4 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

4 Women's Restroom - Oak Wellness

Facility: **MENTAL HEALTH**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Lavatory</u>						
3749	<ul style="list-style-type: none"> As-Built Description: Lavatory: Fixture rim or counter height more than 34" above floor. As-Built: 34.25"-34.75" to rim Proposed Solution: Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD02 ADAAG 4.19.2 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$3,400	\$3,400
						

<u>Shower</u>						
3758	<ul style="list-style-type: none"> As-Built Description: Shower less than 60" x 30". As-Built: 42" x 48" Proposed Solution: Enlarge shower to compliant dimensions. Notes: Decommissioned 	PCODE WF02REF ADAAG 4.21.2 ADA 2010 608.2 CBC 2010 1115B.4.4.1 CBC 2013 11B-608.2 Priority 3 Severity 3 TBD Contract Work	REF			

<u>Toilet Stall</u>						
3752	<ul style="list-style-type: none"> As-Built Description: Toilet stall less than 60" wide. As-Built: 57.5" Proposed Solution: Provide new accessible stall. 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

Facility: **MENTAL HEALTH**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1393 BAILEY DR.

Year to be Completed: **TBD**


Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Water Closet</u>						
3755	<ul style="list-style-type: none"> <i>As-Built Description:</i> Water closet not 17"-18" from near side wall to center line of water closet (2010 ADAS: 16"-18"). <i>As-Built:</i> 15" o.c. <i>Proposed Solution:</i> Relocate existing water closet and plumbing, remount with offset closet flange to provide 17"-18" from side wall. 	PCODE WB02C ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
						

3757	<ul style="list-style-type: none"> <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor. (A 3" high seat shall be permitted only in alterations where the existing fixture is less than 15" high.) <i>As-Built:</i> 4" riser seat <i>Proposed Solution:</i> Provide new accessible water closet. <i>Notes:</i> 18.4" height is ok. 	PCODE WB08REF ADAAG 4.16.3 ADA 2010 604.4 CBC 2010 1115B.4.1.4 CBC 2013 11B-604.4 Priority 3 Severity 4 TBD Contract Work		REF		
						

5 Men's Restroom - Oak Wellness


Lavatory


3761	<ul style="list-style-type: none"> <i>As-Built Description:</i> Lavatory: Fixture rim or counter height more than 34" above floor. <i>As-Built:</i> 34"-34.25" to rim <i>Proposed Solution:</i> Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD02 ADAAG 4.19.2 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$3,400	\$3,400
						


Facility: **MENTAL HEALTH**
 Address: 1393 BAILEY DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Shower						
3773	<ul style="list-style-type: none"> As-Built Description: Shower less than 60" x 30". As-Built: 42" x 48" Proposed Solution: Enlarge shower to compliant dimensions. Notes: decommissioned 	PCODE WF02 ADAAG 4.21.2 ADA 2010 608.2 CBC 2010 1115B.4.4.1 CBC 2013 11B-608.2 Priority 3 Severity 1 TBD Contract Work	1	JOB	\$3,300	\$3,300
						

Toilet Stall						
3767	<ul style="list-style-type: none"> As-Built Description: Toilet stall less than 60" wide. As-Built: 55" Proposed Solution: Provide new accessible stall. 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

Water Closet						
3768	<ul style="list-style-type: none"> As-Built Description: Water closet not 17"-18" from near side wall to center line of water closet (2010 ADAS: 16"-18"). As-Built: 18.5" o.c. Proposed Solution: Relocate existing water closet and plumbing, remount with offset closet flange to provide 17"-18" from side wall. Notes: 3" riser 	PCODE WB02C ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$500	\$500
						

Facility: **MENTAL HEALTH**

Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **3**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3766	<ul style="list-style-type: none"> <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall. <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type, or install sensor flush. 	PCODE WB10 ADAAG 4.16.5 ADA 2010 604.6 CBC 2010 1115B.4.1.5 CBC 2013 11B-604.6 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$500	\$500



6 Main Lobby


Drinking Fountain

3898	<ul style="list-style-type: none"> <i>As-Built Description:</i> Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping. <i>Proposed Solution:</i> Provide additional fountain or hi-lo combination fountain. 	PCODE IA01A ADAAG 4.1.3(10)(a) ADA 2010 211.1 CBC 2010 1115B.4.6.1 CBC 2013 11B-211.1 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$2,000	\$2,000
------	--	--	---	-----	---------	---------



Vertical Clearance

3927	<ul style="list-style-type: none"> <i>As-Built Description:</i> Overhead clearance less than 80" above finished floor. <i>As-Built:</i> Fan: 76" <i>Proposed Solution:</i> Modify overhead clearance. 	PCODE EG01 ADAAG 4.4.2 ADA 2010 307.4 CBC 2010 1133B.8.6.2 CBC 2013 11B-307.4 Priority 1 Severity 2 TBD Contract Work	1	JOB	\$60	\$60
------	--	--	---	-----	------	------



7 Main Lobby Men's Restroom

Facility: **MENTAL HEALTH**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Clearance</u>						
3902	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 30.5" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$2,600	\$2,600
						

<u>Door Swing</u>						
3903	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". <i>As-Built:</i> 40.5" to lav <i>Proposed Solution:</i> Remodel as needed. 	PCODE ID23B ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$2,600	\$2,600
						

<u>Lavatory</u>						
3908	<ul style="list-style-type: none"> <i>As-Built Description:</i> Clear floor space, 30" x 48" in front of fixture, extending 19" max. under the lavatory, not provided (CA only: Less than 18" from side wall to centerline of lavatory). <i>As-Built:</i> 16" o.c. <i>Proposed Solution:</i> Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD01 ADAAG 4.19.3 ADA 2010 606.2 CBC 2010 1115B.4.3 CBC 2013 11B-606.2, 11B-606.6 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$3,400	\$3,400
						

Facility: **MENTAL HEALTH**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1393 BAILEY DR.


Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Toilet Stall</u>						
3911	<ul style="list-style-type: none"> <i>As-Built Description:</i> The lavatory or other unintended fixture, encroaches on the necessary clearance around a water closet (60" x 56"). <i>As-Built:</i> 53" to counter <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet. 	<p>PCODE WB01A</p> <p>ADA 2010 604.3.1; 604.3.2</p> <p>CBC 2013 11B-604.3.1; 11B-604.3.2</p> <p>Priority 3</p> <p>Severity 4</p> <p>TBD Contract Work</p>	1	JOB	\$2,000	\$2,000
						

<u>Turning Space</u>						
3904	<ul style="list-style-type: none"> <i>As-Built Description:</i> Wheelchair clearance: Clear space, floor to 27" high with a diameter of 60", not provided (space 56" x 63" acceptable). <i>As-Built:</i> 53"-64" <i>Proposed Solution:</i> Provide wheelchair clearance space in restroom. 	<p>PCODE WC01</p> <p>ADAAG 4.22.3</p> <p>ADA 2010 603.2.1</p> <p>CBC 2010 1115B.3.1</p> <p>CBC 2013 11B-603.2.1; 11B-304.3</p> <p>Priority 3</p> <p>Severity 2</p> <p>TBD Contract Work</p>	1	JOB	\$1,190	\$1,190
						

8 Main Lobby Women's Restroom

<u>Door Clearance</u>						
3916	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 30.5" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	<p>PCODE ID01</p> <p>ADAAG 4.13.5</p> <p>ADA 2010 404.2.3</p> <p>CBC 2010 1133B.1.1.1.1</p> <p>CBC 2013 11B-404.2.3</p> <p>Priority 3</p> <p>Severity 3</p> <p>TBD Contract Work</p>	1	JOB	\$2,600	\$2,600
						

Facility: **MENTAL HEALTH**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1393 BAILEY DR.


Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door Swing						
3915	<ul style="list-style-type: none"> <i>As-Built Description:</i> Hinge approach: At push side, door does not have clear and level maneuvering space measuring 54" width (starting at latch) x 42" deep (48" deep if door has both, latch and closer) (CA only: 54" x 44"). <i>As-Built:</i> 47" <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed. <i>Notes:</i> latch only 	<p>PCODE ID26B</p> <p>ADAAG Fig. 25(b)</p> <p>ADA 2010 404.2.4</p> <p>CBC 2010 Fig. 11B-26A(b)</p> <p>CBC 2013 11B-404.2.4</p> <p>Priority 3</p> <p>Severity 4</p> <p>TBD Contract Work</p>	1	JOB	\$2,600	\$2,600



Toilet Stall						
3918	<ul style="list-style-type: none"> <i>As-Built Description:</i> The lavatory or other unintended fixture, encroaches on the necessary clearance around a water closet (60" x 56"). <i>As-Built:</i> 53.5" <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet. <i>Notes:</i> Room: 77"x87" 	<p>PCODE WB01A</p> <p>ADA 2010 604.3.1; 604.3.2</p> <p>CBC 2013 11B-604.3.1; 11B-604.3.2</p> <p>Priority 3</p> <p>Severity 4</p> <p>TBD Contract Work</p>	1	JOB	\$2,000	\$2,000

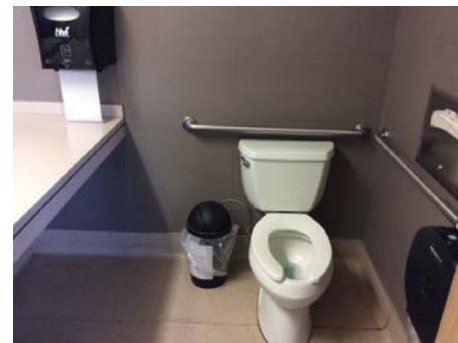

Water Closet						
3922	<ul style="list-style-type: none"> <i>As-Built Description:</i> Water closet not 17"-18" from near side wall to center line of water closet (2010 ADAS: 16"-18"). <i>As-Built:</i> 19.5" o.c. <i>Proposed Solution:</i> Relocate existing water closet and plumbing, remount with offset closet flange to provide 17"-18" from side wall. 	<p>PCODE WB02C</p> <p>ADAAG Fig. 28</p> <p>ADA 2010 604.2</p> <p>CBC 2010 1115B.4.1.1</p> <p>CBC 2013 11B-604.2</p> <p>Priority 3</p> <p>Severity 4</p> <p>TBD Contract Work</p>	1	JOB	\$500	\$500



9 Gaede Meeting Room

Facility: **MENTAL HEALTH**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Assistive Listening

- 3942
- *As-Built Description:*
No portable assistive listening system provided for small meeting room.
 - *Proposed Solution:*
Share existing portable assistive listening system from other facility if needed.

PCODE **GI01E**
 ADAAG **4.1.3(19)(b) & 4.33.7**
 ADA 2010 **219.1 & 706.1**
 CBC 2010 **1104B.2**
 CBC 2013 **11B-219.2**
 Priority **3**
 Severity **3**
 TBD **Contract Work**

REF




Cross Slope

- 3935
- *As-Built Description:*
Cross slope more than 1":48" (2.083%).
 - *As-Built:* 4.3%
 - *Proposed Solution:*
Modify cross slope.

PCODE **EF07REF**
 ADAAG **4.3.7**
 ADA 2010 **403.3**
 CBC 2010 **1133B.7.1.3**
 CBC 2013 **11B-403.3**
 Priority **1**
 Severity **3**
 TBD **Contract Work**

REF

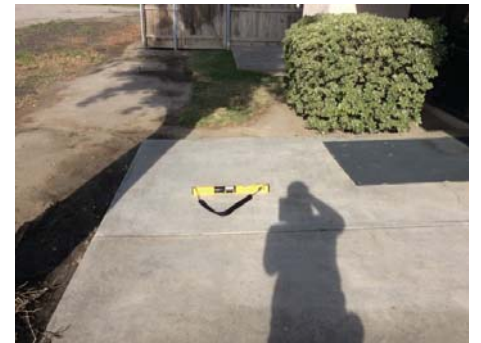

Door

- 3933
- *As-Built Description:*
Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%).
 - *As-Built:* 4.9%
 - *Proposed Solution:*
Modify surface slope at door.

PCODE **ID11**
 ADAAG **4.13.6**
 ADA 2010 **404.2.4.4**
 CBC 2010 **1133B.2.4**
 CBC 2013 **11B-404.2.4**
 Priority **2**
 Severity **3**
 TBD **Contract Work**

72 SF \$40 **\$2,880**



Facility: **MENTAL HEALTH**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Non-Fixed Desk</u>						
3943	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. • <i>As-Built:</i> 41" • <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	<p>PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 TBD Contract Work</p>	1	JOB	\$1,600	\$1,600
						

<u>Sink</u>						
3938	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sink rim higher than 34" above floor. • <i>As-Built:</i> 36" • <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	<p>PCODE IN06 ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work</p>	1	JOB	\$1,750	\$1,750
						

3939	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. • <i>Proposed Solution:</i> Remodel sink cabinet. 	<p>PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 TBD Contract Work</p>	1	JOB	\$1,750	\$1,750
						

10 Group Room

Facility: **MENTAL HEALTH**


Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1393 BAILEY DR.


Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Assistive Listening</u>						
3947	<ul style="list-style-type: none"> <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	PCODE GI01E ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work				
						REF
						


11 Small Group Room - Staff

Non-Fixed Desk

3951	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> 26.5" <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

13 Medium Group Room

Non-Fixed Desk

3960	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> 15" deep <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

14 Medium Group Room

Facility: **MENTAL HEALTH**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1393 BAILEY DR.


Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Assistive Listening</u>						
3963	<ul style="list-style-type: none"> <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	PCODE GI01E ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work				
						REF
						

<u>Non-Fixed Desk</u>						
3965	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> 26.25" <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

15 Medium Group Room

<u>Non-Fixed Desk</u>						
3968	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> 26.75" <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

19 Children's Corridor Men's Restroom

Facility: **MENTAL HEALTH**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Clearance</u>						
3995	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 30.5" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$2,600	\$2,600
						

<u>Door Swing</u>						
3994	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". <i>As-Built:</i> 4" to lav <i>Proposed Solution:</i> Remodel as needed. Notes: Remove urinal. provide new lav. new door and swing door out. 	PCODE ID23B ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$2,600	\$2,600
						

<u>Turning Space</u>						
3996	<ul style="list-style-type: none"> <i>As-Built Description:</i> Wheelchair clearance: Clear space, floor to 27" high with a diameter of 60", not provided (space 56" x 63" acceptable). <i>As-Built:</i> 38"-59" <i>Proposed Solution:</i> Provide wheelchair clearance space in restroom. 	PCODE WC01 ADAAG 4.22.3 ADA 2010 603.2.1 CBC 2010 1115B.3.1 CBC 2013 11B-603.2.1; 11B-304.3 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$1,190	\$1,190
						

Facility: **MENTAL HEALTH**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1393 BAILEY DR.


Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Water Closet</u>						
4001	<ul style="list-style-type: none"> <i>As-Built Description:</i> More than 18" from near side wall to centerline of water closet. <i>As-Built:</i> 21" o.c. <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing. 	PCODE WB02A ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$4,500	\$4,500
						

4000	<ul style="list-style-type: none"> <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall. <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type, or install sensor flush. 	PCODE WB10 ADAAG 4.16.5 ADA 2010 604.6 CBC 2010 1115B.4.1.5 CBC 2013 11B-604.6 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
						

20 Children's Corridor Women's Restroom

<u>Door Clearance</u>						
4007	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 30.5" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$2,600	\$2,600
						

Facility: **MENTAL HEALTH**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **3**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Door Swing

- 4009
- *As-Built Description:*
Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60".
 - *As-Built:* 3" to lav
 - *Proposed Solution:*
Remodel as needed.

PCODE ID23B
 ADAAG Fig. 25(a)
 ADA 2010 404.2.4
 CBC 2010 11B-26A(a)
 CBC 2013 11B-404.2.4
 Priority 3
 Severity 2
 TBD Contract Work

1 JOB \$2,600 \$2,600

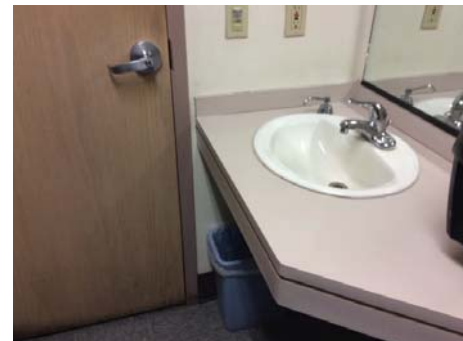

Turning Space

- 4015
- *As-Built Description:*
Wheelchair clearance: Clear space, floor to 27" high with a diameter of 60", not provided (space 56" x 63" acceptable).
 - *As-Built:* 59" wide
 - *Proposed Solution:*
Provide wheelchair clearance space in restroom.

PCODE WC01
 ADAAG 4.22.3
 ADA 2010 603.2.1
 CBC 2010 1115B.3.1
 CBC 2013 11B-603.2.1; 11B-304.3
 Priority 3
 Severity 2
 TBD Contract Work

1 JOB \$1,190 \$1,190




Water Closet

- 4017
- *As-Built Description:*
Water closet not 17"-18" from near side wall to center line of water closet (2010 ADAS: 16"-18").
 - *As-Built:* 19" o.c.
 - *Proposed Solution:*
Relocate existing water closet and plumbing, remount with offset closet flange to provide 17"-18" from side wall.

PCODE WB02C
 ADAAG Fig. 28
 ADA 2010 604.2
 CBC 2010 1115B.4.1.1
 CBC 2013 11B-604.2
 Priority 3
 Severity 4
 TBD Contract Work

1 JOB \$500 \$500

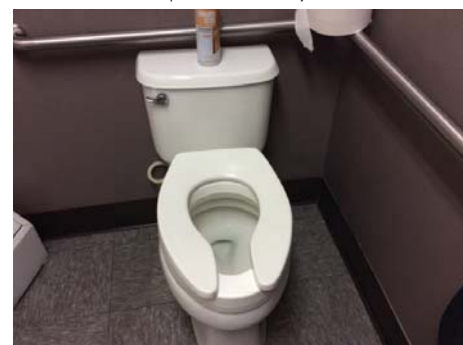

Facility: **MENTAL HEALTH**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
4016	<ul style="list-style-type: none"> As-Built Description: Height of water closet seat less than 17" or more than 19" from floor. As-Built: 21" Proposed Solution: Remove riser seat. 	PCODE WB08 ADAAG 4.16.3 ADA 2010 604.4 CBC 2010 1115B.4.1.4 CBC 2013 11B-604.4 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$80	\$80



21 AOD Offices

Door


4025	<ul style="list-style-type: none"> As-Built Description: Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). As-Built: 4.2% Proposed Solution: Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 1 Severity 3 TBD Contract Work	72	SF	\$40	\$2,880
------	---	---	----	----	------	---------



22 AOD Corridors

Accessible Route

4029	<ul style="list-style-type: none"> As-Built Description: No walk / sidewalk provided to connect accessible facilities or elements that are on the same site. Proposed Solution: Provide new 48" wide walk / sidewalk. 	PCODE EF13 ADAAG 4.3.2 ADA 2010 206.1 CBC 2010 1114B.1.2 CBC 2013 11B-206.1 Priority 1 Severity 1 TBD Contract Work	9	LF	\$45	\$405
------	---	--	---	----	------	-------

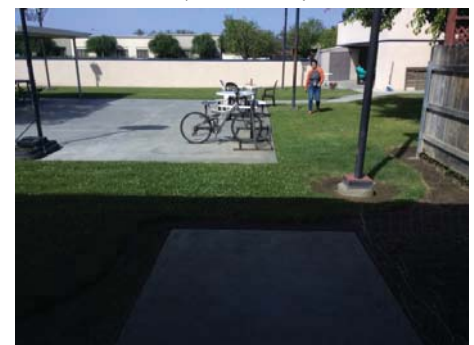

Facility: **MENTAL HEALTH**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1393 BAILEY DR.


Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door Swing						
4031	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18"(CA only: 24" at exterior doors)x 60". <i>As-Built:</i> 18" <i>Proposed Solution:</i> Extend maneuvering space. 	<p>PCODE ID23D ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 3 TBD Contract Work</p>	1	JOB	\$800	\$800
						

23 AOD Corridor Men's Restroom - Staff

Door Clearance						
4034	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 31" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	<p>PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 4 Severity 3 TBD Contract Work</p>	1	JOB	\$2,600	\$2,600
						

Entry Door						
4038	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door swings into the clear 30x48 floor space required for any fixture. <i>As-Built:</i> Stall door swings into urinal clear space <i>Proposed Solution:</i> Modify restroom layout. Notes: Remove stall and provide single occupant restroom 	<p>PCODE WC04 ADAAG 4.22.2 ADA 2010 603.2.3 CBC 2010 1115B.3.1.2 CBC 2013 11B-603.2.3 Priority 4 Severity 2 TBD Contract Work</p>	1	JOB	\$460	\$460
						

Facility: **MENTAL HEALTH**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1393 BAILEY DR.


Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Toilet Stall</u>						
4040	<ul style="list-style-type: none"> <i>As-Built Description:</i> Less than 95" from back wall to front wall of side entry toilet stall when door swings inward, or less than 92" if water closet is wall-hung (CA only: Less than 60" from front of water closet to opposite wall in side entry stall). <i>As-Built:</i> 49" in front of WC. <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture. 	PCODE WB04 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.2 CBC 2013 11B-604.8.1.1 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

<u>Water Closet</u>						
4043	<ul style="list-style-type: none"> <i>As-Built Description:</i> More than 18" from near side wall to center line of water closet. <i>As-Built:</i> 20" o.c. <i>Proposed Solution:</i> Fur out side wall with 60" x 60" panel to provide 17"-18" dimension. Install grab bar and recess toilet paper dispenser and ensure 60" wide clear space is maintained from side wall. 	PCODE WB02BNT ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

24 AOD Corridor Women's Restroom - Staff

<u>Door Clearance</u>						
4048	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 31" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$2,600	\$2,600
						

Facility: **MENTAL HEALTH**


Area: **Interior**

Part/Floor: **Ground Floor**



Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Toilet Stall</u>						
4054	<ul style="list-style-type: none"> As-Built Description: Less than 95" from back wall to front wall of side entry toilet stall when door swings inward, or less than 92" if water closet is wall-hung (CA only: Less than 60" from front of water closet to opposite wall in side entry stall). As-Built: 48" Proposed Solution: Provide new enclosure at existing water closet fixture. Notes: Side out swing 	PCODE WB04 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.2 CBC 2013 11B-604.8.1.1 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

25 Staff Break Room

<u>Non-Fixed Desk</u>						
4068	<ul style="list-style-type: none"> As-Built Description: Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. As-Built: 26" high knee space Proposed Solution: Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						
4070	<ul style="list-style-type: none"> As-Built Description: Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. Proposed Solution: Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

Facility: **MENTAL HEALTH**




Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Sink						
4062	<ul style="list-style-type: none"> As-Built Description: Sink does not have knee space min. 27" high x 19" deep x 30" wide. Proposed Solution: Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						
4063	<ul style="list-style-type: none"> As-Built Description: Sink is more than 6 1/2" deep. As-Built: 7" Proposed Solution: Provide new sink remodel and cabinet as needed. 	PCODE IN06BREF ADAAG 4.24.4 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.7 Priority 4 Severity 4 TBD Contract Work	REF			
						
4061	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 36" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work	REF			
						

27 Break Room Restroom - Staff Women's

Facility: **MENTAL HEALTH**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Toilet Stall</u>						
4085	<ul style="list-style-type: none"> <i>As-Built Description:</i> Less than 95" from back wall to front wall of side entry toilet stall when door swings inward, or less than 92" if water closet is wall-hung (CA only: Less than 60" from front of water closet to opposite wall in side entry stall). <i>As-Built:</i> 49.5" in front. also scale in s stall <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture. 	PCODE WB04 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.2 CBC 2013 11B-604.8.1.1 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$1,500	\$1,500



4086	<ul style="list-style-type: none"> <i>As-Built Description:</i> Toilet stall less than 60" wide. <i>As-Built:</i> 57"-59" <i>Proposed Solution:</i> Provide new accessible stall. 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$1,500	\$1,500
------	--	---	---	-----	---------	----------------



<u>Water Closet</u>						
4087	<ul style="list-style-type: none"> <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall. <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type, or install sensor flush. 	PCODE WB10 ADAAG 4.16.5 ADA 2010 604.6 CBC 2010 1115B.4.1.5 CBC 2013 11B-604.6 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$500	\$500



28 Break Room Restroom - Staff Men's

Facility: **MENTAL HEALTH**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1393 BAILEY DR.

Year to be Completed: **TBD**


Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Toilet Stall</u>						
4099	<ul style="list-style-type: none"> <i>As-Built Description:</i> Less than 95" from back wall to front wall of side entry toilet stall when door swings inward, or less than 92" if water closet is wall-hung (CA only: Less than 60" from front of water closet to opposite wall in side entry stall). <i>As-Built:</i> 49" in front <i>Proposed Solution:</i> Provide new enclosure at existing water closet fixture. 	PCODE WB04 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.2 CBC 2013 11B-604.8.1.1 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

4100	<ul style="list-style-type: none"> <i>As-Built Description:</i> Toilet stall less than 60" wide. <i>As-Built:</i> 58"-59" <i>Proposed Solution:</i> Provide new accessible stall. 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

29 Central Corridor

Door Swing

4112	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18"(CA only: 24" at exterior doors)x 60". <i>As-Built:</i> 13" <i>Proposed Solution:</i> Extend maneuvering space. 	PCODE ID23D ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 4 TBD Contract Work	1	JOB	\$800	\$800
						

31 Play Therapy Room

Facility: **MENTAL HEALTH**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Non-Fixed Desk</u>						
4127	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> due to table legs. <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

<u>Sink</u>						
4125	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

4126	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink rim higher than 34" above floor. <i>As-Built:</i> 36" <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work	REF			
						

Total Costs for Part/floor: Interior Ground Floor \$108,135.00

Facility: **MENTAL HEALTH**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Area: Interior					\$108,135.00
------------------------	-----------------------	--	--	--	--	---------------------

Facility: **MENTAL HEALTH**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1393 BAILEY DR.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Facility: MENTAL HEALTH \$152,477.00

Facility: **ADMINISTRATION BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Main Entrance & Lobby

Drinking Fountain

326	<ul style="list-style-type: none"> <i>As-Built Description:</i> Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping. <i>Proposed Solution:</i> Provide additional fountain or hi-lo combination fountain. 	<p>PCODE IA01A ADAAG 4.1.3(10)(a) ADA 2010 211.1 CBC 2010 1115B.4.6.1 CBC 2013 11B-211.1 Priority 3 Severity 2 TBD Contract Work</p>	1	JOB	\$2,000	\$2,000
						
327	<ul style="list-style-type: none"> <i>As-Built Description:</i> Drinking fountain water flow less than 4" high; unit in good condition. <i>As-Built:</i> 2" <i>Proposed Solution:</i> Adjust water flow. 	<p>PCODE IA03D ADAAG 4.15.3 ADA 2010 602.6 CBC 2010 1115B.4.6.5 CBC 2013 11B-602.6 Priority 3 Severity 3 TBD Contract Work</p>	1	JOB	\$75	\$75
						
325	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	<p>PCODE IA04 CBC 2010 1115B.4.6.3; Fig. CBC 2013 11B-602.9 Priority 3 Severity 2 TBD Contract Work</p>	1	JOB	\$3,000	\$3,000
						

Facility: **ADMINISTRATION BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Telephone						
329	<ul style="list-style-type: none"> <i>As-Built Description:</i> Telephone amplification for hearing impaired persons not provided (push button volume control). <i>Proposed Solution:</i> Provide telephone amplification for hearing impaired persons. To be provided by utility company. 	PCODE IB05 ADAAG 4.31.5 ADA 2010 704.3 CBC 2010 1117B.2.8 CBC 2013 11B-704.3 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$100	\$100
						

TTY						
328	<ul style="list-style-type: none"> <i>As-Built Description:</i> Interior public text telephone (TTY) not provided at type of facility required to have a public text telephone. <i>Proposed Solution:</i> Provide text telephone. 	PCODE IB10 ADAAG 4.1.3(17)(c) ADA 2010 217.4 CBC 2010 1117B.2.9.1 CBC 2013 11B-217.4 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$1,150	\$1,150
						


3 Men's Public Restroom


Door Swing						
373	<ul style="list-style-type: none"> <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60"). <i>As-Built:</i> Stall door: 42.5" <i>Proposed Solution:</i> Remodel restroom as needed. 	PCODE ID27NT ADAAG Fig. 25(c) ADA 2010 404.2.4 CBC 2010 11B-26A(c) CBC 2013 11B-404.2.4 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$500	\$500
						


Facility: **ADMINISTRATION BUILDING**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Toilet Stall</u>						
376	<ul style="list-style-type: none"> As-Built Description: Toilet stall less than 60" wide. As-Built: 38.5" Proposed Solution: Provide new accessible stall. 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

<u>Urinal</u>						
370	<ul style="list-style-type: none"> As-Built Description: Front of rim projects less than 13.5" from wall. As-Built: 12.5" Proposed Solution: Provide accessible urinal. Remodel restroom as needed. 	PCODE WE01 ADA 2010 605.2 CBC 2010 1115B.4.2.1 CBC 2013 11B-605.2 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$4,000	\$4,000
						

371	<ul style="list-style-type: none"> As-Built Description: Fixture mounted with rim more than 17" above floor. As-Built: 25" Proposed Solution: Provide accessible urinal. Remodel restroom as needed. 	PCODE WE02REF ADAAG 4.18.2 ADA 2010 605.2 CBC 2010 1115B.4.2.1 CBC 2013 11B-605.2 Priority 3 Severity 2 TBD Contract Work	REF			
						

Facility: **ADMINISTRATION BUILDING**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
372	<ul style="list-style-type: none"> <i>As-Built Description:</i> 30" x 48" clear floor space in front of accessible urinal not provided. <i>As-Built:</i> Door swing hazard. <i>Proposed Solution:</i> Provide clear floor space in front of accessible urinal. Remodel restroom as needed. 	PCODE WE04 ADAAG 4.18.3 ADA 2010 605.3 CBC 2010 1115B.4.2.3 CBC 2013 11B-605.3 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500



Water Closet

378	<ul style="list-style-type: none"> <i>As-Built Description:</i> Water closet not 17"-18" from near side wall to center line of water closet (2010 ADAS: 16"-18"). <i>As-Built:</i> 18.5" o.c. <i>Proposed Solution:</i> Relocate existing water closet and plumbing, remount with offset closet flange to provide 17"-18" from side wall when remodeling restroom. Notes: Restroom remodel needed. 	PCODE WB02C ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$500	\$500
-----	--	---	---	-----	-------	-------



377	<ul style="list-style-type: none"> <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall. <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type, or install sensor flush when remodeling restroom. 	PCODE WB10 ADAAG 4.16.5 ADA 2010 604.6 CBC 2010 1115B.4.1.5 CBC 2013 11B-604.6 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
-----	---	---	---	-----	-------	-------





4 Women's Public Restroom


Facility: **ADMINISTRATION BUILDING**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door Swing						
390	<ul style="list-style-type: none"> <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60"). <i>As-Built:</i> Stall door: 42.5" <i>Proposed Solution:</i> Remodel restroom as needed. 	PCODE ID27BNT ADAAG Fig. 25(c) ADA 2010 404.2.4 CBC 2010 11B-26A(c) CBC 2013 11B-404.2.4 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

Grab Bars						
395	<ul style="list-style-type: none"> <i>As-Built Description:</i> Grab bars not provided or are not code compliant. <i>Proposed Solution:</i> Provide accessible grab bars. 	PCODE WB07REF ADAAG 4.17.6 ADA 2010 604.5 CBC 2010 1115B.4.1.3 CBC 2013 11B-604.5 Priority 3 Severity 3 TBD Contract Work	REF			
						

Toilet Stall						
394	<ul style="list-style-type: none"> <i>As-Built Description:</i> Toilet stall less than 60" wide. <i>As-Built:</i> 40" <i>Proposed Solution:</i> Provide new accessible stall. 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

Facility: **ADMINISTRATION BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.


Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Turn Space</u>						
382	<ul style="list-style-type: none"> <i>As-Built Description:</i> Less than 60" diameter or T-shaped space provided for wheelchair turns. <i>As-Built:</i> 53" to chair and table <i>Proposed Solution:</i> Retrofit space to provide 60" diameter or T-turn by providing a smaller table. 	<p>PCODE IN04 ADAAG 4.2.3 ADA 2010 304.1 CBC 2010 1118B.3 CBC 2013 11B-304.1 Priority 3 Severity 2 TBD Contract Work</p>	1	JOB	\$925	\$925
						

8 Admin & Board of Supervisor Offices

<u>Door Swing</u>						
481	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18"(CA only: 24" at exterior doors)x 60". <i>As-Built:</i> Exterior: DW + 7" <i>Proposed Solution:</i> Extend maneuvering space. Notes: Staff Only 	<p>PCODE ID23D ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 4 Severity 3 TBD Contract Work</p>	1	JOB	\$800	\$800
						

<u>Drinking Fountain</u>						
447	<ul style="list-style-type: none"> <i>As-Built Description:</i> Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping. <i>Proposed Solution:</i> Provide additional fountain or hi-lo combination fountain. 	<p>PCODE IA01A ADAAG 4.1.3(10)(a) ADA 2010 211.1 CBC 2010 1115B.4.6.1 CBC 2013 11B-211.1 Priority 3 Severity 2 TBD Contract Work</p>	1	JOB	\$2,000	\$2,000
						

Facility: **ADMINISTRATION BUILDING**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
449	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor. • <i>As-Built:</i> 38" AFF • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA03BREF ADAAG 4.15.2 ADA 2010 602.4 CBC 2010 1115B.4.6.4 CBC 2013 11B-602.4 Priority 3 Severity 4 TBD Contract Work				
446	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. • <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	PCODE IA04 CBC 2010 1115B.4.6.3; Fig. CBC 2013 11B-602.9 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$3,000	\$3,000



9 Admin & Board of Supervisor Conference Room

Assistive Listening

452	<ul style="list-style-type: none"> • <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. • <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	PCODE GI01E ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work				

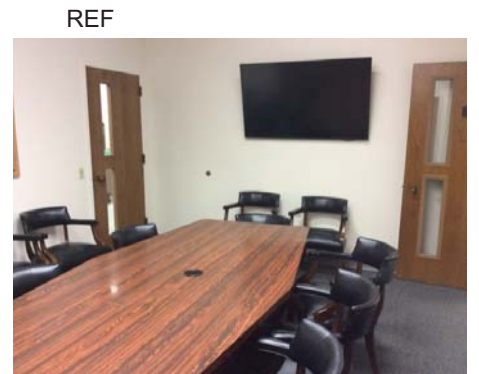



11 Staff Men's Restroom


Facility: **ADMINISTRATION BUILDING**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door Swing						
468	<ul style="list-style-type: none"> <i>As-Built Description:</i> Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60"). <i>As-Built:</i> 48" <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed. 	PCODE ID27BREF ADAAG Fig. 25(c) ADA 2010 404.2.4 CBC 2010 11B-26A(c) CBC 2013 11B-404.2.4 Priority 4 Severity 4 TBD Contract Work				
						REF
						

Restroom						
469	<ul style="list-style-type: none"> <i>As-Built Description:</i> Multiple accommodation restroom not accessible; multiple compliance violations. <i>Proposed Solution:</i> Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens). 	PCODE WA01A ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.1 CBC 2013 11B-603 Priority 4 Severity 1 TBD Contract Work	1	JOB	\$35,000	\$35,000
						

Toilet Stall						
470	<ul style="list-style-type: none"> <i>As-Built Description:</i> Toilet stall less than 60" wide. <i>As-Built:</i> 39.5" wide <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	PCODE WB06REF ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 4 Severity 2 TBD Contract Work				
						REF
						

12 Staff Women's Restroom

Facility: **ADMINISTRATION BUILDING**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Door Swing

- 476
- *As-Built Description:*
 Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60".
 - *As-Built:* 48" at DW+12"
 - *Proposed Solution:*
 Remodel walls as needed.

PCODE **ID23BREF**
 ADAAG **Fig. 25(a)**
 ADA 2010 **404.2.4**
 CBC 2010 **11B-26A(a)**
 CBC 2013 **11B-404.2.4**
 Priority **4**
 Severity **4**
 TBD **Contract Work**

REF



Restroom

- 477
- *As-Built Description:*
 Multiple accommodation restroom not accessible; multiple compliance violations.
 - *Proposed Solution:*
 Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens).

PCODE **WA01A**
 ADAAG **4.22**
 ADA 2010 **603**
 CBC 2010 **1115B.3.1**
 CBC 2013 **11B-603**
 Priority **4**
 Severity **1**
 TBD **Contract Work**

1 JOB \$35,000 **\$35,000**



Sink

- 479
- *As-Built Description:*
 Sink faucet controls not accessible.
 - *Proposed Solution:*
 Provide accessible sink faucet controls.

PCODE **IN07REF**
 ADAAG **4.24.7**
 ADA 2010 **606.4**
 CBC 2010 **1115B.4.7.1**
 CBC 2013 **11B-606.4**
 Priority **4**
 Severity **2**
 TBD **Contract Work**


REF




Facility: **ADMINISTRATION BUILDING**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Toilet Stall</u>						
478	<ul style="list-style-type: none"> As-Built Description: Toilet stall less than 60" wide. As-Built: 39.5" Proposed Solution: Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	PCODE WB06REF ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 4 Severity 2 TBD Contract Work				
						REF
						

<u>Vertical Clearance</u>						
475	<ul style="list-style-type: none"> As-Built Description: Overhead clearance less than 80" above finished floor. As-Built: 77.5" Proposed Solution: Modify overhead clearance. 	PCODE EG01 ADAAG 4.4.2 ADA 2010 307.4 CBC 2010 1133B.8.6.2 CBC 2013 11B-307.4 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$60	\$60
						

Total Costs for	Part/floor: Interior	Ground Floor	\$94,710.00
------------------------	-----------------------------	---------------------	--------------------

Facility: **ADMINISTRATION BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$94,710.00

Facility: **ADMINISTRATION BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: ADMINISTRATION BUILDING					\$94,710.00
------------------------	--	--	--	--	--	--------------------

Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Central Services Lobby

Door Threshold

942	<ul style="list-style-type: none"> <i>As-Built Description:</i> Existing threshold at door is 1/2" high or less but without a beveled edge on both sides. <i>As-Built:</i> Gap, loose plate 0.25" no bevel <i>Proposed Solution:</i> Modify threshold to have beveled edge on each side. 	PCODE ID02 ADAAG 4.1.6(3)(d)(ii) ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 1 Severity 4 TBD Contract Work	1	JOB	\$250	\$250
-----	---	--	---	-----	-------	--------------



Public Counter

948	<ul style="list-style-type: none"> <i>As-Built Description:</i> Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. <i>As-Built:</i> 41.75" <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$150	\$150
-----	---	---	---	-----	-------	--------------



2 Minors Advocates Lobby

Public Counter

954	<ul style="list-style-type: none"> <i>As-Built Description:</i> Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. <i>As-Built:</i> 42" <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$150	\$150
-----	--	---	---	-----	-------	--------------






4 Central Services Office

Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Sink						
974	<ul style="list-style-type: none"> As-Built Description: Sink does not have knee space min. 27" high x 19" deep x 30" wide. Proposed Solution: Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						
976	<ul style="list-style-type: none"> As-Built Description: Sink is more than 6 1/2" deep. Proposed Solution: Provide new sink remodel and cabinet as needed. 	PCODE IN06B ADAAG 4.24.4 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.7 Priority 2 Severity 3 TBD Contract Work	1	JOB	\$1,850	\$1,850
						
975	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 36" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 2 Severity 4 TBD Contract Work		REF		
						

5 Central Services Break Room

Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Non-Fixed Desk</u>						
986	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> 26.5" knee ht <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						


7 Corridors

Door

995	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 14" to irregular surface within DW + 24" at exterior door. <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 1 TBD Contract Work	10	SF	\$40	\$400
						

8 Restroom Corridor




Door

1009	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 5" to irregular surface within DW + 24" at exterior door. <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 3 Severity 1 TBD Contract Work	10	SF	\$40	\$400
						

Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Drinking Fountain</u>						
1003	<ul style="list-style-type: none"> <i>As-Built Description:</i> Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping. <i>Proposed Solution:</i> Provide additional fountain or hi-lo combination fountain. 	PCODE IA01A ADAAG 4.1.3(10)(a) ADA 2010 211.1 CBC 2010 1115B.4.6.1 CBC 2013 11B-211.1 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$2,000	\$2,000
						
1002	<ul style="list-style-type: none"> <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor. <i>As-Built:</i> 36.5" <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA03B ADAAG 4.15.2 ADA 2010 602.4 CBC 2010 1115B.4.6.4 CBC 2013 11B-602.4 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$3,200	\$3,200
						
1001	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	PCODE IA04 CBC 2010 1115B.4.6.3; Fig. CBC 2013 11B-602.9 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$3,000	\$3,000
						


9 Women's Restroom


Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Accessories</u>						
1014	<ul style="list-style-type: none"> As-Built Description: Dispensers in sanitary facilities, such as for towels, soap, sanitary napkins, seat covers, etc., and waste receptacles not accessible or more than 40" from floor to highest operating slot or control. As-Built: FND: 5.5" @ 45" Proposed Solution: Provide specific restroom accessories. 	PCODE WG01REF ADAAG 4.23.7 ADA 2010 308.2.1 CBC 2010 1115B.8.3 CBC 2013 11B-603.5 Priority 3 Severity 3 TBD Contract Work				
						REF
						


<u>Grab Bars</u>						
1025	<ul style="list-style-type: none"> As-Built Description: Grab bars not provided or are not code compliant. Proposed Solution: Provide accessible grab bars. 	PCODE WB07 ADAAG 4.17.6 ADA 2010 604.5 CBC 2010 1115B.4.1.3 CBC 2013 11B-604.5 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
						

<u>Lavatory</u>						
1022	<ul style="list-style-type: none"> As-Built Description: Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory. Proposed Solution: Provide accessible faucet at accessible lavatory. 	PCODE WD06 ADAAG 4.19.5 ADA 2010 606.4 CBC 2010 1115B.4.3 CBC 2013 11B-606.4 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$600	\$600
						


Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Toilet Stall</u>						
1029	<ul style="list-style-type: none"> As-Built Description: Toilet stall less than 60" wide. As-Built: 40.5" Proposed Solution: Provide new accessible stall. 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

10 Men's Restroom - Staff


<u>Grab Bars</u>						
1042	<ul style="list-style-type: none"> As-Built Description: Grab bars not provided or are not code compliant. Proposed Solution: Provide accessible grab bars. 	PCODE WB07 ADAAG 4.17.6 ADA 2010 604.5 CBC 2010 1115B.4.1.3 CBC 2013 11B-604.5 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
						


<u>Lavatory</u>						
1035	<ul style="list-style-type: none"> As-Built Description: Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory. Proposed Solution: Provide accessible faucet at accessible lavatory. 	PCODE WD06 ADAAG 4.19.5 ADA 2010 606.4 CBC 2010 1115B.4.3 CBC 2013 11B-606.4 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$600	\$600
						


Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Toilet Stall						
1043	<ul style="list-style-type: none"> As-Built Description: Toilet stall less than 60" wide. As-Built: 39.5" Proposed Solution: Provide new accessible stall. 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
						


Urinal						
1036	<ul style="list-style-type: none"> As-Built Description: Fixture mounted with rim more than 17" above floor. As-Built: 24" Proposed Solution: Provide accessible urinal. Remodel restroom as needed. 	PCODE WE02 ADAAG 4.18.2 ADA 2010 605.2 CBC 2010 1115B.4.2.1 CBC 2013 11B-605.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$2,400	\$2,400
						

1037	<ul style="list-style-type: none"> As-Built Description: Urinal flush control lever more than 48" above floor (CA only: 44" max.). As-Built: 54" Proposed Solution: Provide accessible urinal flush control. 	PCODE WE03 ADAAG 4.18.4 ADA 2010 605.4 CBC 2010 1115B.4.2.2 CBC 2013 11B-605.4 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
						


Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Water Closet</u>						
1046	<ul style="list-style-type: none"> <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall. <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type, or install sensor flush. <i>Notes:</i> WC 19" o.c. 	PCODE WB10 ADAAG 4.16.5 ADA 2010 604.6 CBC 2010 1115B.4.1.5 CBC 2013 11B-604.6 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
						

11 Dispatch Center

<u>Restroom</u>						
1060	<ul style="list-style-type: none"> <i>As-Built Description:</i> Single accommodation restroom not accessible; multiple compliance violations. <i>Proposed Solution:</i> Remodel area to provide single-occupant accessible restroom. <i>Notes:</i> Room size 98"x70" 	PCODE WA01 ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.2 CBC 2013 11B-603 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$30,000	\$30,000
						

<u>Sink</u>						
1056	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>As-Built:</i> Also drinking fountain not compliant. <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

Facility: **COUNTY SERVICES OFFICES**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1057	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sink rim higher than 34" above floor. • <i>As-Built:</i> 35.75" • <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	<p>PCODE IN06REF</p> <p>ADAAG 4.24.2</p> <p>ADA 2010 606.3</p> <p>CBC 2010 1115B.4.7.1</p> <p>CBC 2013 11B-606.3</p> <p>Priority 2</p> <p>Severity 4</p> <p>TBD Contract Work</p>				



Toilet Stall


1061	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet stall less than 60" wide. • <i>As-Built:</i> 36" wide • <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	<p>PCODE WB06REF</p> <p>ADAAG 4.17.3</p> <p>ADA 2010 604.8.1.1</p> <p>CBC 2010 1115B.3.1.4.1</p> <p>CBC 2013 11B-604.8.1.1</p> <p>Priority 3</p> <p>Severity 1</p> <p>TBD Contract Work</p>				
------	---	---	--	--	--	--



12 Dispatch Center Break Room

Door Pair


1063	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. • <i>As-Built:</i> 27.5" • <i>Proposed Solution:</i> Provide new door leaves, unequal in width, to existing frame for pair of doors. 	<p>PCODE ID08A</p> <p>ADAAG 4.13.4</p> <p>ADA 2010 404.2.2</p> <p>CBC 2010 1133B.2.3.1</p> <p>CBC 2013 11B-404.2.2</p> <p>Priority 4</p> <p>Severity 2</p> <p>TBD Contract Work</p>	1	JOB	\$1,500	\$1,500
------	---	---	---	-----	---------	----------------

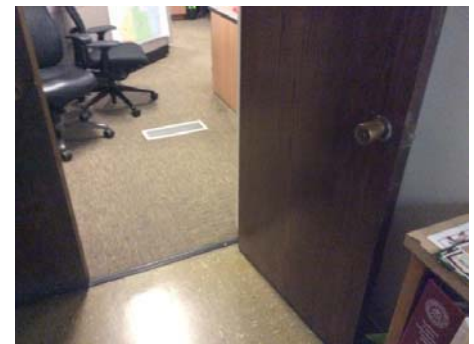



Facility: **COUNTY SERVICES OFFICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Non-Fixed Desk</u>						
1069	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> due to table leg <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

<u>Sink</u>						
1066	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

1067	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink rim higher than 34" above floor. <i>As-Built:</i> 36" <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work	REF			
						

Total Costs for Part/floor: Interior Ground Floor \$59,950.00

Facility: **COUNTY SERVICES OFFICES**
Address: 1400 W. LACEY BLVD.

Area: **Interior**
Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Area: Interior **\$59,950.00**

Facility: COUNTY SERVICES OFFICES

Area: Interior

Part/Floor: Ground Floor

Address: 1400 W. LACEY BLVD.

Year to be Completed: TBD

Priority No: 4

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: COUNTY SERVICES OFFICES					\$59,950.00
------------------------	--	--	--	--	--	--------------------

Facility: **ENGINEERING BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**


Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------


1 Public Works Lobby

Public Counter

772	<ul style="list-style-type: none"> <i>As-Built Description:</i> Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. <i>As-Built:</i> Planning: 42" <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	<p>PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 3 TBD Contract Work</p>	1	JOB	\$150	\$150
-----	--	---	---	-----	-------	--------------




774	<ul style="list-style-type: none"> <i>As-Built Description:</i> Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. <i>As-Built:</i> Public works: 42.25" <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	<p>PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 3 TBD Contract Work</p>	1	JOB	\$150	\$150
-----	---	---	---	-----	-------	--------------



2 Lobby Conference Room

Assistive Listening

779	<ul style="list-style-type: none"> <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	<p>PCODE GI01E ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work</p>	REF			
-----	---	---	-----	--	--	--

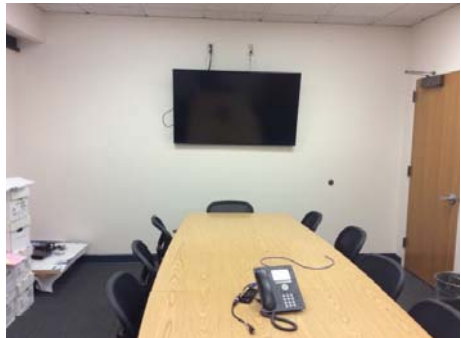

3 Restroom Corridor

Facility: **ENGINEERING BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Drinking Fountain</u>						
785	<ul style="list-style-type: none"> <i>As-Built Description:</i> Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping. <i>As-Built:</i> 9.25" on center from wall <i>Proposed Solution:</i> Provide additional fountain or hi-lo combination fountain. <i>Notes:</i> Also provide within an alcove or provide pedestrian protection. 	PCODE IA01A ADAAG 4.1.3(10)(a) ADA 2010 211.1 CBC 2010 1115B.4.6.1 CBC 2013 11B-211.1 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$2,000	\$2,000
						

<u>Sink</u>						
786	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

789	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink is more than 6 1/2" deep. <i>As-Built:</i> 10" <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed. 	PCODE IN06BREF ADAAG 4.24.4 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.7 Priority 3 Severity 3 TBD Contract Work	REF			
						

Facility: **ENGINEERING BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
787	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 36" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work		REF		



4 Women's Public Restroom

Door Swing

802	<ul style="list-style-type: none"> As-Built Description: Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". As-Built: Stall door: 49" to lav Proposed Solution: Provide relocated new door and frame; remodel as needed. 	PCODE ID23BNT ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$2,600	\$2,600
-----	--	---	---	-----	---------	----------------



Grab Bars

799	<ul style="list-style-type: none"> As-Built Description: Grab bars not provided or are not code compliant. Proposed Solution: Provide accessible grab bars. 	PCODE WB07 ADAAG 4.17.6 ADA 2010 604.5 CBC 2010 1115B.4.1.3 CBC 2013 11B-604.5 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
-----	---	---	---	-----	-------	--------------



Facility: **ENGINEERING BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.


Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Toilet Stall</u>						
798	<ul style="list-style-type: none"> As-Built Description: Toilet stall less than 60" wide. As-Built: 39.5" Proposed Solution: Provide new accessible stall. Notes: WC: 19" o.c. 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

5 Men's Public Restroom

<u>Door Swing</u>						
828	<ul style="list-style-type: none"> As-Built Description: Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". As-Built: Stall door: 46" to lav Proposed Solution: Provide relocated new door and frame; remodel as needed. 	PCODE ID23BNT ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$2,600	\$2,600
						

<u>Grab Bars</u>						
822	<ul style="list-style-type: none"> As-Built Description: Grab bars not provided or are not code compliant. Proposed Solution: Provide accessible grab bars. 	PCODE WB07 ADAAG 4.17.6 ADA 2010 604.5 CBC 2010 1115B.4.1.3 CBC 2013 11B-604.5 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
						

Facility: **ENGINEERING BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Toilet Stall</u>						
821	<ul style="list-style-type: none"> As-Built Description: Toilet stall less than 60" wide. As-Built: 38.5" Proposed Solution: Provide new accessible stall. 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 3 Severity 1 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

<u>Urinal</u>						
829	<ul style="list-style-type: none"> As-Built Description: Fixture mounted with rim more than 17" above floor. As-Built: 25" Proposed Solution: Provide accessible urinal. Remodel restroom as needed. 	PCODE WE02 ADAAG 4.18.2 ADA 2010 605.2 CBC 2010 1115B.4.2.1 CBC 2013 11B-605.2 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$2,400	\$2,400
						

830	<ul style="list-style-type: none"> As-Built Description: 36" wide clearance in front of accessible urinal not provided when walls or partitions project more than 24" from the front edge of 30" x 48" clear space. As-Built: 32.5" wide 60" deep Proposed Solution: Provide 36" clear floor space in front of accessible urinal. Remodel restroom as needed. 	PCODE WE04A ADAAG 4.18.3 ADA 2010 605.3 CBC 2010 1115B.4.2.3 CBC 2013 11B-605.3 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

6 Public Works Office

Facility: **ENGINEERING BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **TBD**

Priority No: **2**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Non-Fixed Desk</u>						
816	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> PC: Knee 24" high Drafting table for viewing plans: Top: <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

7 Public Works Office Corridors

Door

836	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 6" to irregular surface within DW + 24" at exterior door. <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 1 TBD Contract Work	10	SF	\$40	\$400
						

Door Threshold

839	<ul style="list-style-type: none"> <i>As-Built Description:</i> Existing threshold at door is 1/2" high or less but without a beveled edge on both sides. <i>Proposed Solution:</i> Modify threshold to have beveled edge on each side. 	PCODE ID02 ADAAG 4.1.6(3)(d)(ii) ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 2 Severity 4 TBD Contract Work	1	JOB	\$250	\$250
						

Facility: **ENGINEERING BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Drinking Fountain</u>						
841	<ul style="list-style-type: none"> <i>As-Built Description:</i> Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping. <i>Proposed Solution:</i> Provide additional fountain or hi-lo combination fountain. 	PCODE IA01A ADAAG 4.1.3(10)(a) ADA 2010 211.1 CBC 2010 1115B.4.6.1 CBC 2013 11B-211.1 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$2,000	\$2,000
						

840	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	PCODE IA04 CBC 2010 1115B.4.6.3; Fig. CBC 2013 11B-602.9 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$3,000	\$3,000
						

8 Staff Break Room

<u>Non-Fixed Desk</u>						
848	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> 24.75" <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

Facility: **ENGINEERING BUILDING**




Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Sink						
851	<ul style="list-style-type: none"> As-Built Description: Sink does not have knee space min. 27" high x 19" deep x 30" wide. Proposed Solution: Remodel sink cabinet. 	PCODE IN06AREF ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work				
						REF
						
852	<ul style="list-style-type: none"> As-Built Description: Sink is more than 6 1/2" deep. As-Built: 10" Proposed Solution: Provide new sink remodel and cabinet as needed. 	PCODE IN06B ADAAG 4.24.4 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.7 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$1,850	\$1,850
						REF
						
850	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 36" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work				
						REF
						

10 Planning Office Break Room

Facility: **ENGINEERING BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Non-Fixed Desk</u>						
868	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> 26" high knee, 15.5" deep <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

<u>Sink</u>						
864	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

866	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink is more than 6 1/2" deep. <i>As-Built:</i> 10" <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed. 	PCODE IN06BREF ADAAG 4.24.4 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.7 Priority 4 Severity 3 TBD Contract Work	REF			
						

Facility: **ENGINEERING BUILDING**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
865	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work				



11 Planning Office Print Room

Door Swing


876	<ul style="list-style-type: none"> As-Built Description: Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer). As-Built: 5" to wall Proposed Solution: Remove door. Notes: Remove door 	PCODE ID24 ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$500	\$500
-----	--	---	---	-----	-------	-------

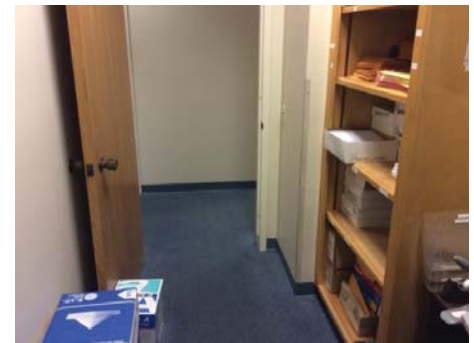

12 IT & Purchasing Lobby

Public Counter

885	<ul style="list-style-type: none"> As-Built Description: Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. As-Built: 42" Proposed Solution: Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$150	\$150
-----	---	--	---	-----	-------	-------

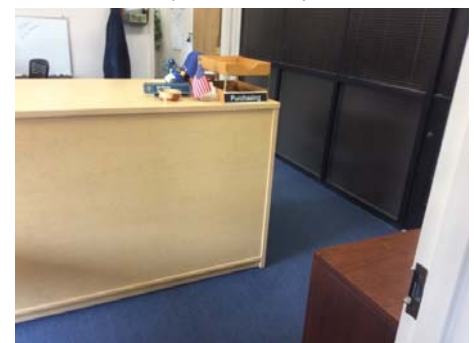

13 IT Offices

Facility: **ENGINEERING BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door						
903	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 3", irregular surface within DW + 24" at exterior door. <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 1 TBD Contract Work	10	SF	\$40	\$400
						

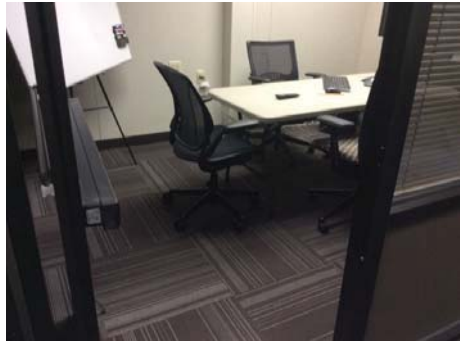Door Clearance						
896	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 31.5" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$2,600	\$2,600
						

14 Server Room & Offices

Door						
912	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 6.5% <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 3 TBD Contract Work	60	SF	\$40	\$2,400
						

Facility: **ENGINEERING BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**


Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
920	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 4.2% <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 3 TBD Contract Work	60	SF	\$40	\$2,400



Door Pair

921	<ul style="list-style-type: none"> <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. <i>As-Built:</i> 28" <i>Proposed Solution:</i> Provide new door leaves, unequal in width, to existing frame for pair of doors. 	PCODE ID08A ADAAG 4.13.4 ADA 2010 404.2.2 CBC 2010 1133B.2.3.1 CBC 2013 11B-404.2.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
-----	---	--	---	-----	---------	---------

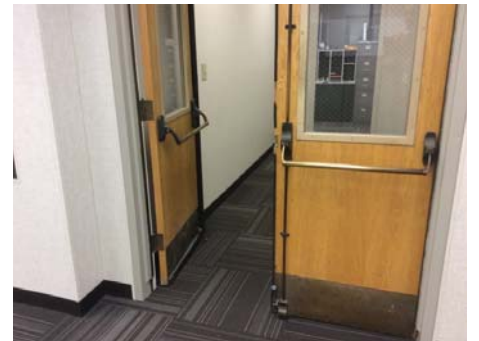

Walk

905	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps. <i>As-Built:</i> 7.8% <i>Proposed Solution:</i> Modify walk/sidewalk slope to 1:20 or less. 	PCODE EF01 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.3 CBC 2013 11B-403.3 Priority 2 Severity 4 TBD Contract Work	20	SF	\$25	\$500
-----	--	--	----	----	------	-------



15 Programming Conference Room

Facility: **ENGINEERING BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Assistive Listening</u>						
931	<ul style="list-style-type: none"> <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	PCODE GI01E ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work				
						REF
						

<u>Door</u>						
924	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 8.3% <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 2 TBD Contract Work	60	SF	\$40	\$2,400
						

16 Network Conference Room

<u>Assistive Listening</u>						
936	<ul style="list-style-type: none"> <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	PCODE GI01E ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work				
						REF
						

Total Costs for Part/floor: Interior Ground Floor \$44,050.00

Facility: **ENGINEERING BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$44,050.00

Facility: **ENGINEERING BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Facility: ENGINEERING BUILDING \$44,050.00

Facility: **FINANCE BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Treasurer & Tax Collector

Desk

577	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> Top: 43.5" <i>Proposed Solution:</i> Provide new fixed accessible table or desk. 	<p>PCODE IN02 ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 Priority 2 Severity 3 TBD Contract Work</p>	1	JOB	\$2,500	\$2,500
-----	---	--	---	-----	---------	----------------



Door Threshold

575	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door inaccessible due to threshold or step at door exceeding 1/2". <i>As-Built:</i> 0.75" <i>Proposed Solution:</i> Modify threshold to be no more than 1/2" by removing existing paving at door and providing landing with edge ramping (slope 1:20 max). 	<p>PCODE ID02A ADAAG 4.13.8 ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 1 Severity 4 TBD Contract Work</p>	2	JOB	\$400	\$800
-----	---	--	---	-----	-------	--------------



Public Counter

576	<ul style="list-style-type: none"> <i>As-Built Description:</i> Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. <i>As-Built:</i> 42.25" <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	<p>PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 3 TBD Contract Work</p>	1	JOB	\$150	\$150
-----	---	---	---	-----	-------	--------------



3 Treasurer Staff Break Room

Facility: **FINANCE BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Door Swing

- 591
- *As-Built Description:*
Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18"(CA only: 24" at exterior doors)x 60".
 - *As-Built:* 3" irregular surface.
 - *Proposed Solution:*
Extend maneuvering space.

PCODE **ID23D**
 ADAAG **Fig. 25(a)**
 ADA 2010 **404.2.4**
 CBC 2010 **11B-26A(a)**
 CBC 2013 **11B-404.2.4**
 Priority **4**
 Severity **2**
 TBD **Contract Work**

1 JOB \$800 **\$800**




Non-Fixed Desk

- 597
- *As-Built Description:*
Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided.
 - *As-Built:* 26"
 - *Proposed Solution:*
Provide table or desk with accessible dimensions when purchasing new furniture.

PCODE **IN02A**
 ADAAG **4.32.3 & .4**
 ADA 2010 **306.1**
 CBC 2010 **1122B.3 & 4**
 CBC 2013 **11B-306.1 & 11B-902.3**
 Priority **4**
 Severity **2**
 TBD **Contract Work**


1 JOB \$1,600 **\$1,600**

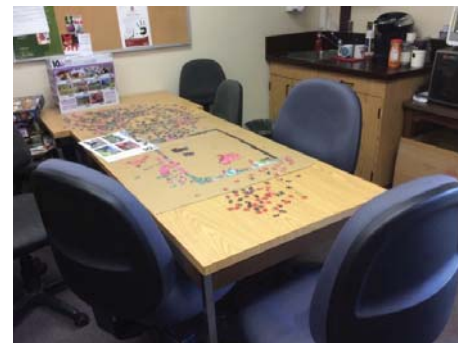

- 599
- *As-Built Description:*
Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided.
 - *As-Built:* Due to table legs
 - *Proposed Solution:*
Provide table or desk with accessible dimensions when purchasing new furniture.

PCODE **IN02A**
 ADAAG **4.32.3 & .4**
 ADA 2010 **306.1**
 CBC 2010 **1122B.3 & 4**
 CBC 2013 **11B-306.1 & 11B-902.3**
 Priority **4**
 Severity **2**
 TBD **Contract Work**

1 JOB \$1,600 **\$1,600**

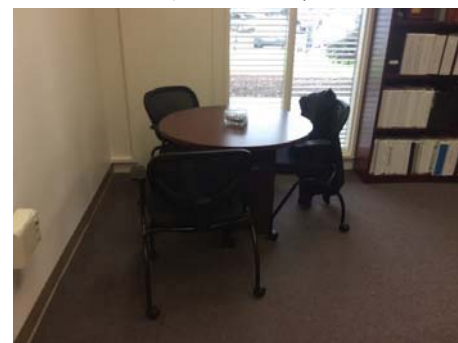

Facility: **FINANCE BUILDING**




Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Sink						
593	<ul style="list-style-type: none"> As-Built Description: Sink does not have knee space min. 27" high x 19" deep x 30" wide. Proposed Solution: Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						
595	<ul style="list-style-type: none"> As-Built Description: Sink is more than 6 1/2" deep. As-Built: 10" Proposed Solution: Provide new sink remodel and cabinet as needed. 	PCODE IN06BREF ADAAG 4.24.4 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.7 Priority 4 Severity 3 TBD Contract Work	REF			
						
594	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work	REF			
						

4 Auditor Controller Office

Facility: **FINANCE BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door						
602	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 3.5", irregular surface within DW + 24" at exterior door. <i>Proposed Solution:</i> Modify surface slope at door to provide accessible clear space at door. <i>Notes:</i> Staff Only 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 4 Severity 1 TBD Contract Work	10	SF	\$40	\$400
						

Non-Fixed Desk						
604	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> 26.5" <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

Sink						
605	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

Facility: **FINANCE BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
607	<ul style="list-style-type: none"> As-Built Description: Sink is more than 6 1/2" deep. As-Built: 10" Proposed Solution: Provide new sink remodel and cabinet as needed. 	<p>PCODE IN06B ADAAG 4.24.4 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.7 Priority 2 Severity 3 TBD Contract Work</p>	1	JOB	\$1,850	\$1,850




606	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 36" Proposed Solution: Remodel sink cabinet to lower sink. 	<p>PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 2 Severity 4 TBD Contract Work</p>				
-----	--	--	--	--	--	--



5 Auditor Controller Lobby

Door Threshold

614	<ul style="list-style-type: none"> As-Built Description: Door inaccessible due to threshold or step at door exceeding 1/2". As-Built: 0.75" Proposed Solution: Modify threshold to be no more than 1/2" by removing existing paving at door and providing landing with edge ramping (slope 1:20 max). 	<p>PCODE ID02A ADAAG 4.13.8 ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 1 Severity 4 TBD Contract Work</p>	1	JOB	\$400	\$400
-----	--	--	---	-----	-------	-------

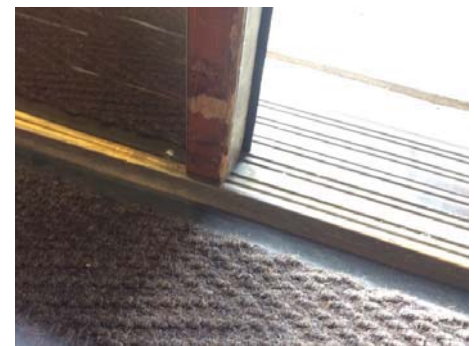

6 Elections Lobby

Facility: **FINANCE BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **TBD**

Priority No: **1**

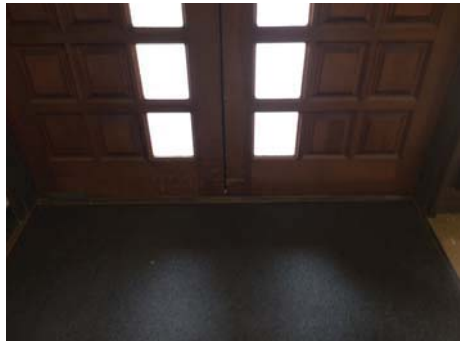Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Threshold</u>						
619	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door inaccessible due to threshold or step at door exceeding 1/2". <i>As-Built:</i> 0.75" <i>Proposed Solution:</i> Modify threshold to be no more than 1/2" by removing existing paving at door and providing landing with edge ramping (slope 1:20 max). 	PCODE ID02A ADAAG 4.13.8 ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 1 Severity 4 TBD Contract Work	1	JOB	\$400	\$400
						

<u>Public Counter</u>						
625	<ul style="list-style-type: none"> <i>As-Built Description:</i> Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. <i>As-Built:</i> 42.25" AFF <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. <i>Notes:</i> To be remodeled 	PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$150	\$150
						

8 Elections Staff Break Room

<u>Door Clearance</u>						
637	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 29" clear <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$2,600	\$2,600
						

Facility: **FINANCE BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Non-Fixed Desk</u>						
635	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. • <i>As-Built:</i> 26.5" • <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

<u>Sink</u>						
639	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. • <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

640	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sink rim higher than 34" above floor. • <i>As-Built:</i> 36" • <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work	REF			
						

9 Courtesy Room

Facility: **FINANCE BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.


Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door</u>						
642	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 3", irregular surface within DW + 24" at exterior door. <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 1 TBD Contract Work	10	SF	\$40	\$400
						

10 Assessor Lobby

<u>Desk</u>						
648	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> 43.5" top at PC station <i>Proposed Solution:</i> Provide new fixed accessible table or desk. 	PCODE IN02 ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 Priority 2 Severity 3 TBD Contract Work	1	JOB	\$2,500	\$2,500
						

<u>Non-Fixed Desk</u>						
652	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> 41.5" work table <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

11 Records Room

Facility: **FINANCE BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**


Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Non-Fixed Desk</u>						
653	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> 25.5" high knee. 15" deep <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

654	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> Microfilm stations 25.75" high knee space <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

13 Staff Men's Restroom

Door Swing

676	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". <i>As-Built:</i> 52" to lav <i>Proposed Solution:</i> Provide relocated new door and frame; remodel as needed. 	PCODE ID23BNT ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$2,600	\$2,600
						

Facility: **FINANCE BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Grab Bars</u>						
678	<ul style="list-style-type: none"> As-Built Description: Grab bars not provided or are not code compliant. Proposed Solution: Provide accessible grab bars. 	PCODE WB07 ADAAG 4.17.6 ADA 2010 604.5 CBC 2010 1115B.4.1.3 CBC 2013 11B-604.5 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
						

<u>Toilet Stall</u>						
677	<ul style="list-style-type: none"> As-Built Description: Toilet stall less than 60" wide. As-Built: 52" Proposed Solution: Provide new accessible stall. Notes: WC 18" o.c. 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

<u>Urinal</u>						
696	<ul style="list-style-type: none"> As-Built Description: Front of rim projects less than 13.5" from wall. As-Built: 12" Proposed Solution: Provide accessible urinal. Remodel restroom as needed. 	PCODE WE01 ADA 2010 605.2 CBC 2010 1115B.4.2.1 CBC 2013 11B-605.2 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$4,000	\$4,000
						

Facility: **FINANCE BUILDING**



Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
695	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor. • <i>As-Built:</i> 24" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	<p>PCODE WE02 ADAAG 4.18.2 ADA 2010 605.2 CBC 2010 1115B.4.2.1 CBC 2013 11B-605.2 Priority 4 Severity 2 TBD Contract Work</p>	1	JOB	\$2,400	\$2,400
						
697	<ul style="list-style-type: none"> • <i>As-Built Description:</i> 36" wide clearance in front of accessible urinal not provided when walls or partitions project more than 24" from the front edge of 30" x 48" clear space. • <i>As-Built:</i> 35"@60" deep • <i>Proposed Solution:</i> Provide 36" clear floor space in front of accessible urinal. Remodel restroom as needed. 	<p>PCODE WE04A ADAAG 4.18.3 ADA 2010 605.3 CBC 2010 1115B.4.2.3 CBC 2013 11B-605.3 Priority 4 Severity 2 TBD Contract Work</p>	1	JOB	\$1,500	\$1,500
						

14 Staff Women's Restroom

Grab Bars

692	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Grab bars not provided or are not code compliant. • <i>Proposed Solution:</i> Provide accessible grab bars. 	<p>PCODE WB07 ADAAG 4.17.6 ADA 2010 604.5 CBC 2010 1115B.4.1.3 CBC 2013 11B-604.5 Priority 4 Severity 3 TBD Contract Work</p>	1	JOB	\$500	\$500
						

Facility: **FINANCE BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Lavatory</u>						
686	<ul style="list-style-type: none"> As-Built Description: Lavatory: Fixture rim or counter height more than 34" above floor. As-Built: 34.5" Proposed Solution: Remount compliant fixture at accessible height. 	PCODE WD02A ADAAG 4.19.2 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$900	\$900
						

<u>Toilet Stall</u>						
691	<ul style="list-style-type: none"> As-Built Description: Toilet stall less than 60" wide. As-Built: 39" Proposed Solution: Provide new accessible stall. 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

<u>Water Closet</u>						
694	<ul style="list-style-type: none"> As-Built Description: Flush Control: Operating handle not mounted toward wide side of stall. Proposed Solution: Replace flush control with properly mounted accessible type, or install sensor flush. Notes: WC 18" o.c. 	PCODE WB10 ADAAG 4.16.5 ADA 2010 604.6 CBC 2010 1115B.4.1.5 CBC 2013 11B-604.6 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
						

15 Assessors Office - Staff

Facility: **FINANCE BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door</u>						
714	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). • <i>As-Built:</i> 3", irregular surface within DW + 24" at exterior door. • <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11NT ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 1 TBD Contract Work	10	SF	\$40	\$400
						
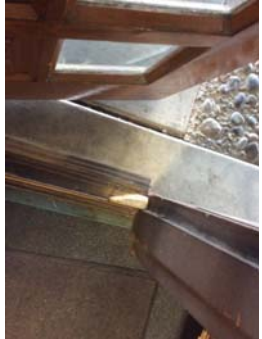
<u>Door Threshold</u>						
715	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Existing threshold at door is 1/2" high or less but without a beveled edge on both sides. • <i>As-Built:</i> 0.25" no bevel • <i>Proposed Solution:</i> Modify threshold to have beveled edge on each side. 	PCODE ID02 ADAAG 4.1.6(3)(d)(ii) ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$250	\$250
						

<u>Drinking Fountain</u>						
702	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping. • <i>As-Built:</i> 13.5" deep • <i>Proposed Solution:</i> Provide additional fountain or hi-lo combination fountain. 	PCODE IA01A ADAAG 4.1.3(10)(a) ADA 2010 211.1 CBC 2010 1115B.4.6.1 CBC 2013 11B-211.1 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$2,000	\$2,000
						

Facility: **FINANCE BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
703	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	<p>PCODE IA04</p> <p>CBC 2010 1115B.4.6.3; Fig.</p> <p>CBC 2013 11B-602.9</p> <p>Priority 3</p> <p>Severity 2</p> <p>TBD Contract Work</p>	1	JOB	\$3,000	\$3,000



Sink

705	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. 	<p>PCODE IN06A</p> <p>ADAAG 4.24.3</p> <p>ADA 2010 606.2</p> <p>CBC 2010 1115B.4.7.1</p> <p>CBC 2013 11B-606.2</p> <p>Priority 2</p> <p>Severity 2</p> <p>TBD Contract Work</p>	1	JOB	\$1,750	\$1,750
-----	--	---	---	-----	---------	---------



706	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink is more than 6 1/2" deep. <i>As-Built:</i> 10" <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed. 	<p>PCODE IN06BREF</p> <p>ADAAG 4.24.4</p> <p>CBC 2010 1115B.4.7.1</p> <p>CBC 2013 11B-606.7</p> <p>Priority 2</p> <p>Severity 3</p> <p>TBD Contract Work</p>	REF			
-----	--	---	-----	--	--	--



16 Assessors Office - Staff Break Room

Facility: **FINANCE BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Non-Fixed Desk</u>						
718	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> 24.5" <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

<u>Sink</u>						
723	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

725	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink is more than 6 1/2" deep. <i>As-Built:</i> 10" <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed. 	PCODE IN06BREF ADAAG 4.24.4 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.7 Priority 4 Severity 3 TBD Contract Work	REF			
						

Facility: **FINANCE BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
724	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sink rim higher than 34" above floor. • <i>As-Built:</i> 36" • <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	<p>PCODE IN06REF</p> <p>ADAAG 4.24.2</p> <p>ADA 2010 606.3</p> <p>CBC 2010 1115B.4.7.1</p> <p>CBC 2013 11B-606.3</p> <p>Priority 4</p> <p>Severity 4</p> <p>TBD Contract Work</p>				



17 Shared Conference Room


Assistive Listening

726	<ul style="list-style-type: none"> • <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. • <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	<p>PCODE GI01E</p> <p>ADAAG 4.1.3(19)(b) & 4.33.7</p> <p>ADA 2010 219.1 & 706.1</p> <p>CBC 2010 1104B.2</p> <p>CBC 2013 11B-219.2</p> <p>Priority 3</p> <p>Severity 3</p> <p>TBD Contract Work</p>				

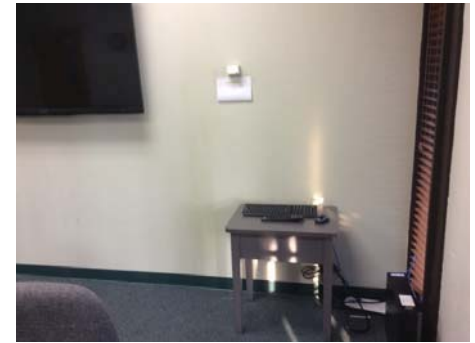

Door

730	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). • <i>As-Built:</i> 3", irregular surface within DW + 24" at exterior door. • <i>Proposed Solution:</i> Modify surface slope at door. 	<p>PCODE ID11</p> <p>ADAAG 4.13.6</p> <p>ADA 2010 404.2.4.4</p> <p>CBC 2010 1133B.2.4</p> <p>CBC 2013 11B-404.2.4</p> <p>Priority 2</p> <p>Severity 1</p> <p>TBD Contract Work</p>	10	SF	\$40	\$400

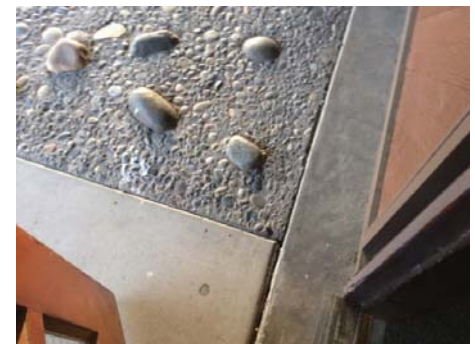

Facility: **FINANCE BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.


Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Threshold</u>						
729	<ul style="list-style-type: none"> <i>As-Built Description:</i> Existing threshold at door is 1/2" high or less but without a beveled edge on both sides. <i>As-Built:</i> No bevel <i>Proposed Solution:</i> Modify threshold to have beveled edge on each side. 	PCODE ID02 ADAAG 4.1.6(3)(d)(ii) ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 2 Severity 4 TBD Contract Work	1	JOB	\$250	\$250
						

18 HR Lobby

<u>Door Threshold</u>						
734	<ul style="list-style-type: none"> <i>As-Built Description:</i> Existing threshold at door is 1/2" high or less but without a beveled edge on both sides. <i>As-Built:</i> Gap and no bevel <i>Proposed Solution:</i> Modify threshold to have beveled edge on each side. 	PCODE ID02 ADAAG 4.1.6(3)(d)(ii) ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 1 Severity 4 TBD Contract Work	1	JOB	\$250	\$250
						

<u>Public Counter</u>						
737	<ul style="list-style-type: none"> <i>As-Built Description:</i> Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. <i>As-Built:</i> 42" <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$150	\$150
						

19 Training Testing Room

Facility: **FINANCE BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Assistive Listening

- 742
- *As-Built Description:*
No portable assistive listening system provided for small meeting room.
 - *Proposed Solution:*
Share existing portable assistive listening system from other facility if needed.

PCODE **GI01E**
 ADAAG **4.1.3(19)(b) & 4.33.7**
 ADA 2010 **219.1 & 706.1**
 CBC 2010 **1104B.2**
 CBC 2013 **11B-219.2**
 Priority **3**
 Severity **3**
 TBD **Contract Work**

REF



21 Staff Offices

Sink

- 759
- *As-Built Description:*
Sink does not have knee space min. 27" high x 19" deep x 30" wide.
 - *Proposed Solution:*
Remodel sink cabinet.

PCODE **IN06A**
 ADAAG **4.24.3**
 ADA 2010 **606.2**
 CBC 2010 **1115B.4.7.1**
 CBC 2013 **11B-606.2**
 Priority **2**
 Severity **2**
 TBD **Contract Work**

1 JOB \$1,750 \$1,750



- 760
- *As-Built Description:*
Sink is more than 6 1/2" deep.
 - *As-Built:* 10"
 - *Proposed Solution:*
Provide new sink remodel and cabinet as needed.

PCODE **IN06BREF**
 ADAAG **4.24.4**
 CBC 2010 **1115B.4.7.1**
 CBC 2013 **11B-606.7**
 Priority **2**
 Severity **3**
 TBD **Contract Work**

REF



Facility: **FINANCE BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
758	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 36" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 2 Severity 4 TBD Contract Work				



Turn Space

763	<ul style="list-style-type: none"> As-Built Description: Less than 60" diameter or T-shaped space provided for wheelchair turns. As-Built: 48.5" Proposed Solution: Retrofit space to provide 60" diameter or T-turn. 	PCODE IN04 ADAAG 4.2.3 ADA 2010 304.1 CBC 2010 1118B.3 CBC 2013 11B-304.1 Priority 2 Severity 2 TBD Contract Work				
-----	--	--	--	--	--	--



Total Costs for	Part/floor: Interior	Ground Floor	\$59,775.00
------------------------	-----------------------------	---------------------	--------------------

Facility: **FINANCE BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$59,775.00

Facility: **FINANCE BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: FINANCE BUILDING					\$59,775.00
------------------------	-----------------------------------	--	--	--	--	--------------------

Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 West Side Parking

Changes in Level

- 1097
- *As-Built Description:*
Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route.
 - *As-Built:* 0.5" gaps
 - *Proposed Solution:*
Remove, replace or repair area of pavement sufficient to correct abrupt change in level.

PCODE EF03REF
 ADAAG 4.3.8
 ADA 2010 403.4
 CBC 2010 1133B.7.4
 CBC 2013 11B-403.4
 Priority 1
 Severity 4
 TBD Contract Work

REF




Cross Slope

- 1098
- *As-Built Description:*
Cross slope more than 1":48" (2.083%).
 - *As-Built:* 2.4%
 - *Proposed Solution:*
Modify cross slope.

PCODE EF07
 ADAAG 4.3.7
 ADA 2010 403.3
 CBC 2010 1133B.7.1.3
 CBC 2013 11B-403.3
 Priority 1
 Severity 4
 TBD Contract Work

5.5 SF \$25 \$138

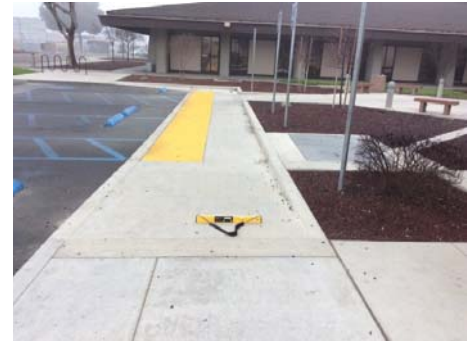

Floor or Ground Surfaces

- 1095
- *As-Built Description:*
Accessible parking space has slope greater than 1/4":12" (2%).
 - *As-Built:* Right two spaces: 2.4-3.3%
 - *Proposed Solution:*
Modify slope at accessible parking space.

PCODE EA05
 ADAAG 4.6.3
 ADA 2010 502.4
 CBC 2010 1129B.3.3
 CBC 2013 11B-502.4
 Priority 1
 Severity 4
 TBD Contract Work


414 SF \$12 \$4,968




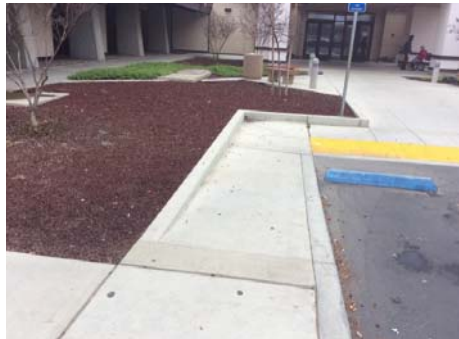
Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Operating Hardware</u>						
1102	<ul style="list-style-type: none"> <i>As-Built Description:</i> Where push plates are provided, two shall be provided: the centerline of one shall be located between 7-8" above the floor, and the second shall be located between 30-44" above the floor. <i>As-Built:</i> 9.5" AFF for bottom push plate <i>Proposed Solution:</i> Remount push plates such that they are compliant. <i>Notes:</i> 40" AFF for top push plate 	PCODE ID29 CBC 2013 11B-404.2.9 Priority 2 Severity 4 TBD Contract Work	1	JOB	\$200	\$200
						

<u>Parking</u>						
1092	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space smaller than 8' wide (CA only: 9' x 18'). <i>As-Built:</i> Old striping causes confusion. <i>Proposed Solution:</i> Modify parking space(s) to create accessible space. 	PCODE EA02ANT ADAAG 4.6.3 ADA 2010 502.2 CBC 2010 1129B.3.1 CBC 2013 11B-502.2 Priority 1 Severity 4 TBD Contract Work	1	JOB	\$200	\$200
						




<u>Walk</u>						
1096	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk more than 36" but less than 48" wide (required in CA only). <i>As-Built:</i> 42" wide <i>Proposed Solution:</i> Enlarge width of walk to 48". 	PCODE EF08 CBC 2010 1133B.7.1 CBC 2013 11B-403.5.1.3 Priority 1 Severity 4 TBD Contract Work	44	SF	\$45	\$1,980
						

2 West Side Curb Ramps to Gov. Center

Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Curb Ramp						
1106	<ul style="list-style-type: none"> As-Built Description: Slope greater than 1:12 (8.3%). As-Built: 9.6% Proposed Solution: Demolish existing and provide new curb ramp. 	PCODE EH02A ADAAG 4.7.2 ADA 2010 406.1 CBC 2010 1127B.5.3 CBC 2013 11B-406.2.1 Priority 1 Severity 4 TBD Contract Work	1	JOB	\$2,500	\$2,500
						
1107	<ul style="list-style-type: none"> As-Built Description: Maximum slope of adjoining gutters, street surface at bottom of ramp exceeds 5% (1:20). As-Built: 12.4% Proposed Solution: Modify road/gutter slopes. Demolish existing and provide new curb ramp. 	PCODE EH02EREF ADAAG 4.7.2 ADA 2010 406.2 CBC 2010 1127B.5.3 CBC 2013 11B-406.5.8 Priority 1 Severity 3 TBD Contract Work				REF
						
1105	<ul style="list-style-type: none"> As-Built Description: Side slopes more than 1:10 (10%). As-Built: Left: 12.5% Right: 12.7% Proposed Solution: Modify curb ramp. Demolish side slopes and replace with 1:10 side slopes if 48" level top landing is provided. 	PCODE EH05A ADAAG 4.7.5 ADA 2010 406.3 CBC 2010 1127B.5.3 CBC 2013 11B-406.2.2 Priority 1 Severity 4 TBD Contract Work	1	JOB	\$2,000	\$2,000
						

Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1109	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Curb ramp: Less than 48" level space at top and 1:12 flared sides not provided. • <i>As-Built:</i> 2.8% at TL • <i>Proposed Solution:</i> Demolish existing and provide new curb ramp. 	PCODE EH05BREF ADAAG 4.7.5; Fig.12(a) ADA 2010 406.4 CBC 2010 1127B.5.4 CBC 2013 11B-406.5.3 Priority 1 Severity 4 TBD Contract Work				



3 NW Accessible Parking

Cross Slope

1116	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Cross slope more than 1":48" (2.083%). • <i>As-Built:</i> 2.7-4.5% • <i>Proposed Solution:</i> Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 3 TBD Contract Work	240	SF	\$25	\$6,000



Floor or Ground Surfaces


1112	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible parking space has slope greater than 1/4":12" (2%). • <i>As-Built:</i> Portion: 2.4-2.6% • <i>Proposed Solution:</i> Modify slope at accessible parking space. 	PCODE EA05 ADAAG 4.6.3 ADA 2010 502.4 CBC 2010 1129B.3.3 CBC 2013 11B-502.4 Priority 1 Severity 4 TBD Contract Work	300	SF	\$12	\$3,600




Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.


Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Parking</u>						
1110	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space does not have 5' wide access aisle; 8' wide for van accessible aisle. <i>As-Built:</i> Missing and faded <i>Proposed Solution:</i> Modify parking aisle(s) to create accessible space by restriping. <i>Notes:</i> 4 Acc 1 van 	PCODE EA02B ADAAG 4.6.3 ADA 2010 502.3 CBC 2010 1129B.3.1 CBC 2013 11B-502.2; 11B-502.3.1 Priority 1 Severity 1 TBD Contract Work	1	JOB	\$200	\$200
						

1114	<ul style="list-style-type: none"> <i>As-Built Description:</i> Disabled persons must wheel or walk behind parked car(s) other than their own. <i>Proposed Solution:</i> Relocate parking and provide curb ramp to accessible route. <i>Notes:</i> Provide walk along front. Provide wheel stops. 	PCODE EA03 ADAAG Fig.9 ADA 2010 502.3 CBC 2010 1129B.3.1 CBC 2013 11B-502.7.1 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$730	\$730
						

4 NE Accessible Parking - Single Space

<u>Curb Ramp</u>						
1123	<ul style="list-style-type: none"> <i>As-Built Description:</i> Side slopes more than 1:10 (10%). <i>As-Built:</i> 34.1% <i>Proposed Solution:</i> Modify curb ramp. Demolish side slopes and replace with 1:10 side slopes if 48" level top landing is provided. 	PCODE EH05A ADAAG 4.7.5 ADA 2010 406.3 CBC 2010 1127B.5.3 CBC 2013 11B-406.2.2 Priority 1 Severity 1 TBD Contract Work	1	JOB	\$2,000	\$2,000
						

Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1124	<ul style="list-style-type: none"> As-Built Description: Less than 48" level space at top and 1:12 flared sides not provided. As-Built: 2.6-3.5% Proposed Solution: Demolish existing and provide new curb ramp. Notes: To staff entry and picnic table 	PCODE EH05B ADAAG 4.7.5; Fig.12(a) ADA 2010 406.4 CBC 2010 1127B.5.4 CBC 2013 11B-406.5.3 Priority 1 Severity 4 TBD Contract Work	1	JOB	\$2,500	\$2,500



Floor or Ground Surfaces


1121	<ul style="list-style-type: none"> As-Built Description: Accessible parking space has slope greater than 1/4":12" (2%). As-Built: 3.0-3.1% Proposed Solution: Modify slope at accessible parking space. 	PCODE EA05 ADAAG 4.6.3 ADA 2010 502.4 CBC 2010 1129B.3.3 CBC 2013 11B-502.4 Priority 1 Severity 4 TBD Contract Work	162	SF	\$12	\$1,944
------	--	--	-----	----	------	----------------



5 East Lot

Cross Slope

1129	<ul style="list-style-type: none"> As-Built Description: Cross slope more than 1":48" (2.083%). As-Built: 3.2-3.6% Proposed Solution: Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 4 TBD Contract Work	48	SF	\$25	\$1,200
------	--	--	----	----	------	----------------

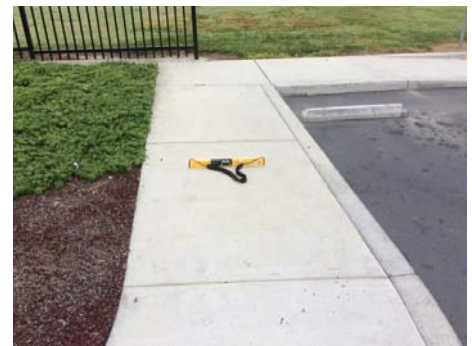

Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.

Area: **Exterior**
 Year to be Completed: **TBD**


Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1130	<ul style="list-style-type: none"> As-Built Description: Cross slope more than 1":48" (2.083%). As-Built: 2.6-2.7% Proposed Solution: Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 4 TBD Contract Work	100	SF	\$25	\$2,500



Door Swing

1132	<ul style="list-style-type: none"> As-Built Description: Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18"(CA only: 24" at exterior doors)x 60". As-Built: 3" Proposed Solution: Extend maneuvering space. Notes: Exterior 24" needed also 12" on push side. 	PCODE ID23D ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 1 Severity 2 TBD Contract Work	1	JOB	\$800	\$800
------	---	---	---	-----	-------	-------

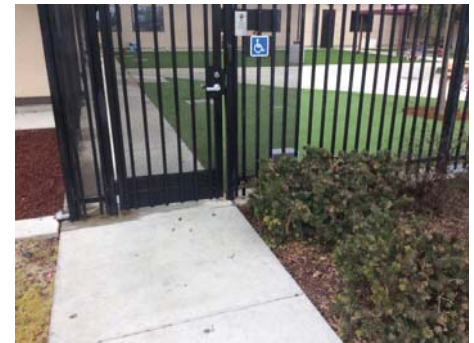

1133	<ul style="list-style-type: none"> As-Built Description: Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18"(CA only: 24" at exterior doors)x 60". As-Built: 7" Proposed Solution: Extend maneuvering space. 	PCODE ID23D ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$800	\$800
------	--	---	---	-----	-------	-------



Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Floor or Ground Surfaces

1128	<ul style="list-style-type: none"> As-Built Description: Accessible parking space has slope greater than 1/4":12" (2%). As-Built: 3.4-3.7% Proposed Solution: Modify slope at accessible parking space. 	PCODE EA05 ADAAG 4.6.3 ADA 2010 502.4 CBC 2010 1129B.3.3 CBC 2013 11B-502.4 Priority 1 Severity 4 TBD Contract Work	306	SF	\$12	\$3,672
------	--	--	-----	----	------	---------



6 South Lot

Cross Slope

1137	<ul style="list-style-type: none"> As-Built Description: Cross slope more than 1":48" (2.083%). As-Built: 2.9-4.1% Proposed Solution: Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 3 TBD Contract Work	564	SF	\$25	\$14,100
------	--	--	-----	----	------	----------




1135	<ul style="list-style-type: none"> As-Built Description: Cross slope more than 1":48" (2.083%). As-Built: 2.4% Proposed Solution: Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 4 TBD Contract Work	112	SF	\$25	\$2,800
------	--	--	-----	----	------	---------



Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1136	<ul style="list-style-type: none"> As-Built Description: Cross slope more than 1":48" (2.083%). As-Built: 2.2-3.3% Proposed Solution: Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 4 TBD Contract Work	100	SF	\$25	\$2,500
						
1138	<ul style="list-style-type: none"> As-Built Description: Cross slope more than 1":48" (2.083%). As-Built: 2.4-3.2% Proposed Solution: Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 4 TBD Contract Work	360	SF	\$25	\$9,000
						
Curb Ramp						
1139	<ul style="list-style-type: none"> As-Built Description: Maximum slope of adjoining gutters, street surface at bottom of ramp exceeds 5% (1:20). As-Built: 5.6-6.7% Proposed Solution: Modify road/gutter slopes. Demolish existing and provide new curb ramp. Notes: 31' and 15' 	PCODE EH02E ADAAG 4.7.2 ADA 2010 406.2 CBC 2010 1127B.5.3 CBC 2013 11B-406.5.8 Priority 1 Severity 4 TBD Contract Work	2	JOB	\$1,250	\$2,500
						

Facility: **HANFORD HUMAN SERVICES**


Area: **Exterior**

Part/Floor: **On-site**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Parking						
1141	<ul style="list-style-type: none"> As-Built Description: Accessible parking space does not have 5' wide access aisle; 8' wide for van accessible aisle. As-Built: 7'9" at van aisles Proposed Solution: Modify parking aisle(s) to create accessible space by restriping. Notes: 201" total 	PCODE EA02B ADAAG 4.6.3 ADA 2010 502.3 CBC 2010 1129B.3.1 CBC 2013 11B-502.2; 11B-502.3.1 Priority 1 Severity 4 TBD Contract Work	2	JOB	\$200	\$400
						

Total Costs for	Part/floor: Exterior	On-site	\$69,231.50
------------------------	----------------------	---------	--------------------

Facility: **HANFORD HUMAN SERVICES**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$69,231.50

Facility: **HANFORD HUMAN SERVICES**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Main Lobby & Reception

Non-Fixed Desk

1153

- *As-Built Description:*
Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided.
- *As-Built:* 26.5"
- *Proposed Solution:*
Provide table or desk with accessible dimensions when purchasing new furniture.

PCODE **IN02A**
 ADAAG **4.32.3 & .4**
 ADA 2010 **306.1**
 CBC 2010 **1122B.3 & 4**
 CBC 2013 **11B-306.1 & 11B-902.3**
 Priority **2**
 Severity **2**
 TBD **Contract Work**

1 JOB \$1,600 **\$1,600**



Public Counter

1152

- *As-Built Description:*
Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.
- *As-Built:* EBT: 42.5"
- *Proposed Solution:*
Provide auxiliary shelf, clipboard, or table as equivalent facilitation.

PCODE **IN03**
 ADAAG **7.2(2)**
 ADA 2010 **904.4**
 CBC 2010 **1122B.4**
 CBC 2013 **11B-904.4**
 Priority **1**
 Severity **3**
 TBD **Contract Work**

1 JOB \$150 **\$150**



4 Finger Printing


Public Counter

1169

- *As-Built Description:*
Public Counter (Seated Service): Accessible section not provided (knee space min. 27" high x 19" deep x 30" wide, top 28" to 34" high, min. 36" counter wide).
- *As-Built:* 42"
- *Proposed Solution:*
Retrofit existing counter to provide accessible seating section.
Interim solution: Provide auxiliary counter or table.

PCODE **IN03A**
 ADAAG **4.32.3 & 4**
 ADA 2010 **306.3; 904.4**
 CBC 2010 **1122B.3 & 4**
 CBC 2013 **11B-306.3; 11B-904.4**
 Priority **1**
 Severity **3**
 TBD **Contract Work**

1 JOB \$1,200 **\$1,200**

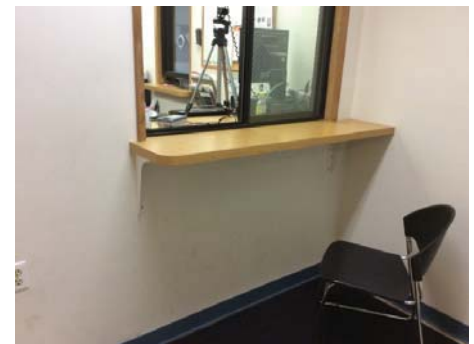



5 Interview Booth 8

Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Public Counter						
1172	<ul style="list-style-type: none"> <i>As-Built Description:</i> Public Counter (Seated Service): Accessible section not provided (knee space min. 27" high x 19" deep x 30" wide, top 28" to 34" high, min. 36" counter wide). <i>As-Built:</i> 13" deep <i>Proposed Solution:</i> Retrofit existing counter to provide accessible seating section. Interim solution: Provide auxiliary counter or table. <i>Notes:</i> 4 total make 1 accessible 	PCODE IN03A ADAAG 4.32.3 & 4 ADA 2010 306.3; 904.4 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.3; 11B-904.4 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,200	\$1,200
						

Turn Space						
1171	<ul style="list-style-type: none"> <i>As-Built Description:</i> Less than 60" diameter or T-shaped space provided for wheelchair turns. <i>As-Built:</i> 59.5" to wall 46" to counter <i>Proposed Solution:</i> Retrofit space to provide 60" diameter or T-turn. <i>Notes:</i> Counter 29" high 	PCODE IN04 ADAAG 4.2.3 ADA 2010 304.1 CBC 2010 1118B.3 CBC 2013 11B-304.1 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$925	\$925
						


6 SW Exit Door- Staff Entry

Door						
1176	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 8" to irregular surface within DW + 24" at exterior door. <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 1 TBD Contract Work	10	SF	\$40	\$400
						


Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**


Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Threshold</u>						
1178	<ul style="list-style-type: none"> As-Built Description: Existing threshold at door is 1/2" high or less but without a beveled edge on both sides. As-Built: 0.5" Proposed Solution: Modify threshold to have beveled edge on each side. 	PCODE ID02 ADAAG 4.1.6(3)(d)(ii) ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$250	\$250
						

7 West Booths Corridor

<u>Turn Space</u>						
1185	<ul style="list-style-type: none"> As-Built Description: Less than 60" diameter or T-shaped space provided for wheelchair turns. As-Built: 31" Proposed Solution: Retrofit space to provide 60" diameter or T-turn. Notes: Provide one wheelchair Acc. room Designate with ISA. 	PCODE IN04 ADAAG 4.2.3 ADA 2010 304.1 CBC 2010 1118B.3 CBC 2013 11B-304.1 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$925	\$925
						


8 West Admin Corridor

<u>Door</u>						
1199	<ul style="list-style-type: none"> As-Built Description: Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). As-Built: 10" to irregular surface within DW + 24" at exterior door. Proposed Solution: Modify surface slope at door. 	PCODE ID11REF ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 1 TBD Contract Work	REF			
						


Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**


Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Threshold</u>						
1198	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door inaccessible due to threshold or step at door exceeding 1/2". <i>As-Built:</i> 0.75" <i>Proposed Solution:</i> Modify threshold to be no more than 1/2" by removing existing paving at door and providing landing with edge ramping (slope 1:20 max). 	PCODE ID02A ADAAG 4.13.8 ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 1 Severity 4 TBD Contract Work	1	JOB	\$400	\$400
						

9 West Admin Conference Room

<u>Assistive Listening</u>							
1207	<ul style="list-style-type: none"> <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	PCODE GI01E ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work	REF				

10 Call Center




<u>Door Pair</u>						
1212	<ul style="list-style-type: none"> <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. <i>As-Built:</i> 27.5" <i>Proposed Solution:</i> Provide new door leaves, unequal in width, to existing frame for pair of doors. 	PCODE ID08A ADAAG 4.13.4 ADA 2010 404.2.2 CBC 2010 1133B.2.3.1 CBC 2013 11B-404.2.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

11 Training Corridor

Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Drinking Fountain</u>						
1233	<ul style="list-style-type: none"> <i>As-Built Description:</i> Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping. <i>Proposed Solution:</i> Provide additional fountain or hi-lo combination fountain. 	PCODE IA01A ADAAG 4.1.3(10)(a) ADA 2010 211.1 CBC 2010 1115B.4.6.1 CBC 2013 11B-211.1 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$2,000	\$2,000
						
1234	<ul style="list-style-type: none"> <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain). <i>As-Built:</i> 26" <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA02 ADAAG 4.15.5(1) ADA 2010 602.2 CBC 2010 1115B.4.6.2 CBC 2013 11B-602.2 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$3,200	\$3,200
						
1235	<ul style="list-style-type: none"> <i>As-Built Description:</i> Drinking fountain is not 18" - 19" in depth. <i>As-Built:</i> Top: 9" deep <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA02BREF ADAAG 4.15.5(1) ADA 2010 602.8 CBC 2010 1115B.4.6.2 CBC 2013 11B-602.8 Priority 3 Severity 1 TBD Contract Work	REF			

Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1232	<ul style="list-style-type: none"> As-Built Description: CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. Proposed Solution: Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	PCODE IA04 CBC 2010 1115B.4.6.3; Fig. CBC 2013 11B-602.9 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$3,000	\$3,000



12 Receiving

Corridor

1244	<ul style="list-style-type: none"> As-Built Description: Corridor less than 36" wide. As-Built: 30" Proposed Solution: Enlarge corridor to 36" wide; relocate stud wall. 	PCODE IH03 ADAAG 4.3.3 ADA 2010 403.5.1 CBC 2010 1133B.3.1 CBC 2013 11B-403.5.1 Priority 2 Severity 2 TBD Contract Work	1	LF	\$140	\$140
------	--	--	---	----	-------	-------



13 Mail Room

Public Counter

1252	<ul style="list-style-type: none"> As-Built Description: Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. As-Built: 42-65.5" Proposed Solution: Provide auxiliary shelf, clipboard, or table as equivalent facilitation. Notes: Staff Only. Reach height. 	PCODE IN03NT ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 4 Severity 1 TBD Contract Work	1	JOB	\$150	\$150
------	---	---	---	-----	-------	-------





14 Training Room

Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Assistive Listening</u>						
1258	<ul style="list-style-type: none"> <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	PCODE GI01E ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work				
						REF
						

<u>Door</u>						
1261	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 5" to irregular surface within DW + 24" at exterior door. <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 1 TBD Contract Work	5	SF	\$40	\$200
						




15 Staff Break Room

<u>Door</u>						
1270	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 5" to irregular surface within DW + 24" at exterior door. <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 4 Severity 1 TBD Contract Work	10	SF	\$40	\$400
						

Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Sink						
1272	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						
1274	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink is more than 6 1/2" deep. <i>As-Built:</i> 7" deep <i>Proposed Solution:</i> Provide new sink remodel and cabinet as needed. 	PCODE IN06B ADAAG 4.24.4 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.7 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$1,850	\$1,850
						
1275	<ul style="list-style-type: none"> <i>As-Built Description:</i> Food waste disposal at kitchen sink protrudes into knee space (recommended: remove equipment if requested as a reasonable accommodation by an employee). <i>Proposed Solution:</i> Remove unit. 	PCODE IN06DREF ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work		REF		
						

Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1273	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sink rim higher than 34" above floor. • <i>As-Built:</i> 36" • <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work				



16 Staff Men's Restroom

Door Swing

1283	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". • <i>As-Built:</i> 57" to lav • <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed. 	PCODE ID23BREF ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 4 Severity 4 TBD Contract Work				
------	---	--	--	--	--	--



Lavatory

1282	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Lavatory: Fixture rim or counter height more than 34" above floor. • <i>As-Built:</i> 34.5" • <i>Proposed Solution:</i> Remount compliant fixture at accessible height. 	PCODE WD02AREF ADAAG 4.19.2 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work				
------	--	---	--	--	--	--



Facility: **HANFORD HUMAN SERVICES**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Restroom</u>						
1279	<ul style="list-style-type: none"> <i>As-Built Description:</i> Multiple accommodation restroom not accessible; multiple compliance violations. <i>Proposed Solution:</i> Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens). 	PCODE WA01A ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.1 CBC 2013 11B-603 Priority 4 Severity 1 TBD Contract Work	1	JOB	\$35,000	\$35,000
						

<u>Toilet Stall</u>							
1280	<ul style="list-style-type: none"> <i>As-Built Description:</i> Toilet stall less than 60" wide. <i>As-Built:</i> 39.5" <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	PCODE WB06REF ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 4 Severity 2 TBD Contract Work	REF				


<u>Urinal</u>							
1281	<ul style="list-style-type: none"> <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor. <i>As-Built:</i> 21" <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE02REF ADAAG 4.18.2 ADA 2010 605.2 CBC 2010 1115B.4.2.1 CBC 2013 11B-605.2 Priority 4 Severity 3 TBD Contract Work	REF				


17 Staff Women's Restroom

Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Corridor						
1291	<ul style="list-style-type: none"> <i>As-Built Description:</i> Corridor less than 36" wide. <i>As-Built:</i> 33-38" to non accessible side. <i>Proposed Solution:</i> Enlarge corridor to 36" wide; relocate stud wall. <i>Notes:</i> Provide FND at accessible side 	PCODE IH03 ADAAG 4.3.3 ADA 2010 403.5.1 CBC 2010 1133B.3.1 CBC 2013 11B-403.5.1 Priority 4 Severity 3 TBD Contract Work	10	LF	\$140	\$1,400
						

Stall Door						
1289	<ul style="list-style-type: none"> <i>As-Built Description:</i> Stall door opening less than 32" clear (CA only: ... or less than 34" at side entry door). <i>As-Built:</i> 32" side door <i>Proposed Solution:</i> Remove stall. Remodel floor and walls as needed. 	PCODE WB05A ADAAG 4.17.5 ADA 2010 604.8.1.2 CBC 2010 1115B.3.1.4.4 CBC 2013 11B-604.8.1.2 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$250	\$250
						




19 North Main Corridor

Door						
1318	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> Irregular surface within DW + 24" at exterior door. <i>Proposed Solution:</i> Modify surface slope at door. <i>Notes:</i> To play yard 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 1 TBD Contract Work	5	SF	\$40	\$200
						

Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Public Counter						
1320	<ul style="list-style-type: none"> <i>As-Built Description:</i> Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. <i>As-Built:</i> 42" <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$150	\$150
						
1305	<ul style="list-style-type: none"> <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. <i>As-Built:</i> staff only; 42.5" <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03REF ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 3 TBD Contract Work	REF			
						
1310	<ul style="list-style-type: none"> <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. <i>As-Built:</i> No longer in use. 42" <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03REF ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 3 TBD Contract Work	REF			
						

Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**


Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1307	<ul style="list-style-type: none"> <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. <i>As-Built:</i> counter shelf 43" <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. <i>Notes:</i> Staff Only. Not used as counter. 	PCODE IN03REF ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 4 Severity 3 TBD Contract Work				



Turn Space

1316	<ul style="list-style-type: none"> <i>As-Built Description:</i> Less than 60" diameter or T-shaped space provided for wheelchair turns. <i>As-Built:</i> 30.5" to desk <i>Proposed Solution:</i> Retrofit space to provide 60" diameter or T-turn. <i>Notes:</i> Provide 2 Acc. rooms 15 total 	PCODE IN04 ADAAG 4.2.3 ADA 2010 304.1 CBC 2010 1118B.3 CBC 2013 11B-304.1 Priority 2 Severity 2 TBD Contract Work	2	JOB	\$925	\$1,850
------	---	---	---	-----	-------	---------

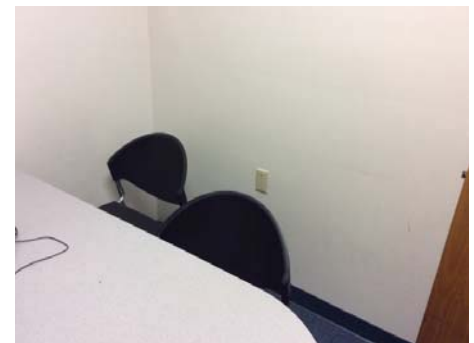

28 Courtyard

Doormat

1355	<ul style="list-style-type: none"> <i>As-Built Description:</i> Doormat hinders access to disabled persons. <i>Proposed Solution:</i> Provide new doormat; recess or attach at edges. 	PCODE ID05 ADAAG 4.5.3 ADA 2010 302.2 CBC 2010 1124B.3 CBC 2013 11B-302.2 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
------	---	---	---	-----	-------	-------






29 Breakroom

Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Sink						
1361	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 34.5" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06 ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$1,750	\$1,750
						
1358	<ul style="list-style-type: none"> As-Built Description: Hot or sharp-surfaced water/drain pipe not insulated or covered. Proposed Solution: Insulate or cover water/drain pipe. 	PCODE IN06C ADAAG 4.24.6 ADA 2010 606.5 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.5 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$120	\$120
						
1359	<ul style="list-style-type: none"> As-Built Description: Food waste disposal at kitchen sink protrudes into knee space (recommended: remove equipment if requested as a reasonable accommodation by an employee). Proposed Solution: Remove unit. 	PCODE IN06D ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$300	\$300
						


32 Women's Restroom SE

Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Semi-Ambulant Stall</u>						
1376	<ul style="list-style-type: none"> <i>As-Built Description:</i> Semi-ambulant stall in restroom not compliant (one required where 6 or more exist). <i>Proposed Solution:</i> Provide grab bars in otherwise compliant stall. <i>Notes:</i> 6 stalls no semi amb 	PCODE WB06BNT ADAAG 4.22.4 ADA 2010 213.3.1 CBC 2010 1115B.3.1.5 CBC 2013 11B-213.3.1 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$400	\$400
						

<u>Water Closet</u>						
1379	<ul style="list-style-type: none"> <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor. <i>As-Built:</i> 19.5" <i>Proposed Solution:</i> Provide new accessible water closet. 	PCODE WB08 ADAAG 4.16.3 ADA 2010 604.4 CBC 2010 1115B.4.1.4 CBC 2013 11B-604.4 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$1,400	\$1,400
						

34 Elm Conference Room F


<u>Assistive Listening</u>							
1383	<ul style="list-style-type: none"> <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	PCODE GI01E ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work	REF				


35 SE Office Spaces

Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Sink						
1385	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 34.5" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06 ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

1386	<ul style="list-style-type: none"> As-Built Description: Sink does not have knee space min. 27" high x 19" deep x 30" wide. As-Built: 8" deep at 13" high Proposed Solution: Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

37 South Offices

Sink						
1392	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 34.5" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06 ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

39 Birch Conference Room

Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Assistive Listening

- 1399
- *As-Built Description:*
No portable assistive listening system provided for small meeting room.
 - *Proposed Solution:*
Share existing portable assistive listening system from other facility if needed.

PCODE **GI01E**
 ADAAG **4.1.3(19)(b) & 4.33.7**
 ADA 2010 **219.1 & 706.1**
 CBC 2010 **1104B.2**
 CBC 2013 **11B-219.2**
 Priority **3**
 Severity **3**
 TBD **Contract Work**

REF



40 Willow Conference Room B

Assistive Listening

- 1401
- *As-Built Description:*
No portable assistive listening system provided for small meeting room.
 - *Proposed Solution:*
Share existing portable assistive listening system from other facility if needed.

PCODE **GI01E**
 ADAAG **4.1.3(19)(b) & 4.33.7**
 ADA 2010 **219.1 & 706.1**
 CBC 2010 **1104B.2**
 CBC 2013 **11B-219.2**
 Priority **3**
 Severity **3**
 TBD **Contract Work**

REF



41 Redwood Classroom

Assistive Listening

- 1406
- *As-Built Description:*
No portable assistive listening system provided for small meeting room.
 - *Proposed Solution:*
Share existing portable assistive listening system from other facility if needed.

PCODE **GI01E**
 ADAAG **4.1.3(19)(b) & 4.33.7**
 ADA 2010 **219.1 & 706.1**
 CBC 2010 **1104B.2**
 CBC 2013 **11B-219.2**
 Priority **3**
 Severity **3**
 TBD **Contract Work**

REF




42 Oak Classroom


Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**


Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Assistive Listening</u>						
1414	<ul style="list-style-type: none"> <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	PCODE GI01E ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work				
						REF
						

43 Cedar Classroom

<u>Assistive Listening</u>						
1421	<ul style="list-style-type: none"> <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	PCODE GI01E ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work				
						REF
						

44 Sequoia Classroom

<u>Assistive Listening</u>						
1427	<ul style="list-style-type: none"> <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	PCODE GI01E ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work				
						REF
						

45 Pine Classroom

Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Assistive Listening</u>						
1434	<ul style="list-style-type: none"> <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	PCODE GI01E ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work				
						REF



46 Classroom Lobby North

<u>Sink</u>						
1435	<ul style="list-style-type: none"> <i>As-Built Description:</i> Food waste disposal at kitchen sink protrudes into knee space (recommended: remove equipment if requested as a reasonable accommodation by an employee). <i>Proposed Solution:</i> Remove unit. Notes: Public area 	PCODE IN06D ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 TBD Contract Work				
			1	JOB	\$300	\$300



47 Classroom Lobby North - Women's RR

<u>Water Closet</u>						
1441	<ul style="list-style-type: none"> <i>As-Built Description:</i> Water closet not 17"-18" from near side wall to center line of water closet (2010 ADAS: 16"-18"). <i>As-Built:</i> 19" o.c. <i>Proposed Solution:</i> Relocate existing water closet and plumbing, remount with offset closet flange to provide 17"-18" from side wall. 	PCODE WB02C ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 4 TBD Contract Work				
			1	JOB	\$500	\$500




49 Classroom Lobby South


Facility: **HANFORD HUMAN SERVICES**
 Address: 1400 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**


Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Sink						
1451	<ul style="list-style-type: none"> <i>As-Built Description:</i> Food waste disposal at kitchen sink protrudes into knee space (recommended: remove equipment if requested as a reasonable accommodation by an employee). <i>Proposed Solution:</i> Remove unit. <i>Notes:</i> Public area 	PCODE IN06D ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$300	\$300
						

50 Classroom Lobby South - Women's RR

Water Closet						
1458	<ul style="list-style-type: none"> <i>As-Built Description:</i> Water closet not 17"-18" from near side wall to center line of water closet (2010 ADAS: 16"-18"). <i>As-Built:</i> 19" o.c. <i>Proposed Solution:</i> Relocate existing water closet and plumbing, remount with offset closet flange to provide 17"-18" from side wall. 	PCODE WB02C ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$500	\$500
						

51 Classroom Lobby South - Men's RR

Water Closet						
1463	<ul style="list-style-type: none"> <i>As-Built Description:</i> Water closet not 17"-18" from near side wall to center line of water closet (2010 ADAS: 16"-18"). <i>As-Built:</i> 19" o.c. <i>Proposed Solution:</i> Relocate existing water closet and plumbing, remount with offset closet flange to provide 17"-18" from side wall. 	PCODE WB02C ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$500	\$500
						

Total Costs for	Part/floor: Interior	Ground Floor	\$71,910.00
------------------------	-----------------------------	---------------------	--------------------

Facility: **HANFORD HUMAN SERVICES**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$71,910.00

Facility: **HANFORD HUMAN SERVICES**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: HANFORD HUMAN SERVICES					\$141,141.50
------------------------	---	--	--	--	--	---------------------

Facility: **LAW OFFICES BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**


Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 DA Offices - Conference Room

Door

1468	<ul style="list-style-type: none"> As-Built Description: Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). As-Built: 5" to irregular surface within DW + 24" at exterior door. Proposed Solution: Modify surface slope at door. 	<p>PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 1 TBD Contract Work</p>	10	SF	\$40	\$400
------	---	--	----	----	------	-------

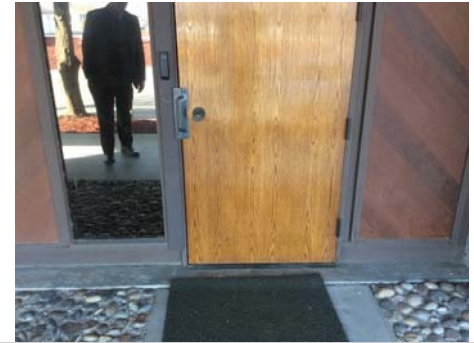

Door Threshold

1472	<ul style="list-style-type: none"> As-Built Description: Door inaccessible due to threshold or step at door exceeding 1/2". As-Built: 0.75" Proposed Solution: Modify threshold to be no more than 1/2" by removing existing paving at door and providing landing with edge ramping (slope 1:20 max). Notes: 26.75" 	<p>PCODE ID02A ADAAG 4.13.8 ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 2 Severity 4 TBD Contract Work</p>	1	JOB	\$400	\$400
------	---	---	---	-----	-------	-------



3 Staff Breakroom

Door

1478	<ul style="list-style-type: none"> As-Built Description: Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). As-Built: Irregular surface within DW + 24" at exterior door. Proposed Solution: Modify surface slope at door. 	<p>PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 4 Severity 1 TBD Contract Work</p>	10	SF	\$40	\$400
------	---	--	----	----	------	-------



Facility: **LAW OFFICES BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Non-Fixed Desk						
1479	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> 26" <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

Sink						
1473	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

1474	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink rim higher than 34" above floor. <i>As-Built:</i> 36", also has garbage disposal within knee space. <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work	REF			
						

4 Staff Office West

Facility: **LAW OFFICES BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.


Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door						
1486	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 5" to irregular surface within DW + 24" at exterior door. <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 1 TBD Contract Work	10	SF	\$40	\$400
						

5 Sexual Assault Offices

Sink						
1488	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>As-Built:</i> 26" <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

1489	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink rim higher than 34" above floor. <i>As-Built:</i> 34.5" <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work	REF			
						

6 Sexual Assault Lobby

Facility: **LAW OFFICES BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door</u>						
1494	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). • <i>As-Built:</i> 5" to irregular surface within DW + 24" at exterior door. • <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 1 Severity 1 TBD Contract Work	10	SF	\$40	\$400
						

<u>Door Threshold</u>						
1495	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Existing threshold at door is 1/2" high or less but without a beveled edge on both sides. • <i>Proposed Solution:</i> Modify threshold to have beveled edge on each side. 	PCODE ID02 ADAAG 4.1.6(3)(d)(ii) ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 1 Severity 4 TBD Contract Work	1	JOB	\$250	\$250
						

7 Sexual Assault Interview Room
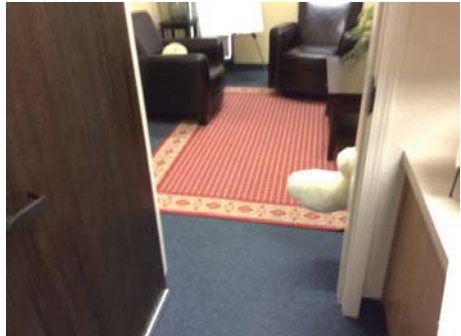
<u>Door Clearance</u>						
1504	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. • <i>As-Built:</i> 29" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 2 Severity 3 TBD Contract Work	1	JOB	\$2,600	\$2,600
						

Facility: **LAW OFFICES BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Swing</u>						
1503	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". • <i>As-Built:</i> 4" to desk counter • <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed. 	<p>PCODE ID23BREF ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 2 TBD Contract Work</p>				
						REF
						

<u>Turn Space</u>						
1507	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than 60" diameter or T-shaped space provided for wheelchair turns. • <i>As-Built:</i> 50" • <i>Proposed Solution:</i> Retrofit space to provide 60" diameter or T-turn. 	<p>PCODE IN04 ADAAG 4.2.3 ADA 2010 304.1 CBC 2010 1118B.3 CBC 2013 11B-304.1 Priority 2 Severity 2 TBD Contract Work</p>	1	JOB	\$925	\$925
						

8 DA Staff Conference Room

<u>Assistive Listening</u>						
1512	<ul style="list-style-type: none"> • <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. • <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	<p>PCODE GI01E ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work</p>				
						REF
						

9 DA Restroom Corridor

Facility: **LAW OFFICES BUILDING**




Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Drinking Fountain</u>						
1515	<ul style="list-style-type: none"> <i>As-Built Description:</i> Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping. <i>Proposed Solution:</i> Provide additional fountain or hi-lo combination fountain. 	PCODE IA01A ADAAG 4.1.3(10)(a) ADA 2010 211.1 CBC 2010 1115B.4.6.1 CBC 2013 11B-211.1 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$2,000	\$2,000
						
1516	<ul style="list-style-type: none"> <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain). <i>As-Built:</i> 6.5" deep <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA02 ADAAG 4.15.5(1) ADA 2010 602.2 CBC 2010 1115B.4.6.2 CBC 2013 11B-602.2 Priority 3 Severity 1 TBD Contract Work	1	JOB	\$3,200	\$3,200
						
1517	<ul style="list-style-type: none"> <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor. <i>As-Built:</i> 40" AFF <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA03B ADAAG 4.15.2 ADA 2010 602.4 CBC 2010 1115B.4.6.4 CBC 2013 11B-602.4 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$3,200	\$3,200
						

Facility: **LAW OFFICES BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1514	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	<p>PCODE IA04</p> <p>CBC 2010 1115B.4.6.3; Fig.</p> <p>CBC 2013 11B-602.9</p> <p>Priority 3</p> <p>Severity 2</p> <p>TBD Contract Work</p>	1	JOB	\$3,000	\$3,000



10 DA Restroom Corridor - Kitchenette

Door

1529	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 8" to irregular surface within DW + 24" at exterior door. <i>Proposed Solution:</i> Modify surface slope at door. 	<p>PCODE ID11</p> <p>ADAAG 4.13.6</p> <p>ADA 2010 404.2.4.4</p> <p>CBC 2010 1133B.2.4</p> <p>CBC 2013 11B-404.2.4</p> <p>Priority 3</p> <p>Severity 1</p> <p>TBD Contract Work</p>	10	SF	\$40	\$400
------	---	--	----	----	------	--------------



Sink

1523	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. 	<p>PCODE IN06A</p> <p>ADAAG 4.24.3</p> <p>ADA 2010 606.2</p> <p>CBC 2010 1115B.4.7.1</p> <p>CBC 2013 11B-606.2</p> <p>Priority 2</p> <p>Severity 2</p> <p>TBD Contract Work</p>	1	JOB	\$1,750	\$1,750
------	--	---	---	-----	---------	----------------



Facility: **LAW OFFICES BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1524	<ul style="list-style-type: none"> As-Built Description: Sink is more than 6 1/2" deep. As-Built: 10" Proposed Solution: Provide new sink remodel and cabinet as needed. 	<p>PCODE IN06B ADAAG 4.24.4 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.7 Priority 3 Severity 3 TBD Contract Work</p>	1	JOB	\$1,850	\$1,850




1525	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 35.5" Proposed Solution: Remodel sink cabinet to lower sink. 	<p>PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work</p>				
------	--	--	--	--	--	--



11 DA Restroom - Staff Women's

Lavatory

1537	<ul style="list-style-type: none"> As-Built Description: Lavatory: Fixture rim or counter height more than 34" above floor. As-Built: 34.5" Proposed Solution: Provide new accessible lavatory. Remodel restroom as needed. 	<p>PCODE WD02 ADAAG 4.19.2 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work</p>	1	JOB	\$3,400	\$3,400
------	--	---	---	-----	---------	---------

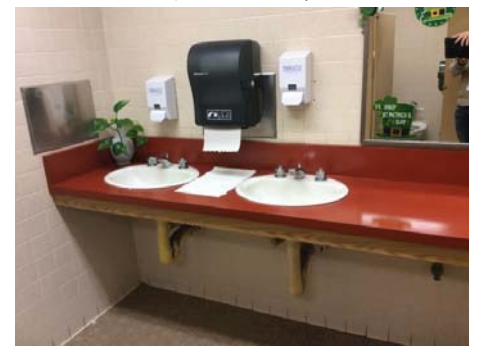

Facility: **LAW OFFICES BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1538	<ul style="list-style-type: none"> <i>As-Built Description:</i> Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory. <i>Proposed Solution:</i> Provide accessible faucet at accessible lavatory. 	PCODE WD06 ADAAG 4.19.5 ADA 2010 606.4 CBC 2010 1115B.4.3 CBC 2013 11B-606.4 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$600	\$600



Toilet Stall

1544	<ul style="list-style-type: none"> <i>As-Built Description:</i> Toilet stall less than 60" wide. <i>As-Built:</i> 40" <i>Proposed Solution:</i> Provide new accessible stall. <i>Notes:</i> Multiple items. WC 18.5" o.c. 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
------	--	---	---	-----	---------	----------------



12 DA Restroom - Staff Men's

Lavatory

1554	<ul style="list-style-type: none"> <i>As-Built Description:</i> Lavatory: Fixture rim or counter height more than 34" above floor. <i>As-Built:</i> 34.5" <i>Proposed Solution:</i> Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD02 ADAAG 4.19.2 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$3,400	\$3,400
------	---	---	---	-----	---------	----------------



Facility: **LAW OFFICES BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1553	<ul style="list-style-type: none"> <i>As-Built Description:</i> Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory. <i>Proposed Solution:</i> Provide accessible faucet at accessible lavatory. 	PCODE WD06REF ADAAG 4.19.5 ADA 2010 606.4 CBC 2010 1115B.4.3 CBC 2013 11B-606.4 Priority 4 Severity 3 TBD Contract Work				



Restroom

1551	<ul style="list-style-type: none"> <i>As-Built Description:</i> Multiple accommodation restroom not accessible; multiple compliance violations. <i>As-Built:</i> 22" to urinal <i>Proposed Solution:</i> Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens). 	PCODE WA01A ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.1 CBC 2013 11B-603 Priority 4 Severity 1 TBD Contract Work	1	JOB	\$35,000	\$35,000
------	---	--	---	-----	----------	-----------------



Toilet Stall

1552	<ul style="list-style-type: none"> <i>As-Built Description:</i> Toilet stall less than 60" wide. <i>As-Built:</i> 39.5" <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	PCODE WB06REF ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 4 Severity 2 TBD Contract Work				
------	--	--	--	--	--	--



13 DA Lobby

Facility: **LAW OFFICES BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Pair</u>						
1560	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. • <i>As-Built:</i> 30" • <i>Proposed Solution:</i> Provide new door leaves, unequal in width, to existing frame for pair of doors. 	PCODE ID08A ADAAG 4.13.4 ADA 2010 404.2.2 CBC 2010 1133B.2.3.1 CBC 2013 11B-404.2.2 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

<u>Public Counter</u>						
1563	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. • <i>As-Built:</i> 42" • <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$150	\$150
						

14 Law Library

<u>Book Shelves</u>						
1579	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Book shelves are more than 54" maximum height. • <i>As-Built:</i> 68" • <i>Proposed Solution:</i> Provide attendant when needed. • Notes: Attendant part time. Ensure that help can be received when needed. 	PCODE BD01A ADAAG 4.2.6; Fig. 6 ADA 2010 225.2.2 CBC 2010 1106B.4.3 CBC 2013 11B-225.2.3 Priority 2 Severity 2 TBD Contract Work	JOB		\$0	
						

Facility: **LAW OFFICES BUILDING**




Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Open Stack						
1575	<ul style="list-style-type: none"> <i>As-Built Description:</i> Open stacks (i.e. public use) do not have min 36" (44" preferred) wide aisles (CA only: 44" min. width at main aisles and 36" min. at end aisles). <i>As-Built:</i> 28" to chairs <i>Proposed Solution:</i> Enlarge open stack aisles to 44" wide and/or end of aisles to 36". 	PCODE BB01 ADAAG 8.5 CBC 2010 1106B.4.2 CBC 2013 11B-403.5.1 Priority 2 Severity 2 TBD Contract Work	4	LF	\$60	\$240
						
1576	<ul style="list-style-type: none"> <i>As-Built Description:</i> Open stacks (i.e. public use) do not have min 36" (44" preferred) wide aisles (CA only: 44" min. width at main aisles and 36" min. at end aisles). <i>As-Built:</i> 41" <i>Proposed Solution:</i> Enlarge open stack aisles to 44" wide and/or end of aisles to 36". 	PCODE BB01 ADAAG 8.5 CBC 2010 1106B.4.2 CBC 2013 11B-403.5.1 Priority 2 Severity 4 TBD Contract Work	116	LF	\$60	\$6,960
						
1577	<ul style="list-style-type: none"> <i>As-Built Description:</i> Open stacks (i.e. public use) do not have min 36" (44" preferred) wide aisles (CA only: 44" min. width at main aisles and 36" min. at end aisles). <i>As-Built:</i> 18" <i>Proposed Solution:</i> Enlarge open stack aisles to 44" wide and/or end of aisles to 36". 	PCODE BB01REF ADAAG 8.5 CBC 2010 1106B.4.2 CBC 2013 11B-403.5.1 Priority 2 Severity 1 TBD Contract Work	REF			
						

15 Veterans Services

Facility: **LAW OFFICES BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door</u>						
1584	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 5" to irregular surface within DW + 24" at exterior door. <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 1 Severity 1 TBD Contract Work	4	SF	\$40	\$160
						

<u>Operable Part</u>						
1587	<ul style="list-style-type: none"> <i>As-Built Description:</i> Operable part(s) require tight grasping, pinching, or twisting of the wrist with one hand. <i>As-Built:</i> 61" <i>Proposed Solution:</i> Modify or replace the operable part(s) to not require tight grasping, pinching, or twisting of the wrist with one hand. 	PCODE IC02 ADAAG 4.27.4 ADA 2010 309.4 CBC 2010 1117B.6.4 CBC 2013 11B-309.4 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$300	\$300
						

<u>Public Counter</u>						
1588	<ul style="list-style-type: none"> <i>As-Built Description:</i> Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. <i>As-Built:</i> 42.25" <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$150	\$150
						

18 County Council Staff Breakroom

Facility: **LAW OFFICES BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Sink						
1608	<ul style="list-style-type: none"> As-Built Description: Sink does not have knee space min. 27" high x 19" deep x 30" wide. Proposed Solution: Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

Total Costs for	Part/floor: Interior	Ground Floor	\$81,385.00
------------------------	----------------------	--------------	--------------------

Facility: **LAW OFFICES BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$81,385.00

Facility: **LAW OFFICES BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: LAW OFFICES BUILDING					\$81,385.00
------------------------	---------------------------------------	--	--	--	--	--------------------

Facility: **VICTIM WITNESS**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 POT from Sidewalk to Ramped Entrance

Change in Direction

<p>1620</p> <ul style="list-style-type: none"> • <i>As-Built Description:</i> Landing at change of direction not 60" minimum by 72" minimum in the direction of downward travel from the upper ramp run. • <i>As-Built:</i> 70.5" to rail. 72" to platform edge. • <i>Proposed Solution:</i> Modify landing at change of direction to 60" x 72". • <i>Notes:</i> Modify railing and relocate bin 	<p>PCODE EB08 ADAAG 4.8.4(3) ADA 2010 405.7.4 CBC 2010 1133B.5.4 CBC 2013 11B-405.7.4 Priority 1 Severity 4 TBD Contract Work</p>	<p>8 SF \$45 \$360</p>
---	---	-------------------------------



Door Swing

<p>1622</p> <ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18"(CA only: 24" at exterior doors)x 60". • <i>As-Built:</i> 58.5" to rail • <i>Proposed Solution:</i> Extend maneuvering space and relocate railing. 	<p>PCODE ID23D ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 1 Severity 4 TBD Contract Work</p>	<p>1 JOB \$800 \$800</p>
---	---	---------------------------------



Ramps

<p>1619</p> <ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp: Pavement dislocation creates abrupt change in level exceeding 1/2" in ramp. • <i>As-Built:</i> 1" gap at bottom. • <i>Proposed Solution:</i> Remove, replace or repair area of pavement sufficient to correct abrupt change in level. 	<p>PCODE EB04 ADAAG 4.5.2 ADA 2010 303.4 CBC 2010 1133B.7.1 CBC 2013 11B-405.4 Priority 1 Severity 3 TBD Contract Work</p>	<p>4 SF \$25 \$100</p>
--	--	-------------------------------



Facility: **VICTIM WITNESS**


Area: **Exterior**

Part/Floor: **On-site**

Address: 1400 W. LACEY BLVD.


Year to be Completed: **TBD**

Priority No: **1**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Top and Bottom Extension at Ramps</u>						
1621	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. • <i>As-Built:</i> 0" • <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). 	PCODE ED05 ADAAG 4.8.5(2) ADA 2010 505.10.1 CBC 2010 1133B.4.2.2 & CBC 2013 11B-505.10.1 Priority 1 Severity 2 TBD Contract Work	1	JOB	\$170	\$170
						

3 Staff Stairs

Handrails

1624	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas). • <i>Proposed Solution:</i> Provide new handrail for each side including extensions. 	PCODE ED01 ADAAG 4.8.5 & 4.9.4 ADA 2010 505.2 CBC 2010 1133B.4.1.1 & .5.5 CBC 2013 11B-505.2 Priority 4 Severity 2 TBD Contract Work	6	LF	\$95	\$570
						

Open Risers

1627	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stair does not have closed risers. • <i>Proposed Solution:</i> Modify stair to have closed risers 	PCODE EC03 ADAAG 4.9.2 ADA 2010 504.3 CBC 2010 1133B.4.5.3 CBC 2013 11B-504.3 Priority 4 Severity 3 TBD Contract Work	15	LF	\$36	\$540
						

Facility: **VICTIM WITNESS**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Top & Bottom Extension at Stairs

1625

• *As-Built Description:*

Stair handrail does not extend horizontally 12" minimum beyond top nosing, and one tread width sloped, plus 12" minimum horizontally beyond the bottom nosing.

• *As-Built:* does one extend one tread width plus 12"

• *Proposed Solution:*

Extend stair handrail at top and bottom (cost for each extension piece).

PCODE ED06

ADAAG 4.9.4(2)

ADA 2010 505.10.2; 505.10.3

CBC 2010 1133B.4.2.2

CBC 2013 11B-505.10.2; 11B

-505.10.3

Priority 4

Severity 2

TBD Contract Work

1 JOB \$170 \$170



Total Costs for	Part/floor: Exterior	On-site	\$2,710.00
------------------------	-----------------------------	----------------	-------------------

Facility: **VICTIM WITNESS**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$2,710.00

Facility: **VICTIM WITNESS**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Entrance Lobby

Public Counter

- 1633
- *As-Built Description:*
Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.
 - *As-Built:* 42.5"
 - *Proposed Solution:*
Provide auxiliary shelf, clipboard, or table as equivalent facilitation.

PCODE **IN03**
 ADAAG **7.2(2)**
 ADA 2010 **904.4**
 CBC 2010 **1122B.4**
 CBC 2013 **11B-904.4**
 Priority **1**
 Severity **3**
TBD Contract Work

1 JOB \$150 **\$150**




3 Staff Breakroom

Door Swing

- 1638
- *As-Built Description:*
Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60".
 - *As-Built:* 1"
 - *Proposed Solution:*
Provide relocated new door and frame; remodel walls as needed.

PCODE **ID23BNT**
 ADAAG **Fig. 25(a)**
 ADA 2010 **404.2.4**
 CBC 2010 **11B-26A(a)**
 CBC 2013 **11B-404.2.4**
 Priority **4**
 Severity **2**
TBD Contract Work

1 JOB \$2,600 **\$2,600**

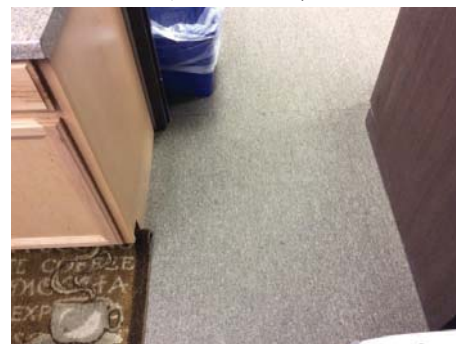

Sink

- 1639
- *As-Built Description:*
Sink does not have knee space min. 27" high x 19" deep x 30" wide.
 - *Proposed Solution:*
Remodel sink cabinet.

PCODE **IN06A**
 ADAAG **4.24.3**
 ADA 2010 **606.2**
 CBC 2010 **1115B.4.7.1**
 CBC 2013 **11B-606.2**
 Priority **4**
 Severity **2**
TBD Contract Work

1 JOB \$1,750 **\$1,750**



Facility: **VICTIM WITNESS**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1640	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 35" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work				



4 Unisex Restroom

Toilet Stall

1651	<ul style="list-style-type: none"> As-Built Description: The lavatory or other unintended fixture, encroaches on the necessary clearance around a water closet (60" x 56"). As-Built: 53" and 28" to lav Proposed Solution: Remove adjacent fixture and provide new enclosure at accessible water closet. 	PCODE WB01A ADA 2010 604.3.1; 604.3.2 CBC 2013 11B-604.3.1; 11B-604.3.2 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$2,000	\$2,000



Water Closet

1646	<ul style="list-style-type: none"> As-Built Description: Water closet not 17"-18" from near side wall to center line of water closet (2010 ADAS: 16"-18"). As-Built: 19" o.c. Proposed Solution: Relocate existing water closet and plumbing, remount with offset closet flange to provide 17"-18" from side wall. 	PCODE WB02C ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$500	\$500



Total Costs for	Part/floor: Interior	Ground Floor				\$7,000.00
------------------------	-----------------------------	---------------------	--	--	--	-------------------

Facility: **VICTIM WITNESS**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$7,000.00

Facility: **VICTIM WITNESS**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1400 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: VICTIM WITNESS					\$9,710.00
------------------------	---------------------------------	--	--	--	--	-------------------

Facility: **PROBATION BUILDING**
 Address: 1424 FORUM DR.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Site Entry

Cross Slope

2076	<ul style="list-style-type: none"> As-Built Description: Cross slope more than 1":48" (2.083%). As-Built: 2.2-2.8% Proposed Solution: Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 4 TBD Contract Work	648	SF	\$25	\$16,200
------	--	--	-----	----	------	----------



Slope

2059	<ul style="list-style-type: none"> As-Built Description: Level 2% max. landing for ramp not provided. Proposed Solution: Rebuild ramp to provide landings for each ramp run with slopes no greater than 2% Notes: Site entry on side street 	PCODE EB05A ADAAG 4.8.4 ADA 2010 405.7.1 CBC 2010 1133B.5.4.1 CBC 2013 11B-405.7.1 Priority 1 Severity 4 TBD Contract Work	10	SF	\$100	\$1,000
------	--	---	----	----	-------	---------



Walk

2077	<ul style="list-style-type: none"> As-Built Description: Walk more than 36" but less than 48" wide (required in CA only). As-Built: 47" Proposed Solution: Enlarge width of walk to 48". 	PCODE EF08 CBC 2010 1133B.7.1 CBC 2013 11B-403.5.1.3 Priority 1 Severity 4 TBD Contract Work	88	SF	\$45	\$3,960
------	---	---	----	----	------	---------



Facility: **PROBATION BUILDING**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1424 FORUM DR.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2075	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk more than 36" but less than 48" wide (required in CA only). <i>Proposed Solution:</i> Enlarge width of walk to 48". <i>Notes:</i> PRoW 36" sidewalk 	<p>PCODE EF08REF</p> <p>ADA 2010 403.5</p> <p>CBC 2010 1133B.7.1</p> <p>CBC 2013 11B-403.5.1.3</p> <p>Priority 1</p> <p>Severity 3</p> <p>TBD Contract Work</p>				



2 Accessible Parking Serving Main Entrance

Floor or Ground Surfaces

2062	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space has slope greater than 1/4":12" (2%). <i>As-Built:</i> 2.5-5.1% <i>Proposed Solution:</i> Modify slope at accessible parking space. 	<p>PCODE EA05</p> <p>ADAAG 4.6.3</p> <p>ADA 2010 502.4</p> <p>CBC 2010 1129B.3.3</p> <p>CBC 2013 11B-502.4</p> <p>Priority 1</p> <p>Severity 3</p> <p>TBD Contract Work</p>	162	SF	\$12	\$1,944
------	---	---	-----	----	------	---------



2063	<ul style="list-style-type: none"> <i>As-Built Description:</i> Access aisle at accessible parking space has slope greater than 1/4":12" (2%) due to built-up curb ramp within aisle. <i>As-Built:</i> 22% at flares <i>Proposed Solution:</i> Provide curb cut. 	<p>PCODE EA05A</p> <p>ADAAG 4.6.3</p> <p>ADA 2010 502.4</p> <p>CBC 2010 1129B.3.3</p> <p>CBC 2013 11B-502.4</p> <p>Priority 1</p> <p>Severity 1</p> <p>TBD Contract Work</p>	1	JOB	\$2,500	\$2,500
------	---	--	---	-----	---------	---------



3 POT from Accessible Parking to Main Entrance

Facility: **PROBATION BUILDING**
 Address: 1424 FORUM DR.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Cross Slope

2068	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Cross slope more than 1":48" (2.083%). • <i>As-Built:</i> 2.3-5.0% • <i>Proposed Solution:</i> Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 3 TBD Contract Work	300	SF	\$25	\$7,500
------	---	--	-----	----	------	----------------



Curb or Barrier

2072	<ul style="list-style-type: none"> • <i>As-Built Description:</i> No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp. • <i>Proposed Solution:</i> Provide 2" minimum curb or wheel guide. • <i>Notes:</i> 2" diameter 	PCODE EB14 ADAAG 4.8.7 ADA 2010 405.9.2 CBC 2010 1133B.5.6 CBC 2013 11B-405.9.2 Priority 1 Severity 2 TBD Contract Work	70	LF	\$17	\$1,190
------	--	--	----	----	------	----------------



Slope

2071	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Slope greater than 1:12 (8.3%). • <i>As-Built:</i> 8.8% at middle panel • <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails. 	PCODE EB02 ADAAG 4.8.2 ADA 2010 405.2 CBC 2010 1133B.5.3 CBC 2013 11B-405.2 Priority 1 Severity 4 TBD Contract Work	66	SF	\$100	\$6,600
------	---	--	----	----	-------	----------------



Facility: **PROBATION BUILDING**
 Address: 1424 FORUM DR.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2070	<ul style="list-style-type: none"> As-Built Description: Level 2% max. landing for ramp not provided. As-Built: 5% Proposed Solution: Rebuild ramp to provide landings for each ramp run with slopes no greater than 2% 	PCODE EB05AREF ADAAG 4.8.4 ADA 2010 405.7.1 CBC 2010 1133B.5.4.1 CBC 2013 11B-405.7.1 Priority 1 Severity 3 TBD Contract Work				
						REF



Top and Bottom Extension at Ramps


2073	<ul style="list-style-type: none"> As-Built Description: Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. Proposed Solution: Provide ramp handrail extension (cost for each extension piece). 	PCODE ED05 ADAAG 4.8.5(2) ADA 2010 505.10.1 CBC 2010 1133B.4.2.2 & CBC 2013 11B-505.10.1 Priority 1 Severity 4 TBD Contract Work	4	JOB	\$170	\$680
------	---	--	---	-----	-------	-------



4 SE Staff Exit

Walk

2079	<ul style="list-style-type: none"> As-Built Description: Walk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps. As-Built: 8.8% Proposed Solution: Provide ramp with handrails on both (2) sides. 	PCODE EF01A ADAAG 4.8.1 ADA 2010 405.1 CBC 2010 1133B.7.3 CBC 2013 11B-405.1 Priority 2 Severity 4 TBD Contract Work	30	LF	\$260	\$7,800
------	--	--	----	----	-------	---------

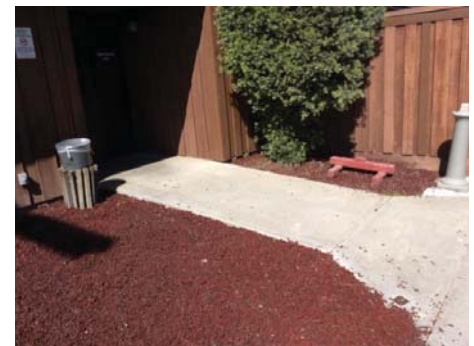


5 NE Staff Exit

Facility: **PROBATION BUILDING**
 Address: 1424 FORUM DR.


Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Walk						
2080	<ul style="list-style-type: none"> As-Built Description: Walk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps. As-Built: 8.8% Proposed Solution: Provide ramp with handrails on both (2) sides. 	PCODE EF01A ADAAG 4.8.1 ADA 2010 405.1 CBC 2010 1133B.7.3 CBC 2013 11B-405.1 Priority 2 Severity 4 TBD Contract Work	30	LF	\$260	\$7,800
						


6 Accessible Staff Parking

Floor or Ground Surfaces

2084	<ul style="list-style-type: none"> As-Built Description: Accessible parking space has slope greater than 1/4":12" (2%). As-Built: 3.0-3.6% Proposed Solution: Modify slope at accessible parking space. 	PCODE EA05 ADAAG 4.6.3 ADA 2010 502.4 CBC 2010 1129B.3.3 CBC 2013 11B-502.4 Priority 1 Severity 4 TBD Contract Work	162	SF	\$12	\$1,944
						

7 Accessible Staff Parking to West Staff Entrance


Cross Slope


2089	<ul style="list-style-type: none"> As-Built Description: Cross slope more than 1":48" (2.083%). As-Built: 3.6-3.9% Proposed Solution: Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 4 TBD Contract Work	168	SF	\$25	\$4,200
						


Facility: **PROBATION BUILDING**
 Address: 1424 FORUM DR.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Curb Ramp						
2086	<ul style="list-style-type: none"> As-Built Description: Side slopes more than 1:10 (10%). As-Built: 29% Proposed Solution: Modify curb ramp. Demolish side slopes and replace with 1:10 side slopes if 48" level top landing is provided. 	PCODE EH05A ADAAG 4.7.5 ADA 2010 406.3 CBC 2010 1127B.5.3 CBC 2013 11B-406.2.2 Priority 1 Severity 1 TBD Contract Work	1	JOB	\$2,000	\$2,000
						

Walk						
2091	<ul style="list-style-type: none"> As-Built Description: Walk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps. As-Built: 9.0% Proposed Solution: Provide ramp with handrails on both (2) sides. Notes: Landing 41" 	PCODE EF01A ADAAG 4.8.1 ADA 2010 405.1 CBC 2010 1133B.7.3 CBC 2013 11B-405.1 Priority 1 Severity 3 TBD Contract Work	30	LF	\$260	\$7,800
						

2090	<ul style="list-style-type: none"> As-Built Description: Walk more than 36" but less than 48" wide (required in CA only). As-Built: 42" Proposed Solution: Enlarge width of walk to 48". 	PCODE EF08REF ADA 2010 403.5 CBC 2010 1133B.7.1 CBC 2013 11B-403.5.1.3 Priority 1 Severity 4 TBD Contract Work	REF			
------	---	--	-----	---	--	--

Total Costs for	Part/floor: Exterior	On-site	\$73,118.00
------------------------	-----------------------------	----------------	--------------------

Facility: **PROBATION BUILDING**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1424 FORUM DR.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$73,118.00

Facility: **PROBATION BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1424 FORUM DR.

Year to be Completed: **TBD**


Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 West Office Corridors - Exit

Door

1901	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 3.0%-11.3% <i>Proposed Solution:</i> Modify surface slope at door. 	<p>PCODE ID11</p> <p>ADAAG 4.13.6</p> <p>ADA 2010 404.2.4.4</p> <p>CBC 2010 1133B.2.4</p> <p>CBC 2013 11B-404.2.4</p> <p>Priority 2</p> <p>Severity 1</p> <p>TBD Contract Work</p>	30	SF	\$40	\$1,200
------	--	--	----	----	------	---------

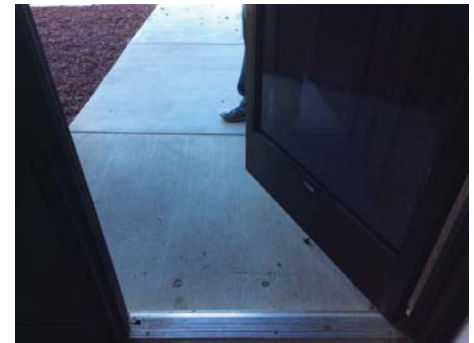

Door Threshold


1902	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door inaccessible due to threshold or step at door exceeding 1/2". <i>As-Built:</i> 1.75" <i>Proposed Solution:</i> Modify threshold to be no more than 1/2" by removing existing paving at door and providing landing with edge ramping (slope 1:20 max). 	<p>PCODE ID02AREF</p> <p>ADAAG 4.13.8</p> <p>ADA 2010 404.2.5</p> <p>CBC 2010 1133B.2.4.1</p> <p>CBC 2013 11B-404.2.5</p> <p>Priority 1</p> <p>Severity 3</p> <p>TBD Contract Work</p>				
------	---	--	--	--	--	--



4 Main Entrance Lobby

Corridor


1917	<ul style="list-style-type: none"> <i>As-Built Description:</i> Corridor, for occupant load less than 10, less than 36" wide. <i>As-Built:</i> 29" wide. 23" deep <i>Proposed Solution:</i> Enlarge corridor to 36" wide; relocate stud wall. <i>Notes:</i> Through security checkpoint 	<p>PCODE IH03NT</p> <p>ADAAG 4.3.3</p> <p>ADA 2010 403.5.1</p> <p>CBC 2010 1133B.3.1</p> <p>CBC 2013 11B-403.5.1</p> <p>Priority 1</p> <p>Severity 2</p> <p>TBD Contract Work</p>	2	LF	\$140	\$280
------	--	---	---	----	-------	-------

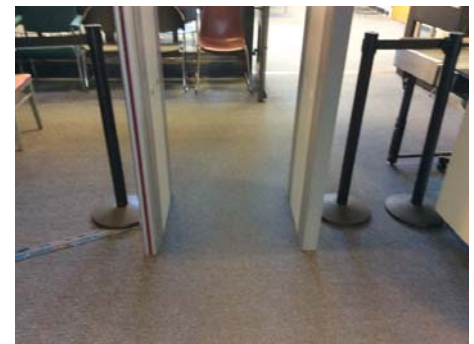


Facility: **PROBATION BUILDING**
 Address: 1424 FORUM DR.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Public Counter						
1915	<ul style="list-style-type: none"> <i>As-Built Description:</i> Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. <i>As-Built:</i> 41.25" <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. <i>Notes:</i> 1 for each dept. 	PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 3 TBD Contract Work	2	JOB	\$150	\$300
						

5 Main Entrance Lobby

Corridor						
1928	<ul style="list-style-type: none"> <i>As-Built Description:</i> Corridor, for occupant load less than 10, less than 36" wide. <i>As-Built:</i> 28" wide & 24" deep <i>Proposed Solution:</i> Enlarge corridor to 36" wide; relocate stud wall. 	PCODE IH03NT ADAAG 4.3.3 ADA 2010 403.5.1 CBC 2010 1133B.3.1 CBC 2013 11B-403.5.1 Priority 1 Severity 2 TBD Contract Work	2	LF	\$140	\$280
						

Drinking Fountain						
1939	<ul style="list-style-type: none"> <i>As-Built Description:</i> Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping. <i>Proposed Solution:</i> Provide additional fountain or hi-lo combination fountain. 	PCODE IA01A ADAAG 4.1.3(10)(a) ADA 2010 211.1 CBC 2010 1115B.4.6.1 CBC 2013 11B-211.1 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$2,000	\$2,000
						

Facility: **PROBATION BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1424 FORUM DR.

Year to be Completed: **TBD**


Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1938	<ul style="list-style-type: none"> <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain). Unit in good condition. <i>As-Built:</i> 23.75" <i>Proposed Solution:</i> Remount fountain at accessible height. 	<p>PCODE IA02A ADAAG 4.15.5(1) ADA 2010 602.2 CBC 2010 1115B.4.6.2 CBC 2013 11B-602.2 Priority 3 Severity 2 TBD Contract Work</p>	1	JOB	\$1,200	\$1,200



Fixed Bench


1931	<ul style="list-style-type: none"> <i>As-Built Description:</i> Clear floor or ground space (30" x 48") not overlapping with other clear space requirements, is not provided at at least one end of the bench. <i>Proposed Solution:</i> Provide and position clear floor or ground space to allow wheelchair users to be seated shoulder-to-shoulder with an individual seated on the bench. 	<p>PCODE NO07 ADAAG 4.32.2 ADA 2010 903.2 CBC 2010 1118B.4 CBC 2013 11B-903.2 Priority 2 Severity 2 TBD Contract Work</p>	1	JOB	\$500	\$500
------	---	--	---	-----	-------	-------

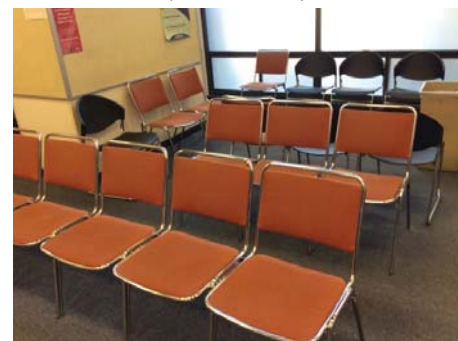

6 Juvenile Offices

Door Clearance

1935	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 29" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	<p>PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 2 Severity 3 TBD Contract Work</p>	5	JOB	\$2,600	\$13,000
------	---	--	---	-----	---------	----------

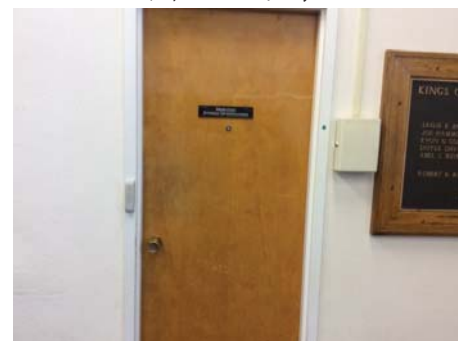

Facility: **PROBATION BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1424 FORUM DR.


Year to be Completed: **TBD**

Priority No: **3**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Restroom</u>						
1948	<ul style="list-style-type: none"> <i>As-Built Description:</i> Single accommodation restroom not accessible; multiple compliance violations. <i>Proposed Solution:</i> Remodel area to provide single-occupant accessible restroom. 	PCODE WA01 ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.2 CBC 2013 11B-603 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$30,000	\$30,000
						

7 Women's Public Restroom

Door Swing

1941	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". <i>As-Built:</i> 6" to lav <i>Proposed Solution:</i> Remodel as needed. 	PCODE ID23BREF ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 3 Severity 3 TBD Contract Work	REF			
						

Lavatory

1944	<ul style="list-style-type: none"> <i>As-Built Description:</i> Lavatory: Fixture rim or counter height more than 34" above floor. <i>As-Built:</i> 34.5" <i>Proposed Solution:</i> Remount compliant fixture at accessible height. <i>Notes:</i> Also protrusion 	PCODE WD02A ADAAG 4.19.2 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$900	\$900
						

Facility: **PROBATION BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Address: 1424 FORUM DR.


Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Toilet Stall						
1952	<ul style="list-style-type: none"> As-Built Description: Toilet stall less than 60" wide. As-Built: 41" wide Proposed Solution: Provide new accessible stall. Notes: Multiple items 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

8 Men's Public Restroom

Door Swing							
1958	<ul style="list-style-type: none"> As-Built Description: Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". As-Built: 6" to lav Proposed Solution: Remodel as needed. 	PCODE ID23BREF ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 3 Severity 3 TBD Contract Work	REF				

Restroom						
1957	<ul style="list-style-type: none"> As-Built Description: Multiple accommodation restroom not accessible; multiple compliance violations. As-Built: 41" Proposed Solution: Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens). 	PCODE WA01A ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.1 CBC 2013 11B-603 Priority 3 Severity 1 TBD Contract Work	1	JOB	\$35,000	\$35,000
						

Facility: **PROBATION BUILDING**
 Address: 1424 FORUM DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Urinal

- 1959
- *As-Built Description:*
CA only: Front of rim projects less than 13.5" from wall.
 - *As-Built:* 10"
 - *Proposed Solution:*
Provide accessible urinal. Remodel restroom as needed.

PCODE **WE01REF**
 ADA 2010 **605.2**
 CBC 2010 **1115B.4.2.1**
 CBC 2013 **11B-605.2**
 Priority **3**
 Severity **3**
 TBD **Contract Work**




9 East Wing South Corridor

Door

- 1974
- *As-Built Description:*
Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%).
 - *As-Built:* 8.6% at 40" from door
 - *Proposed Solution:*
Modify surface slope at door.

PCODE **ID11**
 ADAAG **4.13.6**
 ADA 2010 **404.2.4.4**
 CBC 2010 **1133B.2.4**
 CBC 2013 **11B-404.2.4**
 Priority **2**
 Severity **2**
 TBD **Contract Work**

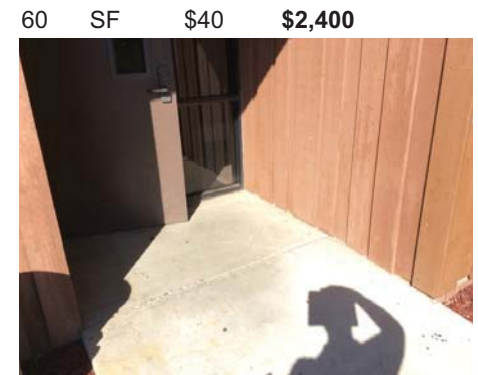

Drinking Fountain

- 1968
- *As-Built Description:*
Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping.
 - *Proposed Solution:*
Provide additional fountain or hi-lo combination fountain.

PCODE **IA01A**
 ADAAG **4.1.3(10)(a)**
 ADA 2010 **211.1**
 CBC 2010 **1115B.4.6.1**
 CBC 2013 **11B-211.1**
 Priority **3**
 Severity **2**
 TBD **Contract Work**



Facility: **PROBATION BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1424 FORUM DR.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1970	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. <i>Proposed Solution:</i> Provide fixed chair or object 	<p>PCODE IA04REF</p> <p>CBC 2010 1115B.4.6.3; Fig.</p> <p>CBC 2013 11B-602.9</p> <p>Priority 3</p> <p>Severity 2</p> <p>TBD Contract Work</p>				



10 East Wing North Corridor

Door

1991	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 10.3% at 40" from door <i>Proposed Solution:</i> Modify surface slope at door. 	<p>PCODE ID11</p> <p>ADAAG 4.13.6</p> <p>ADA 2010 404.2.4.4</p> <p>CBC 2010 1133B.2.4</p> <p>CBC 2013 11B-404.2.4</p> <p>Priority 2</p> <p>Severity 1</p> <p>TBD Contract Work</p>	30	SF	\$40	\$1,200



Drinking Fountain

1985	<ul style="list-style-type: none"> <i>As-Built Description:</i> Where only one drinking fountain is provided per floor: Fountain it is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping. <i>Proposed Solution:</i> Provide additional fountain or hi-lo combination fountain. 	<p>PCODE IA01AREF</p> <p>ADAAG 4.1.3(10)(a)</p> <p>ADA 2010 211.1</p> <p>CBC 2010 1115B.4.6.1</p> <p>CBC 2013 11B-211.1</p> <p>Priority 3</p> <p>Severity 2</p> <p>TBD Contract Work</p>				



Facility: **PROBATION BUILDING**

Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1424 FORUM DR.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1984	<ul style="list-style-type: none"> <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain). Unit in good condition. <i>As-Built:</i> Furniture items <i>Proposed Solution:</i> Remount fountain at accessible height. 	PCODE IA02A ADAAG 4.15.5(1) ADA 2010 602.2 CBC 2010 1115B.4.6.2 CBC 2013 11B-602.2 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$50	\$50
1986	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. <i>As-Built:</i> provide fixed object <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	PCODE IA04NT CBC 2010 1115B.4.6.3; Fig. CBC 2013 11B-602.9 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$3,000	\$3,000

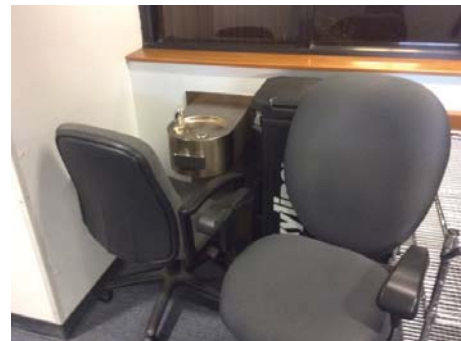

11 Staff Breakroom

Door Threshold

2002	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door inaccessible due to threshold or step at door exceeding 1/2". <i>As-Built:</i> 1" <i>Proposed Solution:</i> Modify threshold to be no more than 1/2" by removing existing paving at door and providing landing with edge ramping (slope 1:20 max). 	PCODE ID02A ADAAG 4.13.8 ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$400	\$400
------	--	---	---	-----	-------	-------



Facility: **PROBATION BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1424 FORUM DR.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Non-Fixed Desk</u>						
1999	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> 26" high knee <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

<u>Picnic Area</u>						
2003	<ul style="list-style-type: none"> <i>As-Built Description:</i> Knee clearance at minimums 27" high, 30" wide, and 19" deep is not provided. <i>As-Built:</i> 11" deep <i>Proposed Solution:</i> Modify picnic table as required to provide knee clearance. 	PCODE NH11A ADAAG 16.5.4. ADA 2010 902.2 CBC 2010 1132B.1 CBC 2013 11-902.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$850	\$850
						

<u>Sink</u>						
1995	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

Facility: **PROBATION BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1424 FORUM DR.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1996	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sink rim higher than 34" above floor. • <i>As-Built:</i> 36.5" • <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	<p>PCODE IN06REF</p> <p>ADAAG 4.24.2</p> <p>ADA 2010 606.3</p> <p>CBC 2010 1115B.4.7.1</p> <p>CBC 2013 11B-606.3</p> <p>Priority 4</p> <p>Severity 4</p> <p>TBD Contract Work</p>				

REF



12 Drug Testing Restroom

Grab Bars

2009	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Grab bars not provided or are not code compliant. • <i>Proposed Solution:</i> Provide accessible grab bars. 	<p>PCODE WB07</p> <p>ADAAG 4.17.6</p> <p>ADA 2010 604.5</p> <p>CBC 2010 1115B.4.1.3</p> <p>CBC 2013 11B-604.5</p> <p>Priority 2</p> <p>Severity 3</p> <p>TBD Contract Work</p>	1	JOB	\$500	\$500
------	---	--	---	-----	-------	-------



Lavatory

2010	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Wheelchair clearance under lavatory apron or lavatory counter front edge less than 29" high. • <i>As-Built:</i> 28.5" • <i>Proposed Solution:</i> Remount compliant fixture to accessible height. 	<p>PCODE WD03A</p> <p>ADAAG 4.19.2</p> <p>ADA 2010 606.3</p> <p>CBC 2010 1115B.4.3.3</p> <p>CBC 2013 11B-306.3.1</p> <p>Priority 2</p> <p>Severity 3</p> <p>TBD Contract Work</p>	1	JOB	\$1,500	\$1,500
------	--	---	---	-----	---------	---------



Facility: **PROBATION BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1424 FORUM DR.


Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Toilet Stall</u>						
2016	<ul style="list-style-type: none"> <i>As-Built Description:</i> The lavatory or other unintended fixture, encroaches on the necessary clearance around a water closet (60" x 56"). <i>As-Built:</i> 22" from WC 48" from sidewall <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet. 	PCODE WB01A ADA 2010 604.3.1; 604.3.2 CBC 2013 11B-604.3.1; 11B-604.3.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$2,000	\$2,000
						

<u>Water Closet</u>						
2014	<ul style="list-style-type: none"> <i>As-Built Description:</i> Water closet not 17"-18" from near side wall to center line of water closet (2010 ADAS: 16"-18"). <i>As-Built:</i> 19.5" o.c. <i>Proposed Solution:</i> Relocate existing water closet and plumbing, remount with offset closet flange to provide 17"-18" from side wall. 	PCODE WB02C ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 2 Severity 4 TBD Contract Work	1	JOB	\$500	\$500
						

13 Staff Men's Restroom

<u>Lavatory</u>							
2022	<ul style="list-style-type: none"> <i>As-Built Description:</i> Lavatory: Fixture rim or counter height more than 34" above floor. <i>As-Built:</i> 34.5" to lav rim <i>Proposed Solution:</i> Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD02REF ADAAG 4.19.2 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work	REF				

Facility: **PROBATION BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1424 FORUM DR.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2021	<ul style="list-style-type: none"> <i>As-Built Description:</i> Wheelchair clearance under lavatory apron or lavatory counter front edge less than 29" high. <i>As-Built:</i> 27" <i>Proposed Solution:</i> Provide new accessible lavatory. Remodel restroom as needed. 	<p>PCODE WD03 ADAAG 4.19.2 ADA 2010 606.3 CBC 2010 1115B.4.3.3 CBC 2013 11B-606.3 Priority 4 Severity 3 TBD Contract Work</p>	1	JOB	\$3,400	\$3,400



Toilet Stall

2033	<ul style="list-style-type: none"> <i>As-Built Description:</i> The lavatory or other unintended fixture, encroaches on the necessary clearance around a water closet (60" x 56"). <i>Proposed Solution:</i> Remove adjacent fixture and provide new enclosure at accessible water closet. 	<p>PCODE WB01A ADA 2010 604.3.1; 604.3.2 CBC 2013 11B-604.3.1; 11B-604.3.2 Priority 4 Severity 4 TBD Contract Work</p>	1	JOB	\$2,000	\$2,000
------	--	---	---	-----	---------	----------------




2031	<ul style="list-style-type: none"> <i>As-Built Description:</i> Toilet stall less than 60" wide. <i>As-Built:</i> 59.5" <i>Proposed Solution:</i> Provide new accessible stall. 	<p>PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 4 Severity 4 TBD Contract Work</p>	1	JOB	\$1,500	\$1,500
------	--	--	---	-----	---------	----------------




Facility: **PROBATION BUILDING**
 Address: 1424 FORUM DR.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Urinal</u>						
2026	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front of rim projects less than 13.5" from wall. <i>As-Built:</i> 12" deep <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE01 ADA 2010 605.2 CBC 2010 1115B.4.2.1 CBC 2013 11B-605.2 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$4,000	\$4,000
						

2025	<ul style="list-style-type: none"> <i>As-Built Description:</i> 36" wide clearance in front of accessible urinal not provided when walls or partitions project more than 24" from the front edge of 30" x 48" clear space. <i>As-Built:</i> 33" wide <i>Proposed Solution:</i> Provide 36" clear floor space in front of accessible urinal. Remodel restroom as needed. 	PCODE WE04A ADAAG 4.18.3 ADA 2010 605.3 CBC 2010 1115B.4.2.3 CBC 2013 11B-605.3 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
						


14 Staff Women's Restroom


<u>Cross Slope</u>						
2054	<ul style="list-style-type: none"> <i>As-Built Description:</i> Cross slope more than 1":48" (2.083%). <i>As-Built:</i> Slope around drain <i>Proposed Solution:</i> Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 4 Severity 4 TBD Contract Work	25	SF	\$25	\$625
						


Facility: **PROBATION BUILDING**
 Address: 1424 FORUM DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Lavatory						
2042	<ul style="list-style-type: none"> As-Built Description: Lavatory: Fixture rim or counter height more than 34" above floor. As-Built: 34.5" to rim Proposed Solution: Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD02 ADAAG 4.19.2 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$3,400	\$3,400
						

2040	<ul style="list-style-type: none"> As-Built Description: Wheelchair clearance under lavatory apron or lavatory counter front edge less than 29" high. As-Built: 27" Proposed Solution: Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD03 ADAAG 4.19.2 ADA 2010 606.3 CBC 2010 1115B.4.3.3 CBC 2013 11B-606.3 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$3,400	\$3,400
						


Water Closet						
2048	<ul style="list-style-type: none"> As-Built Description: Flush Control: Operating handle not mounted toward wide side of stall. Proposed Solution: Replace flush control with properly mounted accessible type, or install sensor flush. 	PCODE WB10 ADAAG 4.16.5 ADA 2010 604.6 CBC 2010 1115B.4.1.5 CBC 2013 11B-604.6 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
						

15 Conference Room

Facility: **PROBATION BUILDING**
 Address: 1424 FORUM DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Assistive Listening</u>						
2056	<ul style="list-style-type: none"> <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	PCODE GI01E ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work				
						REF
						

Total Costs for	Part/floor: Interior	Ground Floor	\$124,235.00
------------------------	-----------------------------	---------------------	---------------------

Facility: **PROBATION BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1424 FORUM DR.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Area: Interior \$124,235.00

Facility: **PROBATION BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1424 FORUM DR.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Facility: PROBATION BUILDING \$197,353.00

Facility: **SHERIFF ADMIN BLDG**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Accessible Parking Serving Sheriff Facilities


Floor or Ground Surfaces

2617	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space has slope greater than 1/4":12" (2%). <i>As-Built:</i> 3.2-3.5% <i>Proposed Solution:</i> Modify slope at accessible parking space. 	<p>PCODE EA05</p> <p>ADAAG 4.6.3</p> <p>ADA 2010 502.4</p> <p>CBC 2010 1129B.3.3</p> <p>CBC 2013 11B-502.4</p> <p>Priority 1</p> <p>Severity 4</p> <p>TBD Contract Work</p>	162	SF	\$12	\$1,944
------	---	---	-----	----	------	---------



Parking

2613	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space does not have 5' wide access aisle; 8' wide for van accessible aisle. <i>As-Built:</i> No aisle <i>Proposed Solution:</i> Modify parking aisle(s) to create accessible space by restriping. 	<p>PCODE EA02B</p> <p>ADAAG 4.6.3</p> <p>ADA 2010 502.3</p> <p>CBC 2010 1129B.3.1</p> <p>CBC 2013 11B-502.2; 11B-502.3.1</p> <p>Priority 1</p> <p>Severity 1</p> <p>TBD Contract Work</p>	1	JOB	\$200	\$200
------	---	---	---	-----	-------	-------

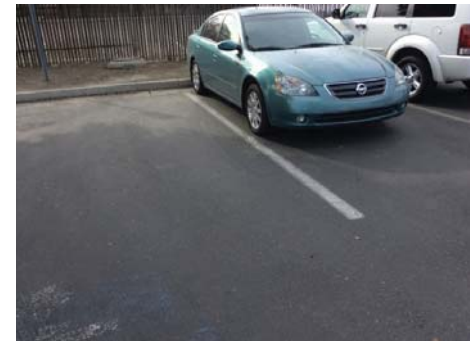

2612	<ul style="list-style-type: none"> <i>As-Built Description:</i> International Symbol of Accessibility (36" square, in white on blue) is not painted on the pavement near the rear end of the parking space (required in CA only). <i>As-Built:</i> Faded <i>Proposed Solution:</i> Apply symbol on parking space pavement when altering area. 	<p>PCODE EA04A</p> <p>CBC 2010 1129B.4</p> <p>CBC 2013 11B-502.6.4</p> <p>Priority 1</p> <p>Severity 4</p> <p>TBD Contract Work</p>	1	JOB	\$120	\$120
------	--	---	---	-----	-------	-------



2 POT from Driveway to Admin Buildings

Facility: **SHERIFF ADMIN BLDG**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1444 W. LACEY BLVD.


Year to be Completed: **TBD**

Priority No: **1**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Accessible Route

2628	<ul style="list-style-type: none"> As-Built Description: (CA requirement only) Abrupt changes in level, except between a walk or sidewalk and an adjacent street or driveway, exceeding 4" in depth must be identified by a 6" min. curb above the potential drop off. As-Built: 10"-27" drop between rails Proposed Solution: Provide a 6" curb as a warning curb for the blind or a handrail centered +/- 3" above finished surface. Notes: 27" drop 	<p>PCODE EG08</p> <p>CBC 2010 1133B.8.1</p> <p>CBC 2013 11B-303.5</p> <p>Priority 1</p> <p>Severity 1</p> <p>TBD Contract Work</p>	48	LF	\$45	\$2,160
------	---	--	----	----	------	---------




2626	<ul style="list-style-type: none"> As-Built Description: (CA requirement only) Abrupt changes in level, except between a walk or sidewalk and an adjacent street or driveway, exceeding 4" in depth must be identified by a 6" min. curb above the potential drop off. Proposed Solution: Provide a 6" curb as a warning curb for the blind or a handrail centered +/- 3" above finished surface. 	<p>PCODE EG08REF</p> <p>CBC 2010 1133B.8.1</p> <p>CBC 2013 11B-303.5</p> <p>Priority 1</p> <p>Severity 1</p> <p>TBD Contract Work</p>	REF			
------	---	---	-----	--	--	--



Changes in Level

2618	<ul style="list-style-type: none"> As-Built Description: Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route. As-Built: 0.75" Proposed Solution: Remove, replace or repair area of pavement sufficient to correct abrupt change in level. 	<p>PCODE EF03</p> <p>ADAAG 4.3.8</p> <p>ADA 2010 403.4</p> <p>CBC 2010 1133B.7.4</p> <p>CBC 2013 11B-403.4</p> <p>Priority 1</p> <p>Severity 4</p> <p>TBD Contract Work</p>	4	SF	\$21	\$84
------	--	---	---	----	------	------



Facility: **SHERIFF ADMIN BLDG**
 Address: 1444 W. LACEY BLVD.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Curb or Barrier

- 2623
- *As-Built Description:*
 Ramp: No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp.
 - *Proposed Solution:*
 Provide 2" minimum curb or wheel guide.

PCODE **EB14REF**
 ADAAG **4.8.7**
 ADA 2010 **405.9.2**
 CBC 2010 **1133B.5.6**
 CBC 2013 **11B-405.9.2**
 Priority **1**
 Severity **2**
TBD Contract Work

REF



Handrail

- 2625
- *As-Built Description:*
 Open guards does not have balusters or ornamental patterns such that a 4-inch-diameter (102 mm) sphere cannot pass through any opening.
 - *As-Built:* 8"
 - *Proposed Solution:*
 Provide new guards which do not allow passage of an 4 inch sphere at any opening.
 - **Notes:**
33" ht

PCODE **ED08A**
 ADA 2010 **405.9.2**
 CBC 2010 **1013.3**
 CBC 2013 **11B-405.9.2**
 Priority **1**
 Severity **3**
TBD Contract Work

70 LF \$120 **\$8,400**



Handrails

- 2622
- *As-Built Description:*
 Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas).
 - *Proposed Solution:*
 Provide new handrail for each side including extensions.

PCODE **ED01REF**
 ADAAG **4.8.5 & 4.9.4**
 ADA 2010 **505.2**
 CBC 2010 **1133B.4.1.1 & .5.5**
 CBC 2013 **11B-505.2**
 Priority **1**
 Severity **2**
TBD Contract Work


REF




Facility: **SHERIFF ADMIN BLDG**
 Address: 1444 W. LACEY BLVD.


Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Slope</u>						
2621	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Slope greater than 1:12 (8.3%). • <i>As-Built:</i> 7.8-10.4% • <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails. 	PCODE EB02 ADAAG 4.8.2 ADA 2010 405.2 CBC 2010 1133B.5.3 CBC 2013 11B-405.2 Priority 1 Severity 4 TBD Contract Work	240	SF	\$100	\$24,000
						

<u>Top and Bottom Extension at Ramps</u>							
2624	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. • <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). 	PCODE ED05REF ADAAG 4.8.5(2) ADA 2010 505.10.1 CBC 2010 1133B.4.2.2 & CBC 2013 11B-505.10.1 Priority 1 Severity 2 TBD Contract Work	REF				


3 Ramp & Stairs To Admin Building

<u>Change in Direction</u>						
2638	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Landing at change of direction not 60" minimum by 72" minimum in the direction of downward travel from the upper ramp run. • <i>As-Built:</i> 58" • <i>Proposed Solution:</i> Modify landing at change of direction to 60" x 72". 	PCODE EB08 ADAAG 4.8.4(3) ADA 2010 405.7.4 CBC 2010 1133B.5.4 CBC 2013 11B-405.7.4 Priority 1 Severity 4 TBD Contract Work	72	SF	\$45	\$3,240
						

Facility: **SHERIFF ADMIN BLDG**
 Address: 1444 W. LACEY BLVD.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Curb or Barrier</u>						
2635	<ul style="list-style-type: none"> <i>As-Built Description:</i> No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp. <i>As-Built:</i> Irregular surface <i>Proposed Solution:</i> Provide 2" minimum curb or wheel guide. 	PCODE EB14 ADAAG 4.8.7 ADA 2010 405.9.2 CBC 2010 1133B.5.6 CBC 2013 11B-405.9.2 Priority 1 Severity 2 TBD Contract Work	24	LF	\$17	\$408
						
2640	<ul style="list-style-type: none"> <i>As-Built Description:</i> Ramp: No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp. <i>Proposed Solution:</i> Provide 2" minimum curb or wheel guide. 	PCODE EB14REF ADAAG 4.8.7 ADA 2010 405.9.2 CBC 2010 1133B.5.6 CBC 2013 11B-405.9.2 Priority 3 Severity 2 TBD Contract Work	REF			
						
<u>Handrails</u>						
2633	<ul style="list-style-type: none"> <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas). <i>Proposed Solution:</i> Provide new handrail for each side including extensions. <i>Notes:</i> 6.1%-6.9% 	PCODE ED01 ADAAG 4.8.5 & 4.9.4 ADA 2010 505.2 CBC 2010 1133B.4.1.1 & .5.5 CBC 2013 11B-505.2 Priority 1 Severity 2 TBD Contract Work	24	LF	\$95	\$2,280
						

Facility: **SHERIFF ADMIN BLDG**




Area: **Exterior**

Part/Floor: **On-site**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2632	<ul style="list-style-type: none"> <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas). <i>As-Built:</i> Obstructed <i>Proposed Solution:</i> Provide new handrail for each side including extensions. 	<p>PCODE ED01REF ADAAG 4.8.5 & 4.9.4 ADA 2010 505.2 CBC 2010 1133B.4.1.1 & .5.5 CBC 2013 11B-505.2 Priority 1 Severity 2 TBD Contract Work</p>				
						REF
						
2639	<ul style="list-style-type: none"> <i>As-Built Description:</i> Handrail not provided at stairs or ramp, required on both sides (not required at curb ramps or adjacent to seating areas). <i>Proposed Solution:</i> Provide new handrail for each side including extensions. 	<p>PCODE ED01REF ADAAG 4.8.5 & 4.9.4 ADA 2010 505.2 CBC 2010 1133B.4.1.1 & .5.5 CBC 2013 11B-505.2 Priority 1 Severity 2 TBD Contract Work</p>				
						REF
						
	Height					
2637	<ul style="list-style-type: none"> <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. <i>As-Built:</i> 33"-34" <i>Proposed Solution:</i> Remove existing and provide new handrail. Notes: Lower portion 	<p>PCODE ED02 ADAAG 4.9.4(5) ADA 2010 505.4 CBC 2010 1133B.4.2.1 & CBC 2013 11B-505.4 Priority 1 Severity 4 TBD Contract Work</p>	12	LF	\$75	\$900
						

Facility: **SHERIFF ADMIN BLDG**




Area: **Exterior**

Part/Floor: **On-site**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2631	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-Built:</i> 32"-33" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	<p>PCODE ED02 ADAAG 4.9.4(5) ADA 2010 505.4 CBC 2010 1133B.4.2.1 & CBC 2013 11B-505.4 Priority 4 Severity 4 TBD Contract Work</p>	12	LF	\$75	\$900
						
2643	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. • <i>As-Built:</i> 33" • <i>Proposed Solution:</i> Remove existing and provide new handrail. 	<p>PCODE ED02 ADAAG 4.9.4(5) ADA 2010 505.4 CBC 2010 1133B.4.2.1 & CBC 2013 11B-505.4 Priority 4 Severity 4 TBD Contract Work</p>	10	LF	\$75	\$750
						
<u>Top & Bottom Extension at Stairs</u>						
2630	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Stair handrail does not extend horizontally 12" minimum beyond top nosing, and one tread width sloped, plus 12" minimum horizontally beyond the bottom nosing. • <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for each extension piece). 	<p>PCODE ED06 ADAAG 4.9.4(2) ADA 2010 505.10.2; 505.10.3 CBC 2010 1133B.4.2.2 CBC 2013 11B-505.10.2; 11B-505.10.3 Priority 4 Severity 2 TBD Contract Work</p>	4	JOB	\$170	\$680
						

Facility: **SHERIFF ADMIN BLDG**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2644	<ul style="list-style-type: none"> <i>As-Built Description:</i> Stair handrail does not extend horizontally 12" minimum beyond top nosing, and one tread width sloped, plus 12" minimum horizontally beyond the bottom nosing. <i>As-Built:</i> does not continue one tread width <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for each extension piece). 	<p>PCODE ED06 ADAAG 4.9.4(2) ADA 2010 505.10.2; 505.10.3 CBC 2010 1133B.4.2.2 CBC 2013 11B-505.10.2; 11B-505.10.3 Priority 4 Severity 2 TBD Contract Work</p>	1	JOB	\$170	\$170



2642	<ul style="list-style-type: none"> <i>As-Built Description:</i> Stair handrail does not extend horizontally 12" minimum beyond top nosing, and one tread width sloped, plus 12" minimum horizontally beyond the bottom nosing. <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for each extension piece). 	<p>PCODE ED06REF ADAAG 4.9.4(2) ADA 2010 505.10.2; 505.10.3 CBC 2010 1133B.4.2.2 CBC 2013 11B-505.10.2; 11B-505.10.3 Priority 4 Severity 2 TBD Contract Work</p>	REF			
------	---	--	-----	--	--	--



Top and Bottom Extension at Ramps

2636	<ul style="list-style-type: none"> <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). 	<p>PCODE ED05 ADAAG 4.8.5(2) ADA 2010 505.10.1 CBC 2010 1133B.4.2.2 & CBC 2013 11B-505.10.1 Priority 1 Severity 2 TBD Contract Work</p>	1	JOB	\$170	\$170
------	---	---	---	-----	-------	-------





4 POT from Street


Facility: **SHERIFF ADMIN BLDG**
 Address: 1444 W. LACEY BLVD.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Accessible Route</u>						
2647	<ul style="list-style-type: none"> <i>As-Built Description:</i> No walk / sidewalk provided to connect accessible facilities or elements that are on the same site. <i>Proposed Solution:</i> Provide new 48" wide walk / sidewalk. 	PCODE EF13 ADAAG 4.3.2 ADA 2010 206.1 CBC 2010 1114B.1.2 CBC 2013 11B-206.1 Priority 1 Severity 1 TBD Contract Work	15	LF	\$45	\$675
						

<u>Picnic Area</u>						
2648	<ul style="list-style-type: none"> <i>As-Built Description:</i> Knee clearance at minimums 27" high, 30" wide, and 19" deep is not provided. <i>As-Built:</i> 14" deep <i>Proposed Solution:</i> Modify picnic table as required to provide knee clearance. 	PCODE NH11A ADAAG 16.5.4. ADA 2010 902.2 CBC 2010 1132B.1 CBC 2013 11-902.2 Priority 1 Severity 2 TBD Contract Work	1	JOB	\$850	\$850
						

<u>Walk</u>						
2645	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk more than 36" but less than 48" wide (required in CA only). <i>As-Built:</i> 36" <i>Proposed Solution:</i> Enlarge width of walk to 48". 	PCODE EF08 CBC 2010 1133B.7.1 CBC 2013 11B-403.5.1.3 Priority 1 Severity 3 TBD Contract Work	220	SF	\$45	\$9,900
						

5 Accessible Space in Secured Staff Lot

Facility: **SHERIFF ADMIN BLDG**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Floor or Ground Surfaces

2651	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space has slope greater than 1/4":12" (2%). <i>As-Built:</i> Irregular surface <i>Proposed Solution:</i> Modify slope at accessible parking space. 	PCODE EA05 ADAAG 4.6.3 ADA 2010 502.4 CBC 2010 1129B.3.3 CBC 2013 11B-502.4 Priority 1 Severity 4 TBD Contract Work	162	SF	\$12	\$1,944
------	--	--	-----	----	------	---------



Parking

2649	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space does not have 5' wide access aisle; 8' wide for van accessible aisle. <i>Proposed Solution:</i> Modify parking aisle(s) to create accessible space by restriping. 	PCODE EA02B ADAAG 4.6.3 ADA 2010 502.3 CBC 2010 1129B.3.1 CBC 2013 11B-502.2; 11B-502.3.1 Priority 1 Severity 1 TBD Contract Work	1	JOB	\$200	\$200
------	--	--	---	-----	-------	-------



Total Costs for	Part/floor: Exterior	On-site	\$59,975.00
------------------------	-----------------------------	----------------	--------------------

Facility: **SHERIFF ADMIN BLDG**

Area: **Exterior**

Part/Floor: **On-site**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$59,975.00

Facility: **SHERIFF ADMIN BLDG**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Sheriff Operations Building Entrance & Lobby

Door

1808

- *As-Built Description:*
Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%).
- *As-Built:* 7.2%
- *Proposed Solution:*
Modify surface slope at door.

PCODE ID11
 ADAAG 4.13.6
 ADA 2010 404.2.4.4
 CBC 2010 1133B.2.4
 CBC 2013 11B-404.2.4
 Priority 1
 Severity 2
 TBD Contract Work

50 SF \$40 \$2,000



3 Women's Restroom

Toilet Stall

1831

- *As-Built Description:*
Toilet stall less than 60" wide.
- *As-Built:* 59"
- *Proposed Solution:*
Provide new accessible stall.

PCODE WB06
 ADAAG 4.17.3
 ADA 2010 604.8.1.1
 CBC 2010 1115B.3.1.4.1
 CBC 2013 11B-604.8.1.1
 Priority 3
 Severity 4
 TBD Contract Work

1 JOB \$1,500 \$1,500



Water Closet

1834

- *As-Built Description:*
Water closet not 17"-18" from near side wall to center line of water closet (2010 ADAS: 16"-18").
- *As-Built:* 19" o.c.
- *Proposed Solution:*
Relocate existing water closet and plumbing, remount with offset closet flange to provide 17"-18" from side wall.

PCODE WB02C
 ADAAG Fig. 28
 ADA 2010 604.2
 CBC 2010 1115B.4.1.1
 CBC 2013 11B-604.2
 Priority 3
 Severity 4
 TBD Contract Work

1 JOB \$500 \$500



Facility: **SHERIFF ADMIN BLDG**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1835	<ul style="list-style-type: none"> <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor. <i>As-Built:</i> 19.5" <i>Proposed Solution:</i> Provide new accessible water closet. 	<p>PCODE WB08 ADAAG 4.16.3 ADA 2010 604.4 CBC 2010 1115B.4.1.4 CBC 2013 11B-604.4 Priority 3 Severity 4 TBD Contract Work</p>	1	JOB	\$1,400	\$1,400



4 Men's Restroom

Toilet Stall

1856	<ul style="list-style-type: none"> <i>As-Built Description:</i> Toilet stall less than 60" wide. <i>As-Built:</i> Seat in clear space <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	<p>PCODE WB06NT ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 3 Severity 4 TBD Contract Work</p>	1	JOB	\$1,500	\$1,500
------	--	--	---	-----	---------	----------------



Urinal




1849	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front of rim projects less than 13.5" from wall. <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	<p>PCODE WE01 ADA 2010 605.2 CBC 2010 1115B.4.2.1 CBC 2013 11B-605.2 Priority 3 Severity 4 TBD Contract Work</p>	1	JOB	\$4,000	\$4,000
------	---	---	---	-----	---------	----------------



Facility: **SHERIFF ADMIN BLDG**
 Address: 1444 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Water Closet						
1851	<ul style="list-style-type: none"> <i>As-Built Description:</i> Water closet not 17"-18" from near side wall to center line of water closet (2010 ADAS: 16"-18"). <i>As-Built:</i> 18.75" o.c. <i>Proposed Solution:</i> Relocate existing water closet and plumbing, remount with offset closet flange to provide 17"-18" from side wall. 	PCODE WB02C ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$500	\$500
						
1852	<ul style="list-style-type: none"> <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor. <i>As-Built:</i> 19.5" <i>Proposed Solution:</i> Provide new accessible water closet. 	PCODE WB08 ADAAG 4.16.3 ADA 2010 604.4 CBC 2010 1115B.4.1.4 CBC 2013 11B-604.4 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$1,400	\$1,400
						
1850	<ul style="list-style-type: none"> <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall. <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type, or install sensor flush. 	PCODE WB10 ADAAG 4.16.5 ADA 2010 604.6 CBC 2010 1115B.4.1.5 CBC 2013 11B-604.6 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
						


5 Interrogation Room

Facility: **SHERIFF ADMIN BLDG**
 Address: 1444 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Clearance</u>						
1859	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 29" clear <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 2 Severity 3 TBD Contract Work	1	JOB	\$2,600	\$2,600
						

<u>Non-Fixed Desk</u>						
1860	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> 25" high knee <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

6 General Staff Corridors

<u>Corridor</u>						
1862	<ul style="list-style-type: none"> <i>As-Built Description:</i> Corridor less than 36" wide. <i>As-Built:</i> 35" <i>Proposed Solution:</i> Enlarge corridor to 36" wide; relocate stud wall. 	PCODE IH03 ADAAG 4.3.3 ADA 2010 403.5.1 CBC 2010 1133B.3.1 CBC 2013 11B-403.5.1 Priority 2 Severity 3 TBD Contract Work	8	LF	\$140	\$1,120
						

Facility: **SHERIFF ADMIN BLDG**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Door Clearance

1865	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 2 Severity 3 TBD Contract Work	8	JOB	\$2,600	\$20,800
------	---	---	---	-----	---------	----------



Locker Facilities

1878	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible locker(s) in dressing room not provided (5% of lockers; not less than one). <i>As-Built:</i> Large ones not acc. <i>Proposed Solution:</i> Provide new locker(s) with accessible locking hardware that is operable with one hand and does not require grasping, pinching or twisting. <i>Notes:</i> provide if requested. 	PCODE GG04 ADAAG 4.1.3(12)(a) ADA 2010 222.1 CBC 2010 1115B.8.5 CBC 2013 11B-222.1 Priority 2 Severity 3 TBD Contract Work	1	JOB	\$750	\$750
------	---	---	---	-----	-------	-------



7 Intake & Staff Entry

Door Threshold


1871	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door inaccessible due to threshold or step at door more than 6" high. <i>As-Built:</i> 6" <i>Proposed Solution:</i> Provide ramp including handrails and compliant landings, matching floor level inside door (+/-1/4"). 	PCODE ID02B ADAAG 4.8.5 ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 4 Severity 1 TBD Contract Work	50	SF	\$100	\$5,000
------	---	---	----	----	-------	---------




Facility: **SHERIFF ADMIN BLDG**
 Address: 1444 W. LACEY BLVD.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Ramp						
1869	<ul style="list-style-type: none"> As-Built Description: Ramp: Slope not steep but greater than 1:20 (5.0%) without handrails. Proposed Solution: Provide steel handrails for ramp. 	PCODE EB03REF ADAAG 4.8.1 ADA 2010 405.1 CBC 2010 1133B.5.5.1 CBC 2013 11B-405.8 Priority 4 Severity 4 TBD Contract Work				
						REF
						

Slope						
1868	<ul style="list-style-type: none"> As-Built Description: Slope greater than 1:12 (8.3%). As-Built: 10.1% Proposed Solution: Demolish existing and provide new ramp with handrails. 	PCODE EB02 ADAAG 4.8.2 ADA 2010 405.2 CBC 2010 1133B.5.3 CBC 2013 11B-405.2 Priority 1 Severity 4 TBD Contract Work	40	SF	\$100	\$4,000
						

8 Staff Breakroom

Sink						
1872	<ul style="list-style-type: none"> As-Built Description: Sink does not have knee space min. 27" high x 19" deep x 30" wide. Proposed Solution: Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

Facility: **SHERIFF ADMIN BLDG**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1873	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sink rim higher than 34" above floor. • <i>As-Built:</i> 36" • <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	<p>PCODE IN06REF</p> <p>ADAAG 4.24.2</p> <p>ADA 2010 606.3</p> <p>CBC 2010 1115B.4.7.1</p> <p>CBC 2013 11B-606.3</p> <p>Priority 4</p> <p>Severity 4</p> <p>TBD Contract Work</p>				



9 Restroom Corridor


Door Clearance

1876	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. • <i>As-Built:</i> 29" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	<p>PCODE ID01</p> <p>ADAAG 4.13.5</p> <p>ADA 2010 404.2.3</p> <p>CBC 2010 1133B.1.1.1.1</p> <p>CBC 2013 11B-404.2.3</p> <p>Priority 3</p> <p>Severity 3</p> <p>TBD Contract Work</p>	1	JOB	\$2,600	\$2,600



Door Swing

1884	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". • <i>As-Built:</i> 9" • <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed. 	<p>PCODE ID23B</p> <p>ADAAG Fig. 25(a)</p> <p>ADA 2010 404.2.4</p> <p>CBC 2010 11B-26A(a)</p> <p>CBC 2013 11B-404.2.4</p> <p>Priority 3</p> <p>Severity 3</p> <p>TBD Contract Work</p>	1	JOB	\$2,600	\$2,600

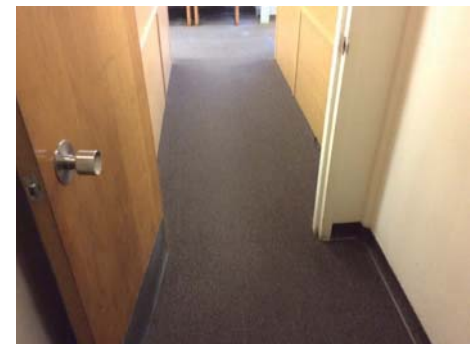

Facility: **SHERIFF ADMIN BLDG**




Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Drinking Fountain</u>						
1882	<ul style="list-style-type: none"> <i>As-Built Description:</i> Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping. <i>Proposed Solution:</i> Provide additional fountain or hi-lo combination fountain. 	PCODE IA01A ADAAG 4.1.3(10)(a) ADA 2010 211.1 CBC 2010 1115B.4.6.1 CBC 2013 11B-211.1 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$2,000	\$2,000
						
1883	<ul style="list-style-type: none"> <i>As-Built Description:</i> Drinking fountain is not 18" - 19" in depth. <i>As-Built:</i> 8" deep <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA02B ADAAG 4.15.5(1) ADA 2010 602.8 CBC 2010 1115B.4.6.2 CBC 2013 11B-602.8 Priority 3 Severity 1 TBD Contract Work	1	JOB	\$3,200	\$3,200
						
1881	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	PCODE IA04 CBC 2010 1115B.4.6.3; Fig. CBC 2013 11B-602.9 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$3,000	\$3,000
						

10 Staff Men's Restroom

Facility: **SHERIFF ADMIN BLDG**
 Address: 1444 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Door Clearance

- 1888
- *As-Built Description:*
 Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open.
 - *As-Built:* 29"
 - *Proposed Solution:*
 Provide new, larger door and frame with new accessible hardware.

PCODE ID01REF
 ADAAG 4.13.5
 ADA 2010 404.2.3
 CBC 2010 1133B.1.1.1.1
 CBC 2013 11B-404.2.3
 Priority 4
 Severity 3
 TBD Contract Work

REF



Lavatory

- 1889
- *As-Built Description:*
 Wheelchair clearance under lavatory apron or lavatory counter front edge less than 29" high.
 - *As-Built:* 26.5"
 - *Proposed Solution:*
 Provide new accessible lavatory. Remodel restroom as needed.

PCODE WD03REF
 ADAAG 4.19.2
 ADA 2010 606.3
 CBC 2010 1115B.4.3.3
 CBC 2013 11B-606.3
 Priority 4
 Severity 3
 TBD Contract Work

REF




Restroom

- 1887
- *As-Built Description:*
 Multiple accommodation restroom not accessible; multiple compliance violations.
 - *Proposed Solution:*
 Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens).

PCODE WA01A
 ADAAG 4.22
 ADA 2010 603
 CBC 2010 1115B.3.1
 CBC 2013 11B-603
 Priority 4
 Severity 1
 TBD Contract Work

1 JOB \$35,000 \$35,000

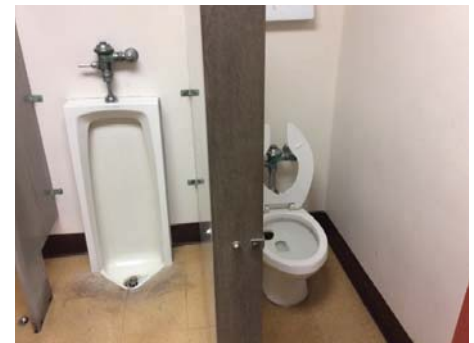

11 Staff Women's Restroom

Facility: **SHERIFF ADMIN BLDG**
 Address: 1444 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Door Clearance

- 1891
- *As-Built Description:*
 Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open.
 - *As-Built:* 29" wide
 - *Proposed Solution:*
 Provide new, larger door and frame with new accessible hardware.

PCODE ID01REF
 ADAAG 4.13.5
 ADA 2010 404.2.3
 CBC 2010 1133B.1.1.1.1
 CBC 2013 11B-404.2.3
 Priority 4
 Severity 3
 TBD Contract Work

REF



Lavatory

- 1892
- *As-Built Description:*
 Wheelchair clearance under lavatory apron or lavatory counter front edge less than 29" high.
 - *As-Built:* 26"
 - *Proposed Solution:*
 Provide new accessible lavatory. Remodel restroom as needed.

PCODE WD03REF
 ADAAG 4.19.2
 ADA 2010 606.3
 CBC 2010 1115B.4.3.3
 CBC 2013 11B-606.3
 Priority 4
 Severity 3
 TBD Contract Work

REF



Restroom

- 1890
- *As-Built Description:*
 Multiple accommodation restroom not accessible; multiple compliance violations.
 - *As-Built:* 35" wide
 - *Proposed Solution:*
 Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens).

PCODE WA01A
 ADAAG 4.22
 ADA 2010 603
 CBC 2010 1115B.3.1
 CBC 2013 11B-603
 Priority 4
 Severity 1
 TBD Contract Work

1 JOB \$35,000 \$35,000



Total Costs for	Part/floor: Interior	Ground Floor	\$134,320.00
------------------------	-----------------------------	---------------------	---------------------

Facility: **SHERIFF ADMIN BLDG**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$134,320.00

Facility: **SHERIFF ADMIN BLDG**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: SHERIFF ADMIN BLDG					\$194,295.00
------------------------	-------------------------------------	--	--	--	--	---------------------

Facility: **SHERIFF'S ADMINISTRATION**
 Address: 1444 W. LACEY BLVD.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Administration Entrance & Lobby

Door

1732

- *As-Built Description:*
Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%).
- *As-Built:* 4.4%
- *Proposed Solution:*
Modify surface slope at door.

PCODE **ID11**
 ADAAG **4.13.6**
 ADA 2010 **404.2.4.4**
 CBC 2010 **1133B.2.4**
 CBC 2013 **11B-404.2.4**
 Priority **1**
 Severity **3**
TBD Contract Work

50 SF \$40 **\$2,000**



Public Counter

1737

- *As-Built Description:*
Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.
- *As-Built:* Records 43.5"
- *Proposed Solution:*
Provide auxiliary shelf, clipboard, or table as equivalent facilitation.

PCODE **IN03**
 ADAAG **7.2(2)**
 ADA 2010 **904.4**
 CBC 2010 **1122B.4**
 CBC 2013 **11B-904.4**
 Priority **1**
 Severity **3**
TBD Contract Work

1 JOB \$150 **\$150**



1739

- *As-Built Description:*
Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.
- *As-Built:* 42"
- *Proposed Solution:*
Provide auxiliary shelf, clipboard, or table as equivalent facilitation.

PCODE **IN03**
 ADAAG **7.2(2)**
 ADA 2010 **904.4**
 CBC 2010 **1122B.4**
 CBC 2013 **11B-904.4**
 Priority **1**
 Severity **3**
TBD Contract Work

1 JOB \$150 **\$150**



4 Staff Breakroom

Facility: **SHERIFF'S ADMINISTRATION**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **TBD**


Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Sink						
1762	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 36.25" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06 ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

1761	<ul style="list-style-type: none"> As-Built Description: Sink does not have knee space min. 27" high x 19" deep x 30" wide. Proposed Solution: Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

5 Civil Office

Door Clearance

1763	<ul style="list-style-type: none"> As-Built Description: Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. As-Built: 29" Proposed Solution: Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 2 Severity 3 TBD Contract Work	1	JOB	\$2,600	\$2,600
						

6 Staff Men's Restroom

Facility: **SHERIFF'S ADMINISTRATION**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1444 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Swing</u>						
1785	<ul style="list-style-type: none"> As-Built Description: Latch approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 24" x 48" or 54" if door has closer (CA only: door width plus 24" x 60"). As-Built: Stall door: 46" Proposed Solution: Remodel restroom as needed. 	PCODE ID27BNT ADAAG Fig. 25(c) ADA 2010 404.2.4 CBC 2010 11B-26A(c) CBC 2013 11B-404.2.4 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

<u>Grab Bars</u>						
1779	<ul style="list-style-type: none"> As-Built Description: Grab bars not provided or are not code compliant. Proposed Solution: Provide accessible grab bars. 	PCODE WB07 ADAAG 4.17.6 ADA 2010 604.5 CBC 2010 1115B.4.1.3 CBC 2013 11B-604.5 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
						

<u>Lavatory</u>						
1774	<ul style="list-style-type: none"> As-Built Description: Lavatory: Fixture rim or counter height more than 34" above floor. As-Built: 36.25" Proposed Solution: Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD02 ADAAG 4.19.2 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$3,400	\$3,400
						

Facility: **SHERIFF'S ADMINISTRATION**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Toilet Stall

- 1777
- *As-Built Description:*
Toilet stall less than 60" wide.
 - *As-Built:* 38" wide
 - *Proposed Solution:*
Provide new accessible stall.

PCODE **WB06**
 ADAAG **4.17.3**
 ADA 2010 **604.8.1.1**
 CBC 2010 **1115B.3.1.4.1**
 CBC 2013 **11B-604.8.1.1**
 Priority **4**
 Severity **2**
TBD Contract Work

1 JOB \$1,500 **\$1,500**



Urinal

- 1782
- *As-Built Description:*
Fixture mounted with rim more than 17" above floor.
 - *As-Built:* 23"
 - *Proposed Solution:*
Provide accessible urinal. Remodel restroom as needed.

PCODE **WE02**
 ADAAG **4.18.2**
 ADA 2010 **605.2**
 CBC 2010 **1115B.4.2.1**
 CBC 2013 **11B-605.2**
 Priority **4**
 Severity **2**
TBD Contract Work

1 JOB \$2,400 **\$2,400**



- 1783
- *As-Built Description:*
Fixture mounted with rim more than 17" above floor.
 - *As-Built:* 12"
 - *Proposed Solution:*
Provide accessible urinal. Remodel restroom as needed.

PCODE **WE02REF**
 ADAAG **4.18.2**
 ADA 2010 **605.2**
 CBC 2010 **1115B.4.2.1**
 CBC 2013 **11B-605.2**
 Priority **4**
 Severity **3**
TBD Contract Work

REF



Facility: **SHERIFF'S ADMINISTRATION**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **TBD**


Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
1784	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Urinal flush control lever more than 48" above floor (CA only: 44" max.). • <i>As-Built:</i> 51" • <i>Proposed Solution:</i> Provide accessible urinal flush control. 	<p>PCODE WE03REF</p> <p>ADAAG 4.18.4</p> <p>ADA 2010 605.4</p> <p>CBC 2010 1115B.4.2.2</p> <p>CBC 2013 11B-605.4</p> <p>Priority 4</p> <p>Severity 3</p> <p>TBD Contract Work</p>				
1781	<ul style="list-style-type: none"> • <i>As-Built Description:</i> 36" wide clearance in front of accessible urinal not provided when walls or partitions project more than 24" from the front edge of 30" x 48" clear space. • <i>As-Built:</i> 30.5" • <i>Proposed Solution:</i> Provide 36" clear floor space in front of accessible urinal. Remodel restroom as needed. 	<p>PCODE WE04A</p> <p>ADAAG 4.18.3</p> <p>ADA 2010 605.3</p> <p>CBC 2010 1115B.4.2.3</p> <p>CBC 2013 11B-605.3</p> <p>Priority 4</p> <p>Severity 2</p> <p>TBD Contract Work</p>	1	JOB	\$1,500	\$1,500



Water Closet

1780	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor. • <i>As-Built:</i> 15.5" • <i>Proposed Solution:</i> Provide new accessible water closet. 	<p>PCODE WB08</p> <p>ADAAG 4.16.3</p> <p>ADA 2010 604.4</p> <p>CBC 2010 1115B.4.1.4</p> <p>CBC 2013 11B-604.4</p> <p>Priority 4</p> <p>Severity 4</p> <p>TBD Contract Work</p>	1	JOB	\$1,400	\$1,400

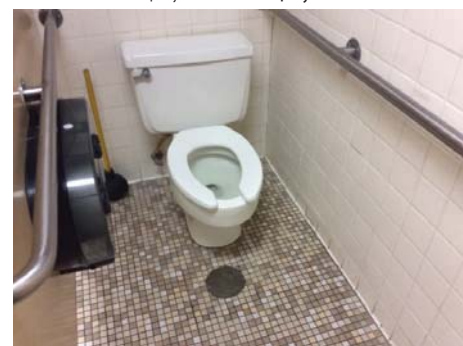

7 Staff Women's Restroom

Facility: **SHERIFF'S ADMINISTRATION**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.


Year to be Completed: **TBD**

Priority No: **4**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Door Swing

1791	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". • <i>As-Built:</i> 17.75" -18" • <i>Proposed Solution:</i> Modify tiling. 	<p>PCODE ID23BNT ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 4 Severity 4 TBD Contract Work</p>	1	JOB	\$260	\$260
------	--	--	---	-----	-------	-------




1793	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18"(CA only: 24" at exterior doors)x 60". • <i>As-Built:</i> 59" to bracing • <i>Proposed Solution:</i> Remodel restroom as needed. 	<p>PCODE ID23REF ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 4 Severity 4 TBD Contract Work</p>		REF		
------	---	--	--	-----	--	--



Grab Bars

1804	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Grab bars not provided or are not code compliant. • <i>Proposed Solution:</i> Provide accessible grab bars. 	<p>PCODE WB07 ADAAG 4.17.6 ADA 2010 604.5 CBC 2010 1115B.4.1.3 CBC 2013 11B-604.5 Priority 4 Severity 3 TBD Contract Work</p>	1	JOB	\$500	\$500
------	---	--	---	-----	-------	-------



Facility: **SHERIFF'S ADMINISTRATION**




Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Lavatory						
1794	<ul style="list-style-type: none"> As-Built Description: Lavatory: Fixture rim or counter height more than 34" above floor. As-Built: 36" Proposed Solution: Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD02 ADAAG 4.19.2 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$3,400	\$3,400
						
1795	<ul style="list-style-type: none"> As-Built Description: Knee clearance 27" min. high starting 8" back from the front edge of the lavatory towards the wall is not provided. As-Built: Storage items. Proposed Solution: Provide new accessible lavatory. Remodel restroom as needed. Notes: Relocate if required 	PCODE WD04REF ADAAG Fig. 31 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-306.3.3 Priority 4 Severity 2 TBD Contract Work				REF
						
1796	<ul style="list-style-type: none"> As-Built Description: Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory. Proposed Solution: Provide accessible faucet at accessible lavatory. 	PCODE WD06 ADAAG 4.19.5 ADA 2010 606.4 CBC 2010 1115B.4.3 CBC 2013 11B-606.4 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$600	\$600
						

Facility: **SHERIFF'S ADMINISTRATION**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 1444 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Toilet Stall</u>						
1801	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet stall less than 60" wide. • <i>As-Built:</i> 38" • <i>Proposed Solution:</i> Provide new accessible stall. 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

<u>Water Closet</u>						
1802	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor. • <i>As-Built:</i> 16.5" • <i>Proposed Solution:</i> Provide new accessible water closet. 	PCODE WB08 ADAAG 4.16.3 ADA 2010 604.4 CBC 2010 1115B.4.1.4 CBC 2013 11B-604.4 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$1,400	\$1,400
						

1803	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall. • <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type, or install sensor flush. 	PCODE WB10 ADAAG 4.16.5 ADA 2010 604.6 CBC 2010 1115B.4.1.5 CBC 2013 11B-604.6 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
						

8 Background Investigations Restroom - Staff Only

Facility: **SHERIFF'S ADMINISTRATION**


Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Restroom</u>						
1806	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Single accommodation restroom not accessible; multiple compliance violations. • <i>As-Built:</i> 28" to RR • <i>Proposed Solution:</i> Remodel area to provide single-occupant accessible restroom. • <i>Notes:</i> Staff RR 	<p>PCODE WA01 ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.2 CBC 2013 11B-603 Priority 4 Severity 2 TBD Contract Work</p>	1	JOB	\$30,000	\$30,000
						

Total Costs for	Part/floor: Interior	Ground Floor	\$58,860.00
------------------------	-----------------------------	---------------------	--------------------

Facility: **SHERIFF'S ADMINISTRATION**
Address: 1444 W. LACEY BLVD.

Area: **Interior**
Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Area: Interior \$58,860.00

Facility: **SHERIFF'S ADMINISTRATION**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 1444 W. LACEY BLVD.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Facility: SHERIFF'S ADMINISTRATION \$58,860.00

Facility: **FIRE ADMIN**

Area: **Exterior**

Part/Floor: **On-site**

Address: 280 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Accessible Parking

Floor or Ground Surfaces

2914	<ul style="list-style-type: none"> <i>As-Built Description:</i> Access aisle at accessible parking space has slope greater than 1/4":12" (2%) due to built-up curb ramp within aisle. <i>As-Built:</i> 7.8% <i>Proposed Solution:</i> Provide curb cut. 	<p>PCODE EA05A ADAAG 4.6.3 ADA 2010 502.4 CBC 2010 1129B.3.3 CBC 2013 11B-502.4 Priority 1 Severity 2 TBD Contract Work</p>	1	JOB	\$2,500	\$2,500
------	--	---	---	-----	---------	---------



Parking


2916	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space smaller than 8' wide (CA only: 9' x 18'). <i>As-Built:</i> 17'10" long <i>Proposed Solution:</i> Modify parking space(s) to create accessible space. 	<p>PCODE EA02A ADAAG 4.6.3 ADA 2010 502.2 CBC 2010 1129B.3.1 CBC 2013 11B-502.2 Priority 1 Severity 4 TBD Contract Work</p>	1	JOB	\$200	\$200
------	--	---	---	-----	-------	-------



2 Side & Rear Exit Paths

Door Swing

2918	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18"(CA only: 24" at exterior doors)x 60". <i>As-Built:</i> 48" <i>Proposed Solution:</i> Extend maneuvering space. <i>Notes:</i> Enlarge sidewalk. 	<p>PCODE ID23D ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 3 Severity 3 TBD Contract Work</p>	1	JOB	\$800	\$800
------	--	---	---	-----	-------	-------

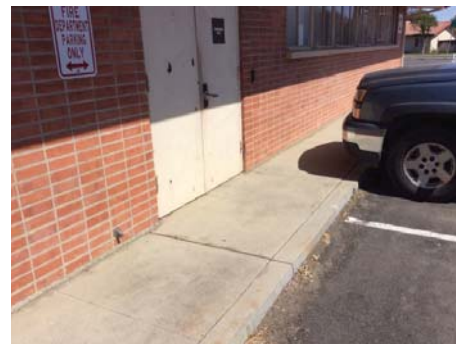

Facility: **FIRE ADMIN**


Area: **Exterior**

Part/Floor: **On-site**

Address: 280 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Walk						
2917	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk more than 36" but less than 48" wide (required in CA only). <i>Proposed Solution:</i> Enlarge width of walk to 48". <i>Notes:</i> Provide wheel stops at parking spaces. 	<p>PCODE EF08NT</p> <p>CBC 2010 1133B.7.1</p> <p>CBC 2013 11B-403.5.1.3</p> <p>Priority 3</p> <p>Severity 3</p> <p>TBD Contract Work</p>	15	JOB	\$45	\$675
						

Total Costs for	Part/floor: Exterior	On-site	\$4,175.00
------------------------	----------------------	---------	-------------------

Facility: **FIRE ADMIN**

Area: **Exterior**

Part/Floor: **On-site**

Address: 280 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$4,175.00

Facility: **FIRE ADMIN**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 280 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Main Entrance & Lobby

Door Swing

2658

As-Built Description:

Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60".

- **As-Built:** 4.5"
- **Proposed Solution:**

Provide relocated new door and frame; remodel walls as needed.

PCODE **ID23B**
 ADAAG **Fig. 25(a)**
 ADA 2010 **404.2.4**
 CBC 2010 **11B-26A(a)**
 CBC 2013 **11B-404.2.4**
 Priority **1**
 Severity **2**
TBD Contract Work

1 JOB \$2,600 **\$2,600**



Public Counter

2655

As-Built Description:


Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.

- **As-Built:** 43"
- **Proposed Solution:**

Provide auxiliary shelf, clipboard, or table as equivalent facilitation.

PCODE **IN03**
 ADAAG **7.2(2)**
 ADA 2010 **904.4**
 CBC 2010 **1122B.4**
 CBC 2013 **11B-904.4**
 Priority **1**
 Severity **3**
TBD Contract Work

1 JOB \$150 **\$150**

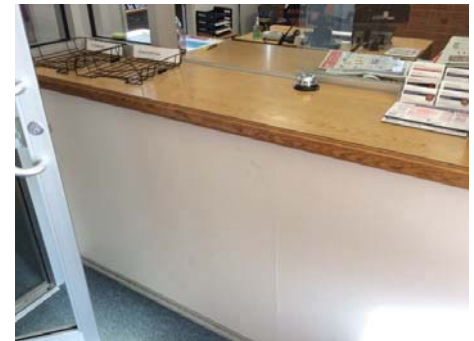

2 Front Staff Corridor & Offices

Door Pair

2666

As-Built Description:


Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°.

- **As-Built:** 28"
- **Proposed Solution:**

Provide new door leaves, unequal in width, to existing frame for pair of doors.

PCODE **ID08A**
 ADAAG **4.13.4**
 ADA 2010 **404.2.2**
 CBC 2010 **1133B.2.3.1**
 CBC 2013 **11B-404.2.2**
 Priority **4**
 Severity **2**
TBD Contract Work

1 JOB \$1,500 **\$1,500**

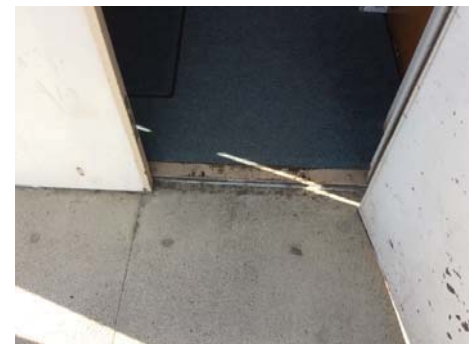

Facility: **FIRE ADMIN**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 280 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Swing</u>						
2667	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18"(CA only: 24" at exterior doors)x 60". <i>As-Built:</i> 52" <i>Proposed Solution:</i> Extend maneuvering space. <i>Notes:</i> Modify walkway 	PCODE ID23D ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$800	\$800
						

<u>Door Threshold</u>						
2665	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door inaccessible due to threshold or step at door exceeding 1/2". <i>As-Built:</i> 1.25" <i>Proposed Solution:</i> Modify threshold to be no more than 1/2" by removing existing paving at door and providing landing with edge ramping (slope 1:20 max). 	PCODE ID02A ADAAG 4.13.8 ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$400	\$400
						

<u>Drinking Fountain</u>						
2671	<ul style="list-style-type: none"> <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain). <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA02 ADAAG 4.15.5(1) ADA 2010 602.2 CBC 2010 1115B.4.6.2 CBC 2013 11B-602.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$3,200	\$3,200
						

Facility: **FIRE ADMIN**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 280 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **4**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2672	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor. • <i>As-Built:</i> 42" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	<p>PCODE IA03BREF ADAAG 4.15.2 ADA 2010 602.4 CBC 2010 1115B.4.6.4 CBC 2013 11B-602.4 Priority 4 Severity 3 TBD Contract Work</p>				
2670	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. • <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	<p>PCODE IA04 CBC 2010 1115B.4.6.3; Fig. CBC 2013 11B-602.9 Priority 3 Severity 2 TBD Contract Work</p>	1	JOB	\$3,000	\$3,000



3 Staff Men's Restroom

Door Clearance

2676	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. • <i>As-Built:</i> 25" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	<p>PCODE ID01REF ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 4 Severity 2 TBD Contract Work</p>				

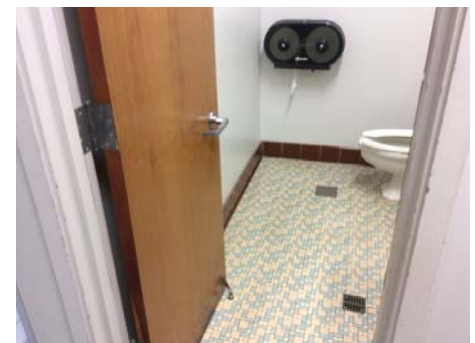

Facility: **FIRE ADMIN**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 280 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Swing</u>						
2678	<ul style="list-style-type: none"> As-Built Description: Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". As-Built: DW +10" at 22" to lavatory Proposed Solution: Remodel as needed. 	PCODE ID23BREF ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 4 Severity 2 TBD Contract Work				
						REF
						

<u>Restroom</u>						
2674	<ul style="list-style-type: none"> As-Built Description: Single accommodation restroom not accessible; multiple compliance violations. Proposed Solution: Remodel area to provide single-occupant accessible restroom. Notes: RR 61"x90" 	PCODE WA01 ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.2 CBC 2013 11B-603 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$30,000	\$30,000
						
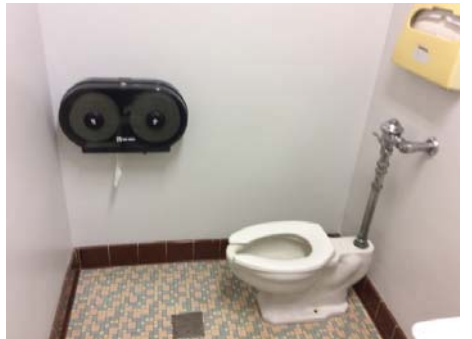
<u>Water Closet</u>						
2677	<ul style="list-style-type: none"> As-Built Description: CA only: In single-accommodation restroom less than 48" in front of water closet provided. As-Built: 30" Proposed Solution: Remodel restroom to provide at least 48" in front of water closet. 	PCODE WB03AREF CBC 2010 1115B.3.2.1 CBC 2013 11B-604.3.1 Priority 4 Severity 1 TBD Contract Work				
						REF
						

4 Staff Women's Restroom

Facility: **FIRE ADMIN**


Area: **Interior**


Part/Floor: **Ground Floor**


Address: 280 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Clearance</u>						
2680	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 25" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	<p>PCODE ID01REF</p> <p>ADAAG 4.13.5</p> <p>ADA 2010 404.2.3</p> <p>CBC 2010 1133B.1.1.1.1</p> <p>CBC 2013 11B-404.2.3</p> <p>Priority 4</p> <p>Severity 2</p> <p>TBD Contract Work</p>				REF
						

<u>Door Swing</u>						
2682	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". <i>As-Built:</i> 21" to lav <i>Proposed Solution:</i> Provide relocated new door and frame; remodel walls as needed. Notes: RR 60"x88" 	<p>PCODE ID23BREF</p> <p>ADAAG Fig. 25(a)</p> <p>ADA 2010 404.2.4</p> <p>CBC 2010 11B-26A(a)</p> <p>CBC 2013 11B-404.2.4</p> <p>Priority 4</p> <p>Severity 2</p> <p>TBD Contract Work</p>				REF
						

<u>Restroom</u>						
2683	<ul style="list-style-type: none"> <i>As-Built Description:</i> Single accommodation restroom not accessible; multiple compliance violations. <i>Proposed Solution:</i> Remodel area to provide single-occupant accessible restroom. Notes: RR 60"x88" 	<p>PCODE WA01</p> <p>ADAAG 4.22</p> <p>ADA 2010 603</p> <p>CBC 2010 1115B.3.2</p> <p>CBC 2013 11B-603</p> <p>Priority 4</p> <p>Severity 2</p> <p>TBD Contract Work</p>	1	JOB	\$30,000	\$30,000
						

Facility: **FIRE ADMIN**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 280 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Water Closet

- 2681
- *As-Built Description:*
CA only: In single-accommodation restroom less than 48" in front of water closet provided.
 - *As-Built:* 31"
 - *Proposed Solution:*
Remodel restroom to provide at least 48" in front of water closet.

PCODE **WB03AREF**
 CBC 2010 **1115B.3.2.1**
 CBC 2013 **11B-604.3.1**
 Priority **4**
 Severity **2**
TBD Contract Work

REF



5 Break Room

Sink

- 2687
- *As-Built Description:*
Sink rim higher than 34" above floor.
 - *As-Built:* 37"
 - *Proposed Solution:*
Remodel sink cabinet to lower sink.

PCODE **IN06**
 ADAAG **4.24.2**
 ADA 2010 **606.3**
 CBC 2010 **1115B.4.7.1**
 CBC 2013 **11B-606.3**
 Priority **4**
 Severity **4**
TBD Contract Work

1 JOB \$1,750 \$1,750



- 2686
- *As-Built Description:*
Sink does not have knee space min. 27" high x 19" deep x 30" wide.
 - *Proposed Solution:*
Remodel sink cabinet.

PCODE **IN06A**
 ADAAG **4.24.3**
 ADA 2010 **606.2**
 CBC 2010 **1115B.4.7.1**
 CBC 2013 **11B-606.2**
 Priority **2**
 Severity **2**
TBD Contract Work

1 JOB \$1,750 \$1,750



6 Training Room

Facility: **FIRE ADMIN**


Area: **Interior**


Part/Floor: **Ground Floor**

Address: 280 CAMPUS DR.


Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Pair</u>						
2694	<ul style="list-style-type: none"> As-Built Description: Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. As-Built: 28" Proposed Solution: Provide new door leaves, unequal in width, to existing frame for pair of doors. 	PCODE ID08A ADAAG 4.13.4 ADA 2010 404.2.2 CBC 2010 1133B.2.3.1 CBC 2013 11B-404.2.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

2691	<ul style="list-style-type: none"> As-Built Description: Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. As-Built: 29" Proposed Solution: Provide new door leaves, unequal in width, to existing frame for pair of doors. 	PCODE ID08A ADAAG 4.13.4 ADA 2010 404.2.2 CBC 2010 1133B.2.3.1 CBC 2013 11B-404.2.2 Priority 2 Severity 3 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

7 Back Office & Conference Room

<u>Door Pair</u>						
2699	<ul style="list-style-type: none"> As-Built Description: Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. As-Built: 28" Proposed Solution: Provide new door leaves, unequal in width, to existing frame for pair of doors. 	PCODE ID08A ADAAG 4.13.4 ADA 2010 404.2.2 CBC 2010 1133B.2.3.1 CBC 2013 11B-404.2.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

Facility: **FIRE ADMIN**


Area: **Interior**

Part/Floor: **Ground Floor**

Address: 280 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Threshold</u>						
2698	<ul style="list-style-type: none"> As-Built Description: Door inaccessible due to threshold or step at door exceeding 1/2". As-Built: 1.5" Proposed Solution: Modify threshold to be no more than 1/2" by removing existing paving at door and providing landing with edge ramping (slope 1:20 max). 	PCODE ID02A ADAAG 4.13.8 ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 2 Severity 4 TBD Contract Work	1	JOB	\$400	\$400
						

Total Costs for Part/floor: Interior Ground Floor \$80,050.00

Facility: **FIRE ADMIN**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 280 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$80,050.00

Facility: **FIRE ADMIN**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 280 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Facility: FIRE ADMIN \$84,225.00

Facility: **ENVIRONMENTAL OFFICES**
 Address: 330 CAMPUS DR.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Accessible Parking Space Serving Buildings 1 & 2

Floor or Ground Surfaces

2941	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space has slope greater than 1/4":12" (2%). <i>As-Built:</i> 3.8% along drain <i>Proposed Solution:</i> Modify slope at accessible parking space. 	PCODE EA05 ADAAG 4.6.3 ADA 2010 502.4 CBC 2010 1129B.3.3 CBC 2013 11B-502.4 Priority 1 Severity 4 TBD Contract Work	50	SF	\$12	\$600
------	---	--	----	----	------	-------



Parking

2942	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space does not have 5' wide access aisle; 8' wide for van accessible aisle. <i>As-Built:</i> Striping faded. <i>Proposed Solution:</i> Modify parking aisle(s) to create accessible space by restriping. <i>Notes:</i> Provide 8' wide for Van space. 	PCODE EA02B ADAAG 4.6.3 ADA 2010 502.3 CBC 2010 1129B.3.1 CBC 2013 11B-502.2; 11B-502.3.1 Priority 1 Severity 4 TBD Contract Work	1	JOB	\$200	\$200
------	--	--	---	-----	-------	-------



2 POT from Accessible Parking Space to Buildings 1 & 2

Changes in Level

2944	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route. <i>As-Built:</i> Various cracks & gaps <i>Proposed Solution:</i> Remove, replace or repair area of pavement sufficient to correct abrupt change in level. 	PCODE EF03NT ADAAG 4.3.8 ADA 2010 403.4 CBC 2010 1133B.7.4 CBC 2013 11B-403.4 Priority 1 Severity 4 TBD Contract Work	40	SF	\$21	\$840
------	--	--	----	----	------	-------



3 POT from Lacey Blvd. to Buildings. 1 & 2

Facility: **ENVIRONMENTAL OFFICES**
 Address: 330 CAMPUS DR.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Changes in Level

2946 • *As-Built Description:*
 Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route.
 • *As-Built:* 1"
 • *Proposed Solution:*
 Remove, replace or repair area of pavement sufficient to correct abrupt change in level.

PCODE EF03
 ADAAG 4.3.8
 ADA 2010 403.4
 CBC 2010 1133B.7.4
 CBC 2013 11B-403.4
 Priority 1
 Severity 4
 TBD Contract Work

1 SF \$21 \$21



Drinking Fountain

2948 • *As-Built Description:*
 Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).
 • *Proposed Solution:*
 Provide new, accessible fountain.

PCODE IA02
 ADAAG 4.15.5(1)
 ADA 2010 602.2
 CBC 2010 1115B.4.6.2
 CBC 2013 11B-602.2
 Priority 3
 Severity 2
 TBD Contract Work


1 JOB \$3,200 \$3,200



2949 • *As-Built Description:*
 Drinking fountain water flow less than 4" high; unit in good condition.
 • *Proposed Solution:*
 Adjust water flow.

PCODE IA03DREF
 ADAAG 4.15.3
 ADA 2010 602.6
 CBC 2010 1115B.4.6.5
 CBC 2013 11B-602.6
 Priority 3
 Severity 2
 TBD Contract Work

REF

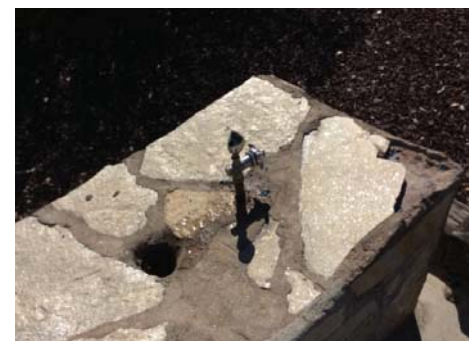

Facility: **ENVIRONMENTAL OFFICES**
 Address: 330 CAMPUS DR.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2950	<ul style="list-style-type: none"> <i>As-Built Description:</i> Fountain bubbler not easily activated by lever, push bar, or other accessible control. <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA03REF ADAAG 4.15.4 ADA 2010 602.3 CBC 2010 1115B.4.6.5 CBC 2013 11B-602.3 Priority 1 Severity 2 TBD Contract Work				



4 POT from Accessible Parking Space to Building 2 & 3 Staff Entrance

Changes in Level

2953	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route. <i>As-Built:</i> 1"-2" lip adjacent to POT. <i>Proposed Solution:</i> Remove, replace or repair area of pavement sufficient to correct abrupt change in level. <i>Notes:</i> A curb may be necessary to distinguish between vehicular area and POT. 	PCODE EF03REF ADAAG 4.3.8 ADA 2010 403.4 CBC 2010 1133B.7.4 CBC 2013 11B-403.4 Priority 1 Severity 2 TBD Contract Work				
------	--	--	--	--	--	--



Cross Slope

2951	<ul style="list-style-type: none"> <i>As-Built Description:</i> Cross slope more than 1":48" (2.083%). <i>As-Built:</i> 2.3-5.2% <i>Proposed Solution:</i> Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 3 TBD Contract Work	160	SF	\$25	\$4,000
------	---	---	-----	----	------	---------



Facility: **ENVIRONMENTAL OFFICES**
 Address: 330 CAMPUS DR.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2954	<ul style="list-style-type: none"> As-Built Description: Cross slope more than 1":48" (2.083%). As-Built: 2.7% Proposed Solution: Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 4 TBD Contract Work	16	SF	\$25	\$400



Walk

2956	<ul style="list-style-type: none"> As-Built Description: Walk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps. As-Built: 5.6-6.7% Proposed Solution: Provide ramp with handrails on both (2) sides. Notes: Also provide landings and wheel guides. 	PCODE EF01A ADAAG 4.8.1 ADA 2010 405.1 CBC 2010 1133B.7.3 CBC 2013 11B-405.1 Priority 1 Severity 4 TBD Contract Work	20	LF	\$260	\$5,200
------	--	---	----	----	-------	---------



5 Patio - Staff Only Area

Accessible Route

2960	<ul style="list-style-type: none"> As-Built Description: No walk / sidewalk provided to connect accessible facilities or elements that are on the same site. As-Built: To picnic tables Proposed Solution: Provide new 48" wide walk / sidewalk. Notes: relocate 	PCODE EF13 ADAAG 4.3.2 ADA 2010 206.1 CBC 2010 1114B.1.2 CBC 2013 11B-206.1 Priority 4 Severity 1 TBD Contract Work	30	LF	\$45	\$1,350
------	--	--	----	----	------	---------



Facility: **ENVIRONMENTAL OFFICES**
 Address: 330 CAMPUS DR.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Cross Slope

2967

- As-Built Description:
 Cross slope more than 1":48" (2.083%).
- As-Built: 2.9-3.0%
- Proposed Solution:
 Modify cross slope.

PCODE EF07
 ADAAG 4.3.7
 ADA 2010 403.3
 CBC 2010 1133B.7.1.3
 CBC 2013 11B-403.3
 Priority 4
 Severity 4
 TBD Contract Work

125 SF \$25 **\$3,125**




Door

2964

- As-Built Description:
 Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%).
- As-Built: 4.0%
- Proposed Solution:
 Modify surface slope at door.

PCODE ID11
 ADAAG 4.13.6
 ADA 2010 404.2.4.4
 CBC 2010 1133B.2.4
 CBC 2013 11B-404.2.4
 Priority 2
 Severity 3
 TBD Contract Work

30 SF \$40 **\$1,200**

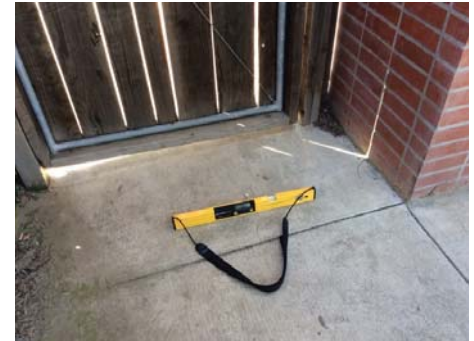

2959

- As-Built Description:
 Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%).
- As-Built: 2.6%
- Proposed Solution:
 Modify surface slope at door.

PCODE ID11
 ADAAG 4.13.6
 ADA 2010 404.2.4.4
 CBC 2010 1133B.2.4
 CBC 2013 11B-404.2.4
 Priority 2
 Severity 4
 TBD Contract Work


30 SF \$40 **\$1,200**



Facility: **ENVIRONMENTAL OFFICES**
 Address: 330 CAMPUS DR.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Picnic Area</u>						
2961	<ul style="list-style-type: none"> <i>As-Built Description:</i> Knee clearance at minimums 27" high, 30" wide, and 19" deep is not provided. <i>Proposed Solution:</i> Modify picnic table as required to provide knee clearance. 	PCODE NH11A ADAAG 16.5.4. ADA 2010 902.2 CBC 2010 1132B.1 CBC 2013 11-902.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$850	\$850
						

Total Costs for	Part/floor: Exterior	On-site	\$22,186.00
------------------------	----------------------	---------	--------------------

Facility: **ENVIRONMENTAL OFFICES**

Area: **Exterior**

Part/Floor: **On-site**

Address: 330 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$22,186.00

Facility: **ENVIRONMENTAL OFFICES**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 Large Conference Room

Assistive Listening

- 2535
- *As-Built Description:*
No portable assistive listening system provided for small meeting room.
 - *As-Built:* 7 lbs
 - *Proposed Solution:*
Share existing portable assistive listening system from other facility if needed.

PCODE **GI01E**
 ADAAG **4.1.3(19)(b) & 4.33.7**
 ADA 2010 **219.1 & 706.1**
 CBC 2010 **1104B.2**
 CBC 2013 **11B-219.2**
 Priority **3**
 Severity **3**
 TBD **Contract Work**

REF




Door Swing

- 2536
- *As-Built Description:*
Front approach: At push side, door does not have clear and level maneuvering space measuring door width x 48" (door width plus 12" if door has both, latch and closer).
 - *As-Built:* 11" deep
 - *Proposed Solution:*
Provide relocated new door and frame; remodel walls as needed.
 - *Notes:*
Reset door frame

PCODE **ID24BNT**
 ADAAG **Fig. 25(a)**
 ADA 2010 **404.2.4**
 CBC 2010 **11B-26A(a)**
 CBC 2013 **11B-404.2.4**
 Priority **2**
 Severity **2**
 TBD **Contract Work**

1 JOB \$2,600 **\$2,600**

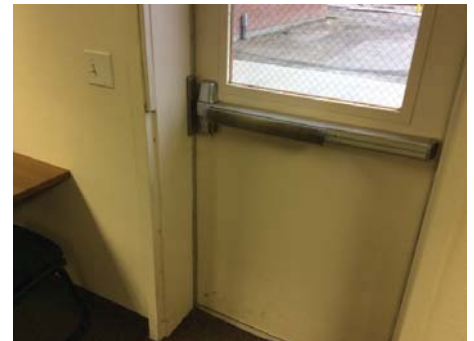

3 Brauner Conference Room

Assistive Listening

- 2540
- *As-Built Description:*
No portable assistive listening system provided for small meeting room.
 - *Proposed Solution:*
Share existing portable assistive listening system from other facility if needed.

PCODE **GI01E**
 ADAAG **4.1.3(19)(b) & 4.33.7**
 ADA 2010 **219.1 & 706.1**
 CBC 2010 **1104B.2**
 CBC 2013 **11B-219.2**
 Priority **3**
 Severity **3**
 TBD **Contract Work**


REF




Facility: **ENVIRONMENTAL OFFICES**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**


Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Sink</u>						
2541	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 36" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06 ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

2542	<ul style="list-style-type: none"> As-Built Description: Hot or sharp-surfaced water/drain pipe not insulated or covered. Proposed Solution: Insulate or cover water/drain pipe. 	PCODE IN06C ADAAG 4.24.6 ADA 2010 606.5 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.5 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$120	\$120
						

4 Copy Room

Drinking Fountain

2553	<ul style="list-style-type: none"> As-Built Description: Oval and round drinking fountains: bubbler outlet more than 3" from front edge of fountain (CA only: all drinking fountain bubbler outlets more than 6" from front edge). As-Built: 7.75" Proposed Solution: Provide new, accessible fountain. 	PCODE IA03A ADAAG 4.15.3 ADA 2010 602.6 CBC 2010 1115B.4.6.4 CBC 2013 11B-602.6 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$3,200	\$3,200
						

Facility: **ENVIRONMENTAL OFFICES**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2552	<ul style="list-style-type: none"> As-Built Description: Drinking fountain bubbler more than 36" above floor. As-Built: 38" Proposed Solution: Provide new, accessible fountain. 	PCODE IA03B ADAAG 4.15.2 ADA 2010 602.4 CBC 2010 1115B.4.6.4 CBC 2013 11B-602.4 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$3,200	\$3,200



Sink

2550	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 36" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06 ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$1,750	\$1,750
------	--	--	---	-----	---------	----------------




2551	<ul style="list-style-type: none"> As-Built Description: Hot or sharp-surfaced water/drain pipe not insulated or covered. Proposed Solution: Insulate or cover water/drain pipe. 	PCODE IN06C ADAAG 4.24.6 ADA 2010 606.5 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.5 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$120	\$120
------	--	---	---	-----	-------	--------------




Facility: **ENVIRONMENTAL OFFICES**
 Address: 330 CAMPUS DR.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Turn Space						
2554	<ul style="list-style-type: none"> <i>As-Built Description:</i> Less than 60" diameter or T-shaped space provided for wheelchair turns. <i>As-Built:</i> 42"-49" <i>Proposed Solution:</i> Retrofit space to provide 60" diameter or T-turn. 	PCODE IN04 ADAAG 4.2.3 ADA 2010 304.1 CBC 2010 1118B.3 CBC 2013 11B-304.1 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$925	\$925
						

5 Men's Restroom

Water Closet						
2565	<ul style="list-style-type: none"> <i>As-Built Description:</i> More than 18" from near side wall to centerline of water closet. <i>As-Built:</i> 20" o.c. <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing. 	PCODE WB02A ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$4,500	\$4,500
						


2561	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: In single-accommodation restroom less than 48" in front of water closet provided. <i>As-Built:</i> 41" <i>Proposed Solution:</i> Remodel restroom to provide at least 48" in front of water closet. <i>Notes:</i> Relocate items 	PCODE WB03AREF CBC 2010 1115B.3.2.1 CBC 2013 11B-604.3.1 Priority 3 Severity 3 TBD Contract Work	REF			
------	--	--	-----	---	--	--


6 Women's Restroom

Facility: **ENVIRONMENTAL OFFICES**
 Address: 330 CAMPUS DR.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Water Closet</u>						
2574	<ul style="list-style-type: none"> <i>As-Built Description:</i> More than 18" from near side wall to centerline of water closet. <i>As-Built:</i> 21" o.c. <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing. 	PCODE WB02A ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$4,500	\$4,500
						

2577	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: In single-accommodation restroom less than 48" in front of water closet provided. <i>As-Built:</i> 34" <i>Proposed Solution:</i> Remodel restroom to provide at least 48" in front of water closet. <i>Notes:</i> relocate. 	PCODE WB03AREF CBC 2010 1115B.3.2.1 CBC 2013 11B-604.3.1 Priority 3 Severity 2 TBD Contract Work	REF			
------	---	--	-----	--	--	--

7 Environmental Health Lobby

<u>Door</u>						
2579	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 5.0% <i>Proposed Solution:</i> Modify surface slope at door. <i>Notes:</i> Provide power door operator. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 1 Severity 3 TBD Contract Work	30	SF	\$40	\$1,200
						

Facility: **ENVIRONMENTAL OFFICES**


Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Non-Fixed Desk</u>						
2583	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> due to table legs <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	<p>PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 1 Severity 2 TBD Contract Work</p>	1	JOB	\$1,600	\$1,600
						

Total Costs for	Part/floor: Interior	Ground Floor	\$25,465.00
------------------------	-----------------------------	---------------------	--------------------

Facility: **ENVIRONMENTAL OFFICES**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$25,465.00

Facility: **ENVIRONMENTAL OFFICES**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: ENVIRONMENTAL OFFICES					\$47,651.00
------------------------	--	--	--	--	--	--------------------

Facility: **HEALTH SERVICES ANNEX**
 Address: 330 CAMPUS DR.




Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Accessible Parking Serving Public Health Building 5 & EOC Building 4

Floor or Ground Surfaces

2746	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space has slope greater than 1/4":12" (2%). <i>As-Built:</i> 3.8-4.1% along the swale <i>Proposed Solution:</i> Modify slope at accessible parking space. 	PCODE EA05 ADAAG 4.6.3 ADA 2010 502.4 CBC 2010 1129B.3.3 CBC 2013 11B-502.4 Priority 1 Severity 3 TBD Contract Work	104	SF	\$12	\$1,248
						
2747	<ul style="list-style-type: none"> <i>As-Built Description:</i> Access aisle at accessible parking space has slope greater than 1/4":12" (2%) due to built-up curb ramp within aisle. <i>As-Built:</i> 5.8% <i>Proposed Solution:</i> Provide curb cut. 	PCODE EA05A ADAAG 4.6.3 ADA 2010 502.4 CBC 2010 1129B.3.3 CBC 2013 11B-502.4 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$2,500	\$2,500
						
2749	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space has slope greater than 1/4":12" (2%). <i>As-Built:</i> Lip around lip, potential tripping hazard. <i>Proposed Solution:</i> Modify slope at accessible parking space. 	PCODE EA05NT ADAAG 4.6.3 ADA 2010 502.4 CBC 2010 1129B.3.3 CBC 2013 11B-502.4 Priority 1 Severity 1 TBD Contract Work	6	SF	\$12	\$72
						

2 POT from Accessible Parking to Building 5 & EOC Building 4

Facility: **HEALTH SERVICES ANNEX**
 Address: 330 CAMPUS DR.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Changes in Level

- 2752
- *As-Built Description:*
Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route.
 - *As-Built:* Missing pavement. 0.5"
 - *Proposed Solution:*
Remove, replace or repair area of pavement sufficient to correct abrupt change in level.

PCODE EF03
 ADAAG 4.3.8
 ADA 2010 403.4
 CBC 2010 1133B.7.4
 CBC 2013 11B-403.4
 Priority 1
 Severity 4
 TBD Contract Work

1 SF \$21 \$21




Cross Slope

- 2754
- *As-Built Description:*
Cross slope more than 1":48" (2.083%).
 - *As-Built:* 2.7%
 - *Proposed Solution:*
Modify cross slope.

PCODE EF07
 ADAAG 4.3.7
 ADA 2010 403.3
 CBC 2010 1133B.7.1.3
 CBC 2013 11B-403.3
 Priority 1
 Severity 4
 TBD Contract Work

40 SF \$25 \$1,000

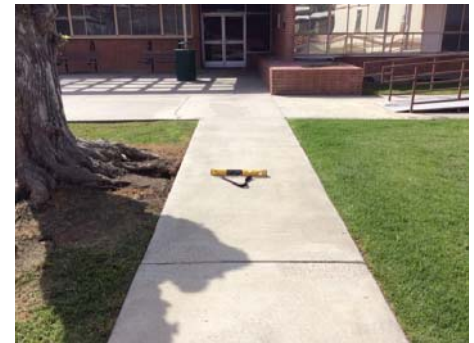

Picnic Area

- 2751
- *As-Built Description:*
Knee clearance at minimums 27" high, 30" wide, and 19" deep is not provided.
 - *As-Built:* 11" deep
 - *Proposed Solution:*
Modify picnic table as required to provide knee clearance.
 - *Notes:*
And rotate table.

PCODE NH11A
 ADAAG 16.5.4.
 ADA 2010 902.2
 CBC 2010 1132B.1
 CBC 2013 11-902.2
 Priority 1
 Severity 2
 TBD Contract Work

1 JOB \$850 \$850



3 Staff Accessible Parking to Building 5

Facility: **HEALTH SERVICES ANNEX**
 Address: 330 CAMPUS DR.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Cross Slope

2761

- *As-Built Description:*
 Cross slope more than 1":48" (2.083%).
- *As-Built:* 2.7%-4.8%
- *Proposed Solution:*
 Modify cross slope.

PCODE EF07REF
 ADAAG 4.3.7
 ADA 2010 403.3
 CBC 2010 1133B.7.1.3
 CBC 2013 11B-403.3
 Priority 1
 Severity 3
 TBD Contract Work

REF



Floor or Ground Surfaces

2758

- *As-Built Description:*
 Accessible parking space has slope greater than 1/4":12" (2%).
- *As-Built:* 3.6% along drainage swale
- *Proposed Solution:*
 Modify slope at accessible parking space.

PCODE EA05
 ADAAG 4.6.3
 ADA 2010 502.4
 CBC 2010 1129B.3.3
 CBC 2013 11B-502.4
 Priority 1
 Severity 4
 TBD Contract Work

34 SF \$12 \$408



2759

- *As-Built Description:*
 Access aisle at accessible parking space has slope greater than 1/4":12" (2%) due to built-up curb ramp within aisle.
- *As-Built:* 6.2%
- *Proposed Solution:*
 Provide curb cut.

PCODE EA05A
 ADAAG 4.6.3
 ADA 2010 502.4
 CBC 2010 1129B.3.3
 CBC 2013 11B-502.4
 Priority 1
 Severity 3
 TBD Contract Work


1 JOB \$2,500 \$2,500




Facility: **HEALTH SERVICES ANNEX**
 Address: 330 CAMPUS DR.

Area: **Exterior**
 Year to be Completed: **TBD**


Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Parking</u>						
2755	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space does not have 5' wide access aisle; 8' wide for van accessible aisle. <i>As-Built:</i> not provided. "freight" <i>Proposed Solution:</i> Modify parking aisle(s) to create accessible space by restriping. 	PCODE EA02B ADAAG 4.6.3 ADA 2010 502.3 CBC 2010 1129B.3.1 CBC 2013 11B-502.2; 11B-502.3.1 Priority 1 Severity 1 TBD Contract Work	1	JOB	\$200	\$200
						

4 Sidewalk Along Lot

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Cross Slope</u>						
2763	<ul style="list-style-type: none"> <i>As-Built Description:</i> Cross slope more than 1":48" (2.083%). <i>As-Built:</i> 4.1-8.0% <i>Proposed Solution:</i> Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 2 TBD Contract Work	200	SF	\$25	\$5,000
						

5 Exit Path

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Cross Slope</u>						
2764	<ul style="list-style-type: none"> <i>As-Built Description:</i> Cross slope more than 1":48" (2.083%). <i>As-Built:</i> 3.6% and cracks <i>Proposed Solution:</i> Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 2 Severity 4 TBD Contract Work	48	SF	\$25	\$1,200
						

Facility: **HEALTH SERVICES ANNEX**
 Address: 330 CAMPUS DR.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2765	<ul style="list-style-type: none"> As-Built Description: Cross slope more than 1":48" (2.083%). As-Built: 3.4% Proposed Solution: Modify cross slope. Notes: 7.7 slope 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 2 Severity 4 TBD Contract Work	80	SF	\$25	\$2,000



Walk

2766	<ul style="list-style-type: none"> As-Built Description: Walk: Slope greater than 1:20 (5.0%), and walk does not comply with requirements for ramps. As-Built: 7.7-10% Proposed Solution: Modify walk/sidewalk slope to 1:20 or less. 	PCODE EF01REF ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.3 CBC 2013 11B-403.3 Priority 2 Severity 3 TBD Contract Work				
------	--	---	--	--	--	--



6 Rear Staff Lot

Walk

2768	<ul style="list-style-type: none"> As-Built Description: Walk more than 36" but less than 48" wide (required in CA only). As-Built: Wheel stops needed. Proposed Solution: Provide wheel stops in adjacent parking spaces. 	PCODE EF08NT CBC 2010 1133B.7.1 CBC 2013 11B-403.5.1.3 Priority 1 Severity 3 TBD Contract Work	12	JOB	\$100	\$1,200
------	---	---	----	-----	-------	---------



Total Costs for	Part/floor: Exterior	On-site	\$18,199.00
------------------------	-----------------------------	----------------	--------------------

Facility: **HEALTH SERVICES ANNEX**

Area: **Exterior**

Part/Floor: **On-site**

Address: 330 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$18,199.00

Facility: **HEALTH SERVICES ANNEX**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 East Staff Corridor - Break Room

Desk

2105

• *As-Built Description:*

Accessible fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided.

• *As-Built:* 8" deep

• *Proposed Solution:*

Provide new fixed accessible table or desk.

• *Notes:*

Break room

PCODE **IN02**
 ADAAG **4.32.3 & .4**
 ADA 2010 **306.1**
 CBC 2010 **1122B.3 & 4**
 CBC 2013 **11B-306.1**
 Priority **4**
 Severity **2**
TBD Contract Work

1 JOB \$2,500 **\$2,500**



3 Large Staff Break Room

Lavatory

2121

• *As-Built Description:*

Clear floor space, 30" x 48" in front of fixture, extending 19" max. under the lavatory, not provided (CA only: Less than 18" from side wall to centerline of lavatory).

• *As-Built:* 12"

• *Proposed Solution:*

Provide new accessible lavatory. Remodel restroom as needed.

PCODE **WD01**
 ADAAG **4.19.3**
 ADA 2010 **606.2**
 CBC 2010 **1115B.4.3**
 CBC 2013 **11B-606.2, 11B-606.6**
 Priority **4**
 Severity **2**
TBD Contract Work

1 JOB \$3,400 **\$3,400**



Sink

2112

• *As-Built Description:*

Sink does not have knee space min. 27" high x 19" deep x 30" wide.

• *Proposed Solution:*

Remodel sink cabinet.

PCODE **IN06A**
 ADAAG **4.24.3**
 ADA 2010 **606.2**
 CBC 2010 **1115B.4.7.1**
 CBC 2013 **11B-606.2**
 Priority **4**
 Severity **2**
TBD Contract Work

1 JOB \$1,750 **\$1,750**



Facility: **HEALTH SERVICES ANNEX**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2113	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 37.25" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work				



Toilet Stall

2130	<ul style="list-style-type: none"> As-Built Description: The lavatory or other unintended fixture, encroaches on the necessary clearance around a water closet (60" x 56"). As-Built: 53" from wall, 28" to lavatory Proposed Solution: Remove adjacent fixture and provide new enclosure at accessible water closet. 	PCODE WB01A ADA 2010 604.3.1; 604.3.2 CBC 2013 11B-604.3.1; 11B-604.3.2 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$2,000	\$2,000



Turning Space




2129	<ul style="list-style-type: none"> As-Built Description: Wheelchair clearance: Clear space, floor to 27" high with a diameter of 60", not provided (space 56" x 63" acceptable). As-Built: Door swings more than 12" Proposed Solution: Provide wheelchair clearance space in restroom. Notes: 75" x 77" 	PCODE WC01 ADAAG 4.22.3 ADA 2010 603.2.1 CBC 2010 1115B.3.1 CBC 2013 11B-603.2.1; 11B-304.3 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,190	\$1,190



Facility: **HEALTH SERVICES ANNEX**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Water Closet</u>						
2125	<ul style="list-style-type: none"> <i>As-Built Description:</i> Water closet not 17"-18" from near side wall to center line of water closet (2010 ADAS: 16"-18"). <i>As-Built:</i> 18.5" o.c. <i>Proposed Solution:</i> Relocate existing water closet and plumbing, remount with offset closet flange to provide 17"-18" from side wall. 	PCODE WB02C ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$500	\$500
						
2128	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: In single-accommodation restroom less than 48" in front of water closet provided. <i>Proposed Solution:</i> Remodel restroom to provide at least 48" in front of water closet. 	PCODE WB03A CBC 2010 1115B.3.2.1 CBC 2013 11B-604.3.1 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$5,000	\$5,000
						
2126	<ul style="list-style-type: none"> <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor. <i>As-Built:</i> 19.25" <i>Proposed Solution:</i> Provide new accessible water closet. 	PCODE WB08 ADAAG 4.16.3 ADA 2010 604.4 CBC 2010 1115B.4.1.4 CBC 2013 11B-604.4 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$1,400	\$1,400
						

Facility: **HEALTH SERVICES ANNEX**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2127	<ul style="list-style-type: none"> <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall. <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type, or install sensor flush. 	PCODE WB10 ADAAG 4.16.5 ADA 2010 604.6 CBC 2010 1115B.4.1.5 CBC 2013 11B-604.6 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$500	\$500



4 Auditorium

Assistive Listening

2143	<ul style="list-style-type: none"> <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	PCODE GI01E ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work		REF		
------	---	---	--	-----	--	--



Non-Fixed Desk

2138	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> Podium 43" <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
------	---	---	---	-----	---------	---------





5 Employee Health Center

Facility: **HEALTH SERVICES ANNEX**
 Address: 330 CAMPUS DR.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Exam Bed</u>						
2165	<ul style="list-style-type: none"> <i>As-Built Description:</i> Seat front edge height is not between 17" min. to 19" max. above ground of floor space. <i>As-Built:</i> 32.5" <i>Proposed Solution:</i> Provide transfer or lift beds in designated accessible exam rooms. <i>Notes:</i> Not County equipment. private company. 	PCODE NO06ANT ADAAG 4.37.5 ADA 2010 903.5 CBC 2010 1132B.1 CBC 2013 11B-903.5 Priority 2 Severity 1 TBD Contract Work	1	JOB	\$600	\$600
						

<u>Fixed Bench</u>						
2154	<ul style="list-style-type: none"> <i>As-Built Description:</i> Clear floor or ground space (30" x 48") not overlapping with other clear space requirements, is not provided at at least one end of the bench. <i>Proposed Solution:</i> Provide and position clear floor or ground space to allow wheelchair users to be seated shoulder-to-shoulder with an individual seated on the bench. 	PCODE NO07 ADAAG 4.32.2 ADA 2010 903.2 CBC 2010 1118B.4 CBC 2013 11B-903.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$500	\$500
						

6 Employee Health Center - Break Room

<u>Sink</u>						
2168	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

Facility: **HEALTH SERVICES ANNEX**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2169	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sink rim higher than 34" above floor. • <i>As-Built:</i> 37" • <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	<p>PCODE IN06REF</p> <p>ADAAG 4.24.2</p> <p>ADA 2010 606.3</p> <p>CBC 2010 1115B.4.7.1</p> <p>CBC 2013 11B-606.3</p> <p>Priority 4</p> <p>Severity 4</p> <p>TBD Contract Work</p>				



Turn Space

2172	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Less than 60" diameter or T-shaped space provided for wheelchair turns. • <i>Proposed Solution:</i> Retrofit space to provide 60" diameter or T-turn. 	<p>PCODE IN04</p> <p>ADAAG 4.2.3</p> <p>ADA 2010 304.1</p> <p>CBC 2010 1118B.3</p> <p>CBC 2013 11B-304.1</p> <p>Priority 4</p> <p>Severity 2</p> <p>TBD Contract Work</p>	1	JOB	\$925	\$925
------	---	---	---	-----	-------	-------



7 Employee Health Center - Staff Restroom

Accessible Compartment


2184	<ul style="list-style-type: none"> • <i>As-Built Description:</i> The location of the stall door is not in front of the clear space (next to the water closet), with a maximum stile width of 4". • <i>As-Built:</i> Stile 19" • <i>Proposed Solution:</i> Remodel compartment. 	<p>PCODE WB05D</p> <p>ADAAG 4.17.3 & Fig. 30(a)</p> <p>ADA 2010 604.8.1.2</p> <p>CBC 2010 1115B.3.1.4.3</p> <p>CBC 2013 11B-604.8.1.2</p> <p>Priority 4</p> <p>Severity 2</p> <p>TBD Contract Work</p>	1	JOB	\$500	\$500
------	--	--	---	-----	-------	-------





Facility: **HEALTH SERVICES ANNEX**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Corridor						
2180	<ul style="list-style-type: none"> As-Built Description: Corridor less than 36" wide. As-Built: 34.5" wide Proposed Solution: Enlarge corridor to 36" wide; relocate stud wall. 	PCODE IH03 ADAAG 4.3.3 ADA 2010 403.5.1 CBC 2010 1133B.3.1 CBC 2013 11B-403.5.1 Priority 4 Severity 3 TBD Contract Work	5	LF	\$140	\$700
						


Door Swing						
2183	<ul style="list-style-type: none"> As-Built Description: Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". As-Built: Stall door 53" Proposed Solution: Remodel as needed. 	PCODE ID23BNT ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$2,600	\$2,600
						

Toilet Stall						
2189	<ul style="list-style-type: none"> As-Built Description: Toilet stall less than 60" wide. As-Built: 59.5" Proposed Solution: Provide new accessible stall. 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$1,500	\$1,500
						


Facility: **HEALTH SERVICES ANNEX**
 Address: 330 CAMPUS DR.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Water Closet</u>						
2187	<ul style="list-style-type: none"> <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall. <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type, or install sensor flush. 	PCODE WB10 ADAAG 4.16.5 ADA 2010 604.6 CBC 2010 1115B.4.1.5 CBC 2013 11B-604.6 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
						

8 Main Entrance Lobby

<u>Doormat</u>						
2208	<ul style="list-style-type: none"> <i>As-Built Description:</i> Doormat hinders access to disabled persons. <i>Proposed Solution:</i> Provide new doormat; recess or attach at edges. 	PCODE ID05 ADAAG 4.5.3 ADA 2010 302.2 CBC 2010 1124B.3 CBC 2013 11B-302.2 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
						

<u>Drinking Fountain</u>						
2200	<ul style="list-style-type: none"> <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor. <i>As-Built:</i> 38", top 8.5" deep <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA03B ADAAG 4.15.2 ADA 2010 602.4 CBC 2010 1115B.4.6.4 CBC 2013 11B-602.4 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$3,200	\$3,200
						

Facility: **HEALTH SERVICES ANNEX**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2199	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. <i>As-Built:</i> 15.5" deep <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	<p>PCODE IA04</p> <p>CBC 2010 1115B.4.6.3; Fig.</p> <p>CBC 2013 11B-602.9</p> <p>Priority 3</p> <p>Severity 2</p> <p>TBD Contract Work</p>	1	JOB	\$3,000	\$3,000



9 Men's Restroom

Lavatory

2223	<ul style="list-style-type: none"> <i>As-Built Description:</i> Clear floor space, 30" x 48" in front of fixture, extending 19" max. under the lavatory, not provided (CA only: Less than 18" from side wall to centerline of lavatory). <i>As-Built:</i> 16.75" <i>Proposed Solution:</i> Provide new accessible lavatory. Remodel restroom as needed. 	<p>PCODE WD01</p> <p>ADAAG 4.19.3</p> <p>ADA 2010 606.2</p> <p>CBC 2010 1115B.4.3</p> <p>CBC 2013 11B-606.2, 11B-606.6</p> <p>Priority 3</p> <p>Severity 2</p> <p>TBD Contract Work</p>	1	JOB	\$3,400	\$3,400
------	--	---	---	-----	---------	---------




2219	<ul style="list-style-type: none"> <i>As-Built Description:</i> Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory. <i>As-Built:</i> For temp control <i>Proposed Solution:</i> Provide accessible faucet at accessible lavatory. 	<p>PCODE WD06</p> <p>ADAAG 4.19.5</p> <p>ADA 2010 606.4</p> <p>CBC 2010 1115B.4.3</p> <p>CBC 2013 11B-606.4</p> <p>Priority 3</p> <p>Severity 3</p> <p>TBD Contract Work</p>	1	JOB	\$600	\$600
------	--	--	---	-----	-------	-------





Facility: **HEALTH SERVICES ANNEX**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Toilet Stall						
2226	<ul style="list-style-type: none"> As-Built Description: Toilet stall less than 60" wide. As-Built: 27"-58" Proposed Solution: Provide new accessible stall. 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 3 Severity 1 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

Urinal						
2217	<ul style="list-style-type: none"> As-Built Description: Front of rim projects less than 13.5" from wall. As-Built: 12" Proposed Solution: Provide accessible urinal. Remodel restroom as needed. 	PCODE WE01 ADA 2010 605.2 CBC 2010 1115B.4.2.1 CBC 2013 11B-605.2 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$4,000	\$4,000
						

2218	<ul style="list-style-type: none"> As-Built Description: Urinal flush control lever more than 48" above floor (CA only: 44" max.). As-Built: 45" Proposed Solution: Provide accessible urinal flush control. 	PCODE WE03 ADAAG 4.18.4 ADA 2010 605.4 CBC 2010 1115B.4.2.2 CBC 2013 11B-605.4 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$500	\$500
						

Facility: **HEALTH SERVICES ANNEX**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2216	<ul style="list-style-type: none"> • <i>As-Built Description:</i> 30" x 48" clear floor space in front of accessible urinal not provided. • <i>As-Built:</i> 32" to trash bin • <i>Proposed Solution:</i> Provide clear floor space in front of accessible urinal. Remodel restroom as needed. • <i>Notes:</i> 38" to stall 	PCODE WE04 ADAAG 4.18.3 ADA 2010 605.3 CBC 2010 1115B.4.2.3 CBC 2013 11B-605.3 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500



Water Closet

2228	<ul style="list-style-type: none"> • <i>As-Built Description:</i> More than 18" from near side wall to centerline of water closet. • <i>As-Built:</i> 20.5" o.c. • <i>Proposed Solution:</i> Provide new accessible water closet and relocate plumbing. 	PCODE WB02A ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$4,500	\$4,500
------	--	---	---	-----	---------	----------------



2230	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Height of water closet seat less than 17" or more than 19" from floor. • <i>As-Built:</i> 19.25" • <i>Proposed Solution:</i> Provide new accessible water closet. 	PCODE WB08 ADAAG 4.16.3 ADA 2010 604.4 CBC 2010 1115B.4.1.4 CBC 2013 11B-604.4 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$1,400	\$1,400
------	--	---	---	-----	---------	----------------





10 Women's Restroom


Facility: **HEALTH SERVICES ANNEX**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Accessories						
2238	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessories in sanitary facilities not accessible, hardware requires tight grasping, pinching, or twisting of the wrist. <i>As-Built:</i> No u-pull 36" down <i>Proposed Solution:</i> Provide accessories with accessible operating mechanism. 	PCODE WG05 ADAAG 4.27.4 ADA 2010 309.4 CBC 2010 1117B.6 CBC 2013 11B-309.4 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$400	\$400
						

Door Swing						
2240	<ul style="list-style-type: none"> <i>As-Built Description:</i> Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". <i>As-Built:</i> Stall 17" to lav <i>Proposed Solution:</i> Remodel as needed. 	PCODE ID23BNT ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$2,600	\$2,600
						

Water Closet						
2242	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: In single-accommodation restroom less than 48" in front of water closet provided. <i>As-Built:</i> 44" <i>Proposed Solution:</i> Remodel restroom to provide at least 48" in front of water closet. 	PCODE WB03A CBC 2010 1115B.3.2.1 CBC 2013 11B-604.3.1 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$5,000	\$5,000
						

Total Costs for Part/floor: Interior Ground Floor \$61,515.00

Facility: **HEALTH SERVICES ANNEX**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$61,515.00

Facility: **HEALTH SERVICES ANNEX**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: HEALTH SERVICES ANNEX					\$79,714.00
------------------------	--	--	--	--	--	--------------------

Facility: **HEALTH SERVICES-BRAUNER BUILDING**

Area: **Interior**
Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
Priority No: **2**

Address: 330 CAMPUS DR.

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Corridor to Building 3

Door

2466	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 3.5% <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 4 TBD Contract Work	20	SF	\$40	\$800
------	--	---	----	----	------	-------



2 Breakroom

Sink

2479	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink rim higher than 34" above floor. <i>As-Built:</i> 36.25" <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	PCODE IN06 ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$1,750	\$1,750
------	--	---	---	-----	---------	---------



2480	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06AREF ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 TBD Contract Work				
------	--	---	--	--	--	--



Facility: **HEALTH SERVICES-BRAUNER BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**

Year to be Completed: **TBD**


Priority No: **4**


Address: 330 CAMPUS DR.

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Turn Space</u>						
2481	<ul style="list-style-type: none"> <i>As-Built Description:</i> Less than 60" diameter or T-shaped space provided for wheelchair turns. <i>As-Built:</i> 43"-52" <i>Proposed Solution:</i> Retrofit space to provide 60" diameter or T-turn. 	PCODE IN04 ADAAG 4.2.3 ADA 2010 304.1 CBC 2010 1118B.3 CBC 2013 11B-304.1 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$925	\$925
						

3 Large Break Room & Classroom

Drinking Fountain

2496	<ul style="list-style-type: none"> <i>As-Built Description:</i> Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping. <i>Proposed Solution:</i> Provide additional fountain or hi-lo combination fountain. 	PCODE IA01A ADAAG 4.1.3(10)(a) ADA 2010 211.1 CBC 2010 1115B.4.6.1 CBC 2013 11B-211.1 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$2,000	\$2,000
						

2495	<ul style="list-style-type: none"> <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain). <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA02 ADAAG 4.15.5(1) ADA 2010 602.2 CBC 2010 1115B.4.6.2 CBC 2013 11B-602.2 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$3,200	\$3,200
						

Facility: **HEALTH SERVICES-BRAUNER BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Year to be Completed: **TBD**

Priority No: **3**

Address: 330 CAMPUS DR.

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2494	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. <i>As-Built:</i> 24" wide <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	<p>PCODE IA04</p> <p>CBC 2010 1115B.4.6.3; Fig.</p> <p>CBC 2013 11B-602.9</p> <p>Priority 3</p> <p>Severity 2</p> <p>TBD Contract Work</p>	1	JOB	\$3,000	\$3,000



Non-Fixed Desk

2489	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> 26.5" <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	<p>PCODE IN02A</p> <p>ADAAG 4.32.3 & .4</p> <p>ADA 2010 306.1</p> <p>CBC 2010 1122B.3 & 4</p> <p>CBC 2013 11B-306.1 & 11B-902.3</p> <p>Priority 4</p> <p>Severity 2</p> <p>TBD Contract Work</p>	1	JOB	\$1,600	\$1,600
------	--	--	---	-----	---------	----------------



Public Counter

2492	<ul style="list-style-type: none"> <i>As-Built Description:</i> Service Counter (Stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. <i>As-Built:</i> 42" <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. <i>Notes:</i> No longer in use 	<p>PCODE IN03REF</p> <p>ADAAG 7.2(2)</p> <p>ADA 2010 904.4</p> <p>CBC 2010 1122B.4</p> <p>CBC 2013 11B-904.4</p> <p>Priority 2</p> <p>Severity 3</p> <p>TBD Contract Work</p>	REF			
------	---	---	-----	--	--	--



4 Two Unisex Restrooms

Facility: **HEALTH SERVICES-BRAUNER BUILDING**


Area: **Interior**


Part/Floor: **Ground Floor**


Year to be Completed: **TBD**

Priority No: **3**

Address: 330 CAMPUS DR.

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Clearance</u>						
2502	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 27" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01REF ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 3 Severity 2 TBD Contract Work				REF
						

<u>Lavatory</u>						
2504	<ul style="list-style-type: none"> <i>As-Built Description:</i> Knee clearance 27" min. high starting 8" back from the front edge of the lavatory towards the wall is not provided. <i>As-Built:</i> 24" <i>Proposed Solution:</i> Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD04REF ADAAG Fig. 31 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-306.3.3 Priority 3 Severity 2 TBD Contract Work				REF
						
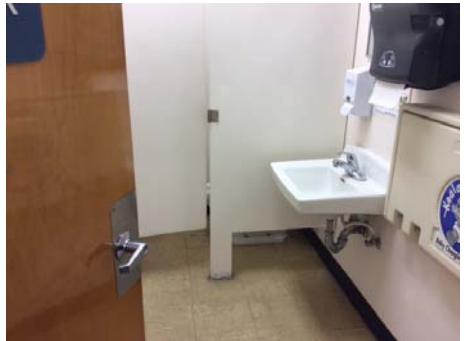
<u>Restroom</u>						
2499	<ul style="list-style-type: none"> <i>As-Built Description:</i> Single accommodation restroom not accessible; multiple compliance violations. <i>Proposed Solution:</i> Remodel area to provide single-occupant accessible restroom. Notes: Provide one compliant unisex RR 	PCODE WA01 ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.2 CBC 2013 11B-603 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$30,000	\$30,000
						

Facility: **HEALTH SERVICES-BRAUNER BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**


Year to be Completed: **TBD**


Priority No: **3**

Address: 330 CAMPUS DR.

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Toilet Stall</u>						
2503	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Toilet stall less than 60" wide. • <i>As-Built:</i> 35.5" • <i>Proposed Solution:</i> Provide new accessible stall. 	<p>PCODE WB06</p> <p>ADAAG 4.17.3</p> <p>ADA 2010 604.8.1.1</p> <p>CBC 2010 1115B.3.1.4.1</p> <p>CBC 2013 11B-604.8.1.1</p> <p>Priority 3</p> <p>Severity 1</p> <p>TBD Contract Work</p>	1	JOB	\$1,500	\$1,500
						

6 Office Corridor to Building 1 Restrooms

<u>Door Clearance</u>						
2516	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. • <i>As-Built:</i> 27" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	<p>PCODE ID01REF</p> <p>ADAAG 4.13.5</p> <p>ADA 2010 404.2.3</p> <p>CBC 2010 1133B.1111</p> <p>CBC 2013 11B-404.2.3</p> <p>Priority 3</p> <p>Severity 2</p> <p>TBD Contract Work</p>	REF			

<u>Restroom</u>						
2515	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Single accommodation restroom not accessible; multiple compliance violations. • <i>Proposed Solution:</i> Remodel area to provide single-occupant accessible restroom. • Notes: Provide one compliant unisex RR 	<p>PCODE WA01</p> <p>ADAAG 4.22</p> <p>ADA 2010 603</p> <p>CBC 2010 1115B.3.2</p> <p>CBC 2013 11B-603</p> <p>Priority 3</p> <p>Severity 2</p> <p>TBD Contract Work</p>	1	JOB	\$30,000	\$30,000
						

Facility: **HEALTH SERVICES-BRAUNER BUILDING**


Area: **Interior**

Part/Floor: **Ground Floor**

Year to be Completed: **TBD**


Priority No: **3**

Address: 330 CAMPUS DR.

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Toilet Stall</u>						
2517	<ul style="list-style-type: none"> As-Built Description: Toilet stall less than 60" wide. As-Built: 35.5" Proposed Solution: Provide new accessible stall. 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 3 Severity 1 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

7 Resource Room

Non-Fixed Desk

2520	<ul style="list-style-type: none"> As-Built Description: Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. As-Built: 22.5" wide Proposed Solution: Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

Total Costs for Part/floor: Interior Ground Floor \$77,875.00

Facility: **HEALTH SERVICES-BRAUNER BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Year to be Completed: **TBD**

Priority No: **2**

Address: 330 CAMPUS DR.

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Total Costs for		Area: Interior				\$77,875.00

Facility: **HEALTH SERVICES-BRAUNER BUILDING**

Area: **Interior**

Part/Floor: **Ground Floor**

Year to be Completed: **TBD**

Priority No: **2**

Address: 330 CAMPUS DR.

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Total Costs for Facility: HEALTH SERVICES-BRAUNER						\$77,875.00

Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.

Area: **Exterior**
 Year to be Completed: **TBD**


Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------


1 Accessible Parking Serving Main Entrance

Floor or Ground Surfaces

2925	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space has slope greater than 1/4":12" (2%). <i>As-Built:</i> Portions along drainage <i>Proposed Solution:</i> Modify slope at accessible parking space. 	PCODE EA05 ADAAG 4.6.3 ADA 2010 502.4 CBC 2010 1129B.3.3 CBC 2013 11B-502.4 Priority 1 Severity 4 TBD Contract Work	160	SF	\$12	\$1,920
------	--	--	-----	----	------	---------




2926	<ul style="list-style-type: none"> <i>As-Built Description:</i> Access aisle at accessible parking space has slope greater than 1/4":12" (2%) due to built-up curb ramp within aisle. <i>As-Built:</i> 11.7% <i>Proposed Solution:</i> Provide curb cut. 	PCODE EA05A ADAAG 4.6.3 ADA 2010 502.4 CBC 2010 1129B.3.3 CBC 2013 11B-502.4 Priority 1 Severity 1 TBD Contract Work	1	JOB	\$2,500	\$2,500
------	---	---	---	-----	---------	---------



Parking

2923	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space does not have 5' wide access aisle; 8' wide for van accessible aisle. <i>Proposed Solution:</i> Modify parking aisle(s) to create accessible space by restriping. 	PCODE EA02B ADAAG 4.6.3 ADA 2010 502.3 CBC 2010 1129B.3.1 CBC 2013 11B-502.2; 11B-502.3.1 Priority 1 Severity 1 TBD Contract Work	1	JOB	\$200	\$200
------	--	--	---	-----	-------	-------



Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2924	<ul style="list-style-type: none"> <i>As-Built Description:</i> International Symbol of Accessibility (36" square, in white on blue) is not painted on the pavement near the rear end of the parking space (required in CA only). <i>As-Built:</i> Faded <i>Proposed Solution:</i> Apply symbol on parking space pavement when altering area. 	PCODE EA04A CBC 2010 1129B.4 CBC 2013 11B-502.6.4 Priority 1 Severity 4 TBD Contract Work	1	JOB	\$120	\$120



2 POT to Staff Entrances

Changes in Level

2933	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route. <i>As-Built:</i> 1.5" <i>Proposed Solution:</i> Remove, replace or repair area of pavement sufficient to correct abrupt change in level. 	PCODE EF03REF ADAAG 4.3.8 ADA 2010 403.4 CBC 2010 1133B.7.4 CBC 2013 11B-403.4 Priority 1 Severity 3 TBD Contract Work	REF			
------	---	---	-----	--	--	--



2930	<ul style="list-style-type: none"> <i>As-Built Description:</i> Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route. <i>As-Built:</i> 1" gap <i>Proposed Solution:</i> Remove, replace or repair area of pavement sufficient to correct abrupt change in level. 	PCODE EF03REF ADAAG 4.3.8 ADA 2010 403.4 CBC 2010 1133B.7.4 CBC 2013 11B-403.4 Priority 1 Severity 4 TBD Contract Work	REF			
------	---	---	-----	--	--	--



Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.


Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Cross Slope

2928	<ul style="list-style-type: none"> As-Built Description: Cross slope more than 1":48" (2.083%). As-Built: 2.3-9.1% Proposed Solution: Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 2 TBD Contract Work	280	SF	\$25	\$7,000
------	--	--	-----	----	------	---------




2932	<ul style="list-style-type: none"> As-Built Description: Cross slope more than 1":48" (2.083%). As-Built: 2.5-4.2% Proposed Solution: Modify cross slope. 	PCODE EF07 ADAAG 4.3.7 ADA 2010 403.3 CBC 2010 1133B.7.1.3 CBC 2013 11B-403.3 Priority 1 Severity 3 TBD Contract Work	200	SF	\$25	\$5,000
------	--	--	-----	----	------	---------



Door

2931	<ul style="list-style-type: none"> As-Built Description: Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). As-Built: 3.7% Proposed Solution: Modify surface slope at door. 	PCODE ID11REF ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 1 Severity 4 TBD Contract Work	REF			
------	---	--	-----	--	--	--

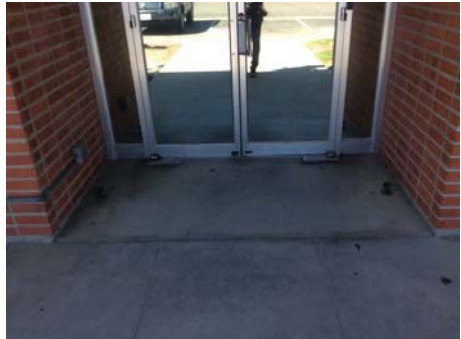

3 POT to Main Entrances

Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Changes in Level

- 2934
- *As-Built Description:*
Walk: Pavement dislocation creates abrupt change in level exceeding 1/2" in accessible route.
 - *As-Built:* 0.75" gap
 - *Proposed Solution:*
Remove, replace or repair area of pavement sufficient to correct abrupt change in level.

PCODE **EF03REF**
 ADAAG **4.3.8**
 ADA 2010 **403.4**
 CBC 2010 **1133B.7.4**
 CBC 2013 **11B-403.4**
 Priority **1**
 Severity **4**
 TBD Contract Work

REF



Cross Slope

- 2935
- *As-Built Description:*
Cross slope more than 1":48" (2.083%).
 - *As-Built:* 2.3-3.4%
 - *Proposed Solution:*
Modify cross slope.

PCODE **EF07**
 ADAAG **4.3.7**
 ADA 2010 **403.3**
 CBC 2010 **1133B.7.1.3**
 CBC 2013 **11B-403.3**
 Priority **1**
 Severity **4**
 TBD Contract Work

132 SF \$25 **\$3,300**



Total Costs for	Part/floor: Exterior	On-site	\$20,040.00
------------------------	-----------------------------	----------------	--------------------

Facility: **HEALTH SERVICES-MAIN BLDG**
Address: 330 CAMPUS DR.

Area: **Exterior**
Year to be Completed: **TBD**

Part/Floor: **On-site**
Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for Area: Exterior \$20,040.00

Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Main Entrance & Lobby

Drinking Fountain

2448	<ul style="list-style-type: none"> As-Built Description: Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping. Proposed Solution: Provide additional fountain or hi-lo combination fountain. 	<p>PCODE IA01A ADAAG 4.1.3(10)(a) ADA 2010 211.1 CBC 2010 1115B.4.6.1 CBC 2013 11B-211.1 Priority 3 Severity 2 TBD Contract Work</p>	1	JOB	\$2,000	\$2,000
2447	<ul style="list-style-type: none"> As-Built Description: Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain). Unit in good condition. Proposed Solution: Remount fountain at accessible height. 	<p>PCODE IA02A ADAAG 4.15.5(1) ADA 2010 602.2 CBC 2010 1115B.4.6.2 CBC 2013 11B-602.2 Priority 3 Severity 2 TBD Contract Work</p>	1	JOB	\$1,200	\$1,200
2446	<ul style="list-style-type: none"> As-Built Description: CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. Proposed Solution: Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	<p>PCODE IA04 CBC 2010 1115B.4.6.3; Fig. CBC 2013 11B-602.9 Priority 3 Severity 2 TBD Contract Work</p>	1	JOB	\$3,000	\$3,000

Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Operating Hardware

2435 • *As-Built Description:*
 Where push plates are provided, two shall be provided: the centerline of one shall be located between 7-8" above the floor, and the second shall be located between 30-44" above the floor.

• *Proposed Solution:*
 Remount push plates such that they are compliant.

• *Notes:*
no lower button

PCODE ID29
 CBC 2013 11B-404.2.9
 Priority 1
 Severity 2
TBD Contract Work

1 JOB \$200 \$200




Public Counter

2439 • *As-Built Description:*
 Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided.

• *As-Built:* 42"
 • *Proposed Solution:*
 Provide auxiliary shelf, clipboard, or table as equivalent facilitation.

PCODE IN03
 ADAAG 7.2(2)
 ADA 2010 904.4
 CBC 2010 1122B.4
 CBC 2013 11B-904.4
 Priority 1
 Severity 3
TBD Contract Work

1 JOB \$150 \$150

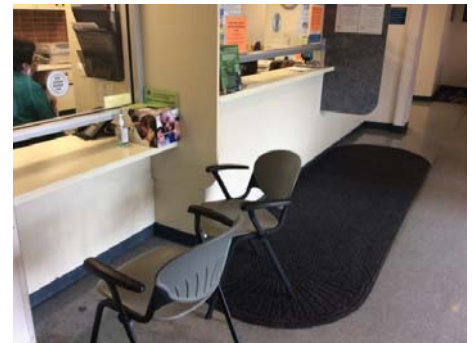


2440 • *As-Built Description:*
 Public Counter (Seated Service): Accessible section not provided (knee space min. 27" high x 19" deep x 30" wide, top 28" to 34" high, min. 36" counter wide).

• *As-Built:* 9" deep
 • *Proposed Solution:*
 Retrofit existing counter to provide accessible seating section.
 Interim solution: Provide auxiliary counter or table.

PCODE IN03A
 ADAAG 4.32.3 & 4
 ADA 2010 306.3; 904.4
 CBC 2010 1122B.3 & 4
 CBC 2013 11B-306.3; 11B-904.4
 Priority 1
 Severity 2
TBD Contract Work

1 JOB \$1,200 \$1,200

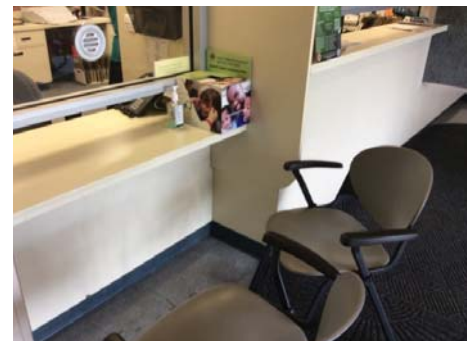

2 Public Restroom - Men's

Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Door Clearance

2453 • *As-Built Description:*
 Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open.
 • *As-Built:* 27"
 • *Proposed Solution:*
 Provide new, larger door and frame with new accessible hardware.

PCODE ID01REF
ADAAG 4.13.5
ADA 2010 404.2.3
CBC 2010 1133B.1.1.1.1
CBC 2013 11B-404.2.3
Priority 3
Severity 2
TBD Contract Work

REF



Lavatory

2455 • *As-Built Description:*
 Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.
 • *Proposed Solution:*
 Provide accessible faucet at accessible lavatory.

PCODE WD06REF
ADAAG 4.19.5
ADA 2010 606.4
CBC 2010 1115B.4.3
CBC 2013 11B-606.4
Priority 3
Severity 3
TBD Contract Work

REF




Restroom

2454 • *As-Built Description:*
 Multiple accommodation restroom not accessible; multiple compliance violations.
 • *As-Built:* 33.5"
 • *Proposed Solution:*
 Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens).

PCODE WA01A
ADAAG 4.22
ADA 2010 603
CBC 2010 1115B.3.1
CBC 2013 11B-603
Priority 3
Severity 1
TBD Contract Work

1 JOB \$35,000 **\$35,000**

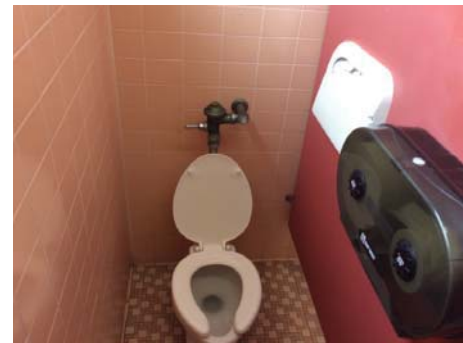

Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Urinal

- 2456
- *As-Built Description:*
 36" wide clearance in front of accessible urinal not provided when walls or partitions project more than 24" from the front edge of 30" x 48" clear space.
 - *As-Built:* 32.5"
 - *Proposed Solution:*
 Provide 36" clear floor space in front of accessible urinal. Remodel restroom as needed.

PCODE **WE04A**
 ADAAG **4.18.3**
 ADA 2010 **605.3**
 CBC 2010 **1115B.4.2.3**
 CBC 2013 **11B-605.3**
 Priority **3**
 Severity **2**
TBD Contract Work

1 JOB \$1,500 **\$1,500**




3 Public Restroom - Women's

Door Clearance

- 2459
- *As-Built Description:*
 Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open.
 - *As-Built:* 27"
 - *Proposed Solution:*
 Provide new, larger door and frame with new accessible hardware.

PCODE **ID01REF**
 ADAAG **4.13.5**
 ADA 2010 **404.2.3**
 CBC 2010 **1133B.1.1.1.1**
 CBC 2013 **11B-404.2.3**
 Priority **3**
 Severity **2**
TBD Contract Work

REF

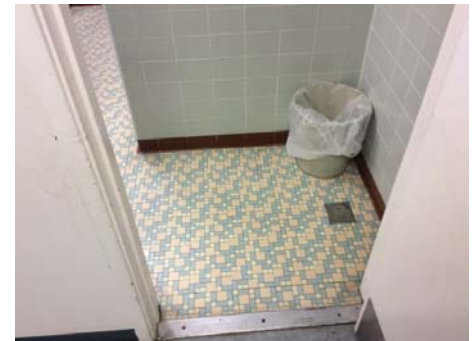


Door Swing

- 2460
- *As-Built Description:*
 Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60".
 - *As-Built:* 35"
 - *Proposed Solution:*
 Provide relocated new door and frame; remodel walls as needed.

PCODE **ID23BREF**
 ADAAG **Fig. 25(a)**
 ADA 2010 **404.2.4**
 CBC 2010 **11B-26A(a)**
 CBC 2013 **11B-404.2.4**
 Priority **3**
 Severity **2**
TBD Contract Work


REF

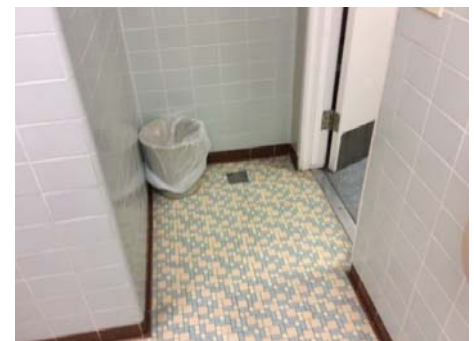

Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Toilet Stall</u>						
2461	<ul style="list-style-type: none"> As-Built Description: Toilet stall less than 60" wide. As-Built: 32" Proposed Solution: Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	PCODE WB06REF ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 3 Severity 1 TBD Contract Work				
						REF
						

4 Corridor to Building 2

Accessories

2254	<ul style="list-style-type: none"> As-Built Description: Accessories in sanitary facilities not accessible, hardware requires tight grasping, pinching, or twisting of the wrist. As-Built: First Aid Proposed Solution: Provide accessories with accessible operating mechanism. 	PCODE WG05REF ADAAG 4.27.4 ADA 2010 309.4 CBC 2010 1117B.6 CBC 2013 11B-309.4 Priority 3 Severity 3 TBD Contract Work				
						REF
						



Drinking Fountain

2257	<ul style="list-style-type: none"> As-Built Description: Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping. Proposed Solution: Provide additional fountain or hi-lo combination fountain. 	PCODE IA01A ADAAG 4.1.3(10)(a) ADA 2010 211.1 CBC 2010 1115B.4.6.1 CBC 2013 11B-211.1 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$2,000	\$2,000
						

Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2256	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Drinking fountain bubbler more than 36" above floor. • <i>As-Built:</i> 38" • <i>Proposed Solution:</i> Provide new, accessible fountain. 	PCODE IA03B ADAAG 4.15.2 ADA 2010 602.4 CBC 2010 1115B.4.6.4 CBC 2013 11B-602.4 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$3,200	\$3,200
						
2255	<ul style="list-style-type: none"> • <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. • <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	PCODE IA04 CBC 2010 1115B.4.6.3; Fig. CBC 2013 11B-602.9 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$3,000	\$3,000
						

5 Staff Break Room


Non-Fixed Desk


2272	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. • <i>As-Built:</i> 26.5" • <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**


Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Sink						
2269	<ul style="list-style-type: none"> As-Built Description: Sink does not have knee space min. 27" high x 19" deep x 30" wide. Proposed Solution: Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

2268	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 36" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work	REF			
------	--	---	-----	--	--	--

6 Corridor Staff Restroom - Men's


Lavatory


2281	<ul style="list-style-type: none"> As-Built Description: Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory. Proposed Solution: Provide accessible faucet at accessible lavatory. 	PCODE WD06REF ADAAG 4.19.5 ADA 2010 606.4 CBC 2010 1115B.4.3 CBC 2013 11B-606.4 Priority 4 Severity 3 TBD Contract Work	REF			
------	---	---	-----	---	--	--


Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Restroom</u>						
2277	<ul style="list-style-type: none"> <i>As-Built Description:</i> Single accommodation restroom not accessible; multiple compliance violations. <i>Proposed Solution:</i> Remodel area to provide single-occupant accessible restroom. 	PCODE WA01 ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.2 CBC 2013 11B-603 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$30,000	\$30,000
						

<u>Toilet Stall</u>						
2278	<ul style="list-style-type: none"> <i>As-Built Description:</i> Toilet stall less than 60" wide. <i>As-Built:</i> 37" <i>Proposed Solution:</i> Provide new accessible stall. 	PCODE WB06 ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

<u>Urinal</u>						
2279	<ul style="list-style-type: none"> <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor. <i>As-Built:</i> 25" <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE02REF ADAAG 4.18.2 ADA 2010 605.2 CBC 2010 1115B.4.2.1 CBC 2013 11B-605.2 Priority 4 Severity 2 TBD Contract Work	REF			
						

7 Corridor Staff Restroom - Women's

Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Door Swing

- 2289
- *As-Built Description:*
 Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60".
 - *As-Built:* 7" to wall
 - *Proposed Solution:*
 Remodel as needed.

PCODE **ID23BREF**
 ADAAG **Fig. 25(a)**
 ADA 2010 **404.2.4**
 CBC 2010 **11B-26A(a)**
 CBC 2013 **11B-404.2.4**
 Priority **4**
 Severity **3**
 TBD **Contract Work**

REF



Lavatory

- 2291
- *As-Built Description:*
 Lavatory: Fixture rim or counter height more than 34" above floor.
 - *As-Built:* 34.5"
 - *Proposed Solution:*
 Provide new accessible lavatory. Remodel restroom as needed.

PCODE **WD02REF**
 ADAAG **4.19.2**
 ADA 2010 **606.3**
 CBC 2010 **1115B.4.3**
 CBC 2013 **11B-606.3**
 Priority **4**
 Severity **4**
 TBD **Contract Work**

REF



- 2290
- *As-Built Description:*
 Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory.
 - *Proposed Solution:*
 Provide accessible faucet at accessible lavatory.

PCODE **WD06REF**
 ADAAG **4.19.5**
 ADA 2010 **606.4**
 CBC 2010 **1115B.4.3**
 CBC 2013 **11B-606.4**
 Priority **4**
 Severity **3**
 TBD **Contract Work**


REF




Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Restroom</u>						
2287	<ul style="list-style-type: none"> <i>As-Built Description:</i> Multiple accommodation restroom not accessible; multiple compliance violations. <i>Proposed Solution:</i> Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens). 	PCODE WA01A ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.1 CBC 2013 11B-603 Priority 4 Severity 1 TBD Contract Work	1	JOB	\$35,000	\$35,000
						

<u>Toilet Stall</u>						
2288	<ul style="list-style-type: none"> <i>As-Built Description:</i> Toilet stall less than 60" wide. <i>As-Built:</i> 37" <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	PCODE WB06REF ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 4 Severity 2 TBD Contract Work	REF			

8 Corridor Exit to Building 2


<u>Door</u>						
2296	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 3.9% at 49" from door <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 4 TBD Contract Work	5	SF	\$40	\$200
						


9 Mail Room


Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Door Swing						
2301	<ul style="list-style-type: none"> As-Built Description: Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60". As-Built: 14.5" Proposed Solution: Change door swing from latch to hinge side. 	PCODE ID23 ADAAG Fig. 25(a) ADA 2010 404.2.4 CBC 2010 11B-26A(a) CBC 2013 11B-404.2.4 Priority 2 Severity 4 TBD Contract Work	1	JOB	\$500	\$500
						

Sink						
2303	<ul style="list-style-type: none"> As-Built Description: Sink does not have knee space min. 27" high x 19" deep x 30" wide. Proposed Solution: Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						


2302	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 36" Proposed Solution: Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work	REF			
						


10 Lab


Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Counter						
2319	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible counter (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> Fume hood. 36.5" <i>Proposed Solution:</i> Provide new section of counter at 34" high max. 	PCODE IN02B ADAAG 4.32.3 & .4 ADA 2010 902.3 CBC 2010 1122B.3 & 4 CBC 2013 11B-902.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$2,500	\$2,500
						



Lab						
2318	<ul style="list-style-type: none"> <i>As-Built Description:</i> Minimum of at least one of each type of sink and other specialized equipment such as fume hoods, microscopes, emergency eyewash and showers, etc, associated with the special use activity is not accessible. <i>Proposed Solution:</i> Remodel existing cabinet/counter to make specialized equipment accessible to disabled persons. 	PCODE LB01B CBC 2010 1106B.2 CBC 2013 11B-805.7 Priority 2 Severity 3 TBD Contract Work	1	JOB	\$1,800	\$1,800
						

Sink						
2317	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						


Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2321	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						
2322	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink rim higher than 34" above floor. <i>As-Built:</i> 37.5" <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	PCODE IN06REF ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work				REF
						

Vertical Clearance


2320	<ul style="list-style-type: none"> <i>As-Built Description:</i> Overhead clearance less than 80" above finished floor. <i>As-Built:</i> Emergency shower. 78.5" <i>Proposed Solution:</i> Modify overhead clearance. 	PCODE EG01 ADAAG 4.4.2 ADA 2010 307.4 CBC 2010 1133B.8.6.2 CBC 2013 11B-307.4 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$120	\$120
						


11 Nurses Offices - Staff Only


Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Counter						
2340	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible counter (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> 42" <i>Proposed Solution:</i> Provide new section of counter at 34" high max. <i>Notes:</i> Staff Only 	PCODE IN02B ADAAG 4.32.3 & .4 ADA 2010 902.3 CBC 2010 1122B.3 & 4 CBC 2013 11B-902.3 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$2,500	\$2,500
						

Door Clearance						
2336	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 29" wide <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. <i>Notes:</i> Room 300-H only 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$2,600	\$2,600
						


Door Pair						
2333	<ul style="list-style-type: none"> <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. <i>As-Built:</i> 26.5" <i>Proposed Solution:</i> Provide new door leaves, unequal in width, to existing frame for pair of doors. 	PCODE ID08A ADAAG 4.13.4 ADA 2010 404.2.2 CBC 2010 1133B.2.3.1 CBC 2013 11B-404.2.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

12 Nurses Offices Lobby


Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**


Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Public Counter</u>						
2343	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. • <i>As-Built:</i> 43.25" • <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. 	PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$150	\$150
						

13 Staff Corridor Medical Records

<u>Door Pair</u>						
2355	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. • <i>As-Built:</i> 27" • <i>Proposed Solution:</i> Provide new door leaves, unequal in width, to existing frame for pair of doors. 	PCODE ID08A ADAAG 4.13.4 ADA 2010 404.2.2 CBC 2010 1133B.2.3.1 CBC 2013 11B-404.2.2 Priority 1 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

14 Breastfeeding Lounge

<u>Sink</u>						
2362	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sink rim higher than 34" above floor. • <i>As-Built:</i> 39" • <i>Proposed Solution:</i> Remodel sink cabinet to lower sink. 	PCODE IN06 ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2363	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. • <i>Proposed Solution:</i> Remodel sink cabinet. 	PCODE IN06AREF ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 2 Severity 2 TBD Contract Work				
2364	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sink faucet controls not accessible. • <i>Proposed Solution:</i> Provide accessible sink faucet controls. 	PCODE IN07 ADAAG 4.24.7 ADA 2010 606.4 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.4 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$600	\$600



15 Staff Women's Restroom - Records

Door Clearance

2370	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. • <i>As-Built:</i> 27" • <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$2,600	\$2,600



Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Lavatory</u>						
2372	<ul style="list-style-type: none"> As-Built Description: Knee clearance 27" min. high starting 8" back from the front edge of the lavatory towards the wall is not provided. As-Built: 26" Proposed Solution: Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD04REF ADAAG Fig. 31 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-306.3.3 Priority 4 Severity 2 TBD Contract Work				
						REF




<u>Restroom</u>						
2371	<ul style="list-style-type: none"> As-Built Description: Multiple accommodation restroom not accessible; multiple compliance violations. As-Built: 32" wide Proposed Solution: Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens). 	PCODE WA01A ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.1 CBC 2013 11B-603 Priority 4 Severity 1 TBD Contract Work	1	JOB	\$35,000	\$35,000



17 CD Office

<u>Public Counter</u>						
2378	<ul style="list-style-type: none"> As-Built Description: Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. As-Built: 42" Proposed Solution: Provide auxiliary shelf, clipboard, or table as equivalent facilitation. Notes: Staff Only 	PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 4 Severity 3 TBD Contract Work	1	JOB	\$150	\$150

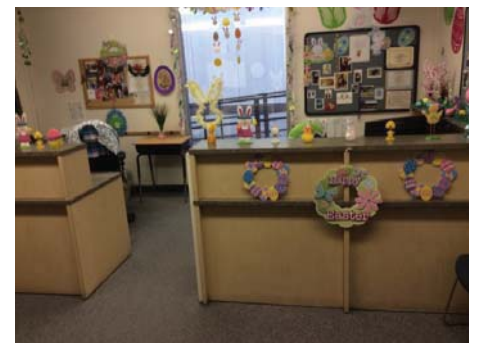



19 Exam Room 304

Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Sink						
2388	<ul style="list-style-type: none"> As-Built Description: Sink rim higher than 34" above floor. As-Built: 36" Proposed Solution: Remodel sink cabinet to lower sink. Notes: Staff Only 	PCODE IN06 ADAAG 4.24.2 ADA 2010 606.3 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.3 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

2389	<ul style="list-style-type: none"> As-Built Description: Sink does not have knee space min. 27" high x 19" deep x 30" wide. Proposed Solution: Remodel sink cabinet. Notes: Staff Only 	PCODE IN06AREF ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work				
			REF 			

20 Exam Room 306 - Check Up


Sink						
2395	<ul style="list-style-type: none"> As-Built Description: Sink does not have knee space min. 27" high x 19" deep x 30" wide. Proposed Solution: Remodel sink cabinet. Notes: Staff Only 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						


22 Exam Room 312

Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Exam Bed</u>						
2403	<ul style="list-style-type: none"> <i>As-Built Description:</i> Seat front edge height is not between 17" min. to 19" max. above ground of floor space. <i>As-Built:</i> 24" <i>Proposed Solution:</i> Provide transfer or lift beds in designated accessible exam rooms. <i>Notes:</i> Provide existing adjustable bed in accessible room. 	PCODE NO06ANT ADAAG 4.37.5 ADA 2010 903.5 CBC 2010 1132B.1 CBC 2013 11B-903.5 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$600	\$600
						

<u>Sink</u>						
2401	<ul style="list-style-type: none"> <i>As-Built Description:</i> Sink does not have knee space min. 27" high x 19" deep x 30" wide. <i>As-Built:</i> Top 36" AFF <i>Proposed Solution:</i> Remodel sink cabinet. <i>Notes:</i> Top 36" AFF. Staff Only 	PCODE IN06A ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$1,750	\$1,750
						

23 Unisex Restroom

<u>Restroom</u>						
2406	<ul style="list-style-type: none"> <i>As-Built Description:</i> Single accommodation restroom not accessible; multiple compliance violations. <i>Proposed Solution:</i> Remodel area to provide single-occupant accessible restroom. 	PCODE WA01 ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.2 CBC 2013 11B-603 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$30,000	\$30,000
						

Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Water Closet</u>						
2407	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: In single-accommodation restroom less than 48" in front of water closet provided. <i>As-Built:</i> 12.5" <i>Proposed Solution:</i> Remodel restroom to provide at least 48" in front of water closet. 	PCODE WB03AREF CBC 2010 1115B.3.2.1 CBC 2013 11B-604.3.1 Priority 3 Severity 1 TBD Contract Work				



24 Corridor to Lab

<u>Door Threshold</u>						
2422	<ul style="list-style-type: none"> <i>As-Built Description:</i> Existing threshold at door is 1/2" high or less but without a beveled edge on both sides. <i>As-Built:</i> 0.5" <i>Proposed Solution:</i> Modify threshold to have beveled edge on each side. 	PCODE ID02 ADAAG 4.1.6(3)(d)(ii) ADA 2010 404.2.5 CBC 2010 1133B.2.4.1 CBC 2013 11B-404.2.5 Priority 2 Severity 4 TBD Contract Work				



25 Patio


<u>Door</u>						
2427	<ul style="list-style-type: none"> <i>As-Built Description:</i> Surface of required maneuvering clearance at door slopes more than 1/4":12" (2.0%). <i>As-Built:</i> 8.1% <i>Proposed Solution:</i> Modify surface slope at door. 	PCODE ID11 ADAAG 4.13.6 ADA 2010 404.2.4.4 CBC 2010 1133B.2.4 CBC 2013 11B-404.2.4 Priority 2 Severity 2 TBD Contract Work				




Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Door Pair</u>						
2425	<ul style="list-style-type: none"> <i>As-Built Description:</i> Pair of doors on accessible route has less than 32" clear opening width with one leaf open 90°. <i>As-Built:</i> 27" <i>Proposed Solution:</i> Provide new door leaves, unequal in width, to existing frame for pair of doors. 	PCODE ID08A ADAAG 4.13.4 ADA 2010 404.2.2 CBC 2010 1133B.2.3.1 CBC 2013 11B-404.2.2 Priority 1 Severity 2 TBD Contract Work	1	JOB	\$1,500	\$1,500
						

<u>Picnic Area</u>						
2428	<ul style="list-style-type: none"> <i>As-Built Description:</i> Knee clearance at minimums 27" high, 30" wide, and 19" deep is not provided. <i>As-Built:</i> 4.5" deep <i>Proposed Solution:</i> Modify picnic table as required to provide knee clearance. 	PCODE NH11A ADAAG 16.5.4. ADA 2010 902.2 CBC 2010 1132B.1 CBC 2013 11-902.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$850	\$850
						


26 Negative Pressure Room

<u>Exam Bed</u>						
2434	<ul style="list-style-type: none"> <i>As-Built Description:</i> Seat front edge height is not between 17" min. to 19" max. above ground of floor space. <i>As-Built:</i> 27" <i>Proposed Solution:</i> Provide transfer or lift beds in designated accessible exam rooms. 	PCODE NO06ANT ADAAG 4.37.5 ADA 2010 903.5 CBC 2010 1132B.1 CBC 2013 11B-903.5 Priority 2 Severity 1 TBD Contract Work	1	JOB	\$600	\$600
						

Facility: **HEALTH SERVICES-MAIN BLDG**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Non-Fixed Desk</u>						
2431	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> due to table leg <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						

Total Costs for	Part/floor: Interior	Ground Floor	\$223,670.00
------------------------	-----------------------------	---------------------	---------------------

Facility: **HEALTH SERVICES-MAIN BLDG**
Address: 330 CAMPUS DR.

Area: **Interior**
Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Area: Interior					\$223,670.00
------------------------	-----------------------	--	--	--	--	---------------------

Facility: **HEALTH SERVICES-MAIN BLDG**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: HEALTH SERVICES-MAIN BLDG					\$243,710.00
------------------------	--	--	--	--	--	---------------------

Facility: **HEALTH DEPT. MODULAR**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 North Entrance

Change in Direction

- 2735
- *As-Built Description:*
Landing at change of direction not 60" minimum by 72" minimum in the direction of downward travel from the upper ramp run.
 - *As-Built:* 60" x 60"
 - *Proposed Solution:*
Modify landing at change of direction to 60" x 72".

PCODE **EB08**
 ADAAG **4.8.4(3)**
 ADA 2010 **405.7.4**
 CBC 2010 **1133B.5.4**
 CBC 2013 **11B-405.7.4**
 Priority **1**
 Severity **4**
TBD Contract Work

5 SF \$45 **\$225**



Curb or Barrier

- 2733
- *As-Built Description:*
No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp.
 - *As-Built:* 5"-6.5" o.c.
 - *Proposed Solution:*
Provide 2" minimum curb or wheel guide.

PCODE **EB14**
 ADAAG **4.8.7**
 ADA 2010 **405.9.2**
 CBC 2010 **1133B.5.6**
 CBC 2013 **11B-405.9.2**
 Priority **1**
 Severity **2**
TBD Contract Work

64 LF \$17 **\$1,088**



Slope

- 2732
- *As-Built Description:*
Slope greater than 1:12 (8.3%).
 - *As-Built:* 8.7%-18.5% at lower ramp
 - *Proposed Solution:*
Demolish existing and provide new ramp with handrails.
 - *Notes:*
Provide longer ramp and extend handrails

PCODE **EB02**
 ADAAG **4.8.2**
 ADA 2010 **405.2**
 CBC 2010 **1133B.5.3**
 CBC 2013 **11B-405.2**
 Priority **1**
 Severity **2**
TBD Contract Work

100 SF \$100 **\$10,000**



Facility: **HEALTH DEPT. MODULAR**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**


Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
2731	<ul style="list-style-type: none"> <i>As-Built Description:</i> Slope greater than 1:12 (8.3%). <i>As-Built:</i> Transition at bottom: 18.5% <i>Proposed Solution:</i> Demolish existing and provide new ramp with handrails. 	PCODE EB02REF ADAAG 4.8.2 ADA 2010 405.2 CBC 2010 1133B.5.3 CBC 2013 11B-405.2 Priority 1 Severity 2 TBD Contract Work				
						REF



Top and Bottom Extension at Ramps

2734	<ul style="list-style-type: none"> <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). <i>Notes:</i> Remodel area. 	PCODE ED05REF ADAAG 4.8.5(2) ADA 2010 505.10.1 CBC 2010 1133B.4.2.2 & CBC 2013 11B-505.10.1 Priority 1 Severity 2 TBD Contract Work				
						REF

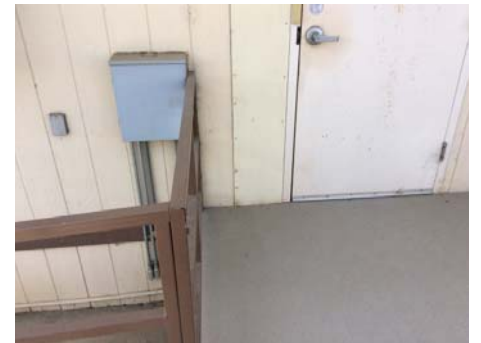

2 South Entrance

Curb or Barrier


2737	<ul style="list-style-type: none"> <i>As-Built Description:</i> No curb (2" minimum height) or wheel guide (centered approx. 3" above surface of ramp) at sides of ramp. <i>As-Built:</i> 5.5" o.c. <i>Proposed Solution:</i> Provide 2" minimum curb or wheel guide. 	PCODE EB14 ADAAG 4.8.7 ADA 2010 405.9.2 CBC 2010 1133B.5.6 CBC 2013 11B-405.9.2 Priority 1 Severity 2 TBD Contract Work	60	LF	\$17	\$1,020
------	--	--	----	----	------	---------





Facility: **HEALTH DEPT. MODULAR**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Height						
2740	<ul style="list-style-type: none"> As-Built Description: Handrail gripping surface top not mounted between 34" and 38" above ramp surface or stair nosings. As-Built: 33" at top Proposed Solution: Remove existing and provide new handrail. 	PCODE ED02 ADAAG 4.9.4(5) ADA 2010 505.4 CBC 2010 1133B.4.2.1 & CBC 2013 11B-505.4 Priority 4 Severity 4 TBD Contract Work	12	LF	\$75	\$900
						

Slope						
2736	<ul style="list-style-type: none"> As-Built Description: Slope greater than 1:12 (8.3%). As-Built: 11.5% at transition Proposed Solution: Demolish existing and provide new ramp with handrails. 	PCODE EB02 ADAAG 4.8.2 ADA 2010 405.2 CBC 2010 1133B.5.3 CBC 2013 11B-405.2 Priority 1 Severity 3 TBD Contract Work	12	SF	\$50	\$600
						

Top & Bottom Extension at Stairs						
2741	<ul style="list-style-type: none"> As-Built Description: Stair handrail does not extend horizontally 12" minimum beyond top nosing, and one tread width sloped, plus 12" minimum horizontally beyond the bottom nosing. Proposed Solution: Extend stair handrail at top and bottom (cost for each extension piece). 	PCODE ED06 ADAAG 4.9.4(2) ADA 2010 505.10.2; 505.10.3 CBC 2010 1133B.4.2.2 CBC 2013 11B-505.10.2; 11B-505.10.3 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$170	\$170
						


Facility: **HEALTH DEPT. MODULAR**
 Address: 330 CAMPUS DR.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------


Top and Bottom Extension at Ramps

2738	<ul style="list-style-type: none"> <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. <i>As-Built:</i> not horizontal <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). 	PCODE ED05 ADAAG 4.8.5(2) ADA 2010 505.10.1 CBC 2010 1133B.4.2.2 & CBC 2013 11B-505.10.1 Priority 1 Severity 4 TBD Contract Work	1	JOB	\$170	\$170
						

2742	<ul style="list-style-type: none"> <i>As-Built Description:</i> Ramp handrail does not extend horizontally 12" past top and / or bottom of ramp. <i>Proposed Solution:</i> Provide ramp handrail extension (cost for each extension piece). <i>Notes:</i> Cannot extend without obstructing door clearance. 	PCODE ED05REF ADAAG 4.8.5(2) ADA 2010 505.10.1 CBC 2010 1133B.4.2.2 & CBC 2013 11B-505.10.1 Priority 1 Severity 2 TBD Contract Work		REF		
						

3 EOC Main Room




Assistive Listening

2707	<ul style="list-style-type: none"> <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	PCODE GI01E ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work		REF		
						

Facility: **HEALTH DEPT. MODULAR**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Drinking Fountain</u>						
2710	<ul style="list-style-type: none"> <i>As-Built Description:</i> Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping. <i>Proposed Solution:</i> Provide additional fountain or hi-lo combination fountain. 	PCODE IA01A ADAAG 4.1.3(10)(a) ADA 2010 211.1 CBC 2010 1115B.4.6.1 CBC 2013 11B-211.1 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$2,000	\$2,000
						
2711	<ul style="list-style-type: none"> <i>As-Built Description:</i> Drinking fountain water flow less than 4" high; unit in good condition. <i>As-Built:</i> 1" <i>Proposed Solution:</i> Adjust water flow. 	PCODE IA03D ADAAG 4.15.3 ADA 2010 602.6 CBC 2010 1115B.4.6.5 CBC 2013 11B-602.6 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$75	\$75
						
2709	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	PCODE IA04 CBC 2010 1115B.4.6.3; Fig. CBC 2013 11B-602.9 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$3,000	\$3,000
						

Facility: **HEALTH DEPT. MODULAR**


Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 CAMPUS DR.


Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Non-Fixed Desk</u>						
2708	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> 12" deep <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						


4 EOC Main Room

Assistive Listening

2713	<ul style="list-style-type: none"> <i>As-Built Description:</i> No portable assistive listening system provided for small meeting room. <i>Proposed Solution:</i> Share existing portable assistive listening system from other facility if needed. 	PCODE GI01E ADAAG 4.1.3(19)(b) & 4.33.7 ADA 2010 219.1 & 706.1 CBC 2010 1104B.2 CBC 2013 11B-219.2 Priority 3 Severity 3 TBD Contract Work	REF			
------	---	--	-----	--	--	--

5 Unisex Restroom




Lavatory

2724	<ul style="list-style-type: none"> <i>As-Built Description:</i> Clear floor space, 30" x 48" in front of fixture, extending 19" max. under the lavatory, not provided (CA only: Less than 18" from side wall to centerline of lavatory). <i>As-Built:</i> 17" oc <i>Proposed Solution:</i> Relocate existing lavatory. <i>Notes:</i> provide smaller lav so as not to encroach into to WC clear space of 60" 	PCODE WD01A ADAAG 4.19.3 ADA 2010 606.2 CBC 2010 1115B.4.3 CBC 2013 11B-606.2, 11B-606.6 Priority 3 Severity 2 TBD Contract Work	1	JOB	\$900	\$900
						

Facility: **HEALTH DEPT. MODULAR**
 Address: 330 CAMPUS DR.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Water Closet						
2727	<ul style="list-style-type: none"> <i>As-Built Description:</i> Water closet not 17"-18" from near side wall to center line of water closet (2010 ADAS: 16"-18"). <i>As-Built:</i> 18.5" o.c. <i>Proposed Solution:</i> Relocate existing water closet and plumbing, remount with offset closet flange to provide 17"-18" from side wall. 	PCODE WB02C ADAAG Fig. 28 ADA 2010 604.2 CBC 2010 1115B.4.1.1 CBC 2013 11B-604.2 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$500	\$500
						
2720	<ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: In single-accommodation restroom less than 48" in front of water closet provided. <i>As-Built:</i> 32" to trash bin <i>Proposed Solution:</i> Remodel restroom to provide at least 48" in front of water closet. <i>Notes:</i> Relocate 	PCODE WB03AREF CBC 2010 1115B.3.2.1 CBC 2013 11B-604.3.1 Priority 3 Severity 2 TBD Contract Work	REF			
						
2721	<ul style="list-style-type: none"> <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall. <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type, or install sensor flush. 	PCODE WB10 ADAAG 4.16.5 ADA 2010 604.6 CBC 2010 1115B.4.1.5 CBC 2013 11B-604.6 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$500	\$500
						

Total Costs for Part/floor: Interior Ground Floor \$22,748.00

Facility: **HEALTH DEPT. MODULAR**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$22,748.00

Facility: **HEALTH DEPT. MODULAR**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 CAMPUS DR.

Year to be Completed: **TBD**

Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: HEALTH DEPT. MODULAR					\$22,748.00
------------------------	---------------------------------------	--	--	--	--	--------------------

Facility: **WOMENS INFANTS & CHILDREN**
 Address: 330 HARRIS ST.

Area: **Exterior**
 Year to be Completed: **TBD**

Part/Floor: **On-site**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Accessible Parking

Floor or Ground Surfaces

2828	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space has slope greater than 1/4":12" (2%). <i>As-Built:</i> 2.3%-3.5% <i>Proposed Solution:</i> Modify slope at accessible parking space. <i>Notes:</i> <p>2 Acc 1 Van 26 tot</p>	<p>PCODE EA05 ADAAG 4.6.3 ADA 2010 502.4 CBC 2010 1129B.3.3 CBC 2013 11B-502.4 Priority 1 Severity 4 TBD Contract Work</p>	468	SF	\$12	\$5,616
------	--	--	-----	----	------	---------



Parking


2829	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible parking space smaller than 8' wide (CA only: 9' x 18'). <i>As-Built:</i> 17' long <i>Proposed Solution:</i> Modify parking space(s) to create accessible space. 	<p>PCODE EA02AREF ADAAG 4.6.3 ADA 2010 502.2 CBC 2010 1129B.3.1 CBC 2013 11B-502.2 Priority 1 Severity 4 TBD Contract Work</p>				
------	---	--	--	--	--	--



2 POT along Lot to Entrance

Curb Ramp

2830	<ul style="list-style-type: none"> <i>As-Built Description:</i> Cross slope greater than 2% <i>As-Built:</i> 2.4-2.9% <i>Proposed Solution:</i> Demolish existing and provide new curb ramp. 	<p>PCODE EH02F ADAAG 4.8.6 ADA 2010 405.3 CBC 2010 1133B.5.3.1 CBC 2013 11B-406.5.7 Priority 1 Severity 4 TBD Contract Work</p>	1	JOB	\$2,500	\$2,500
------	---	---	---	-----	---------	---------

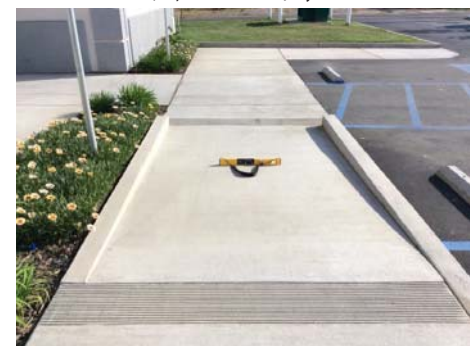

Total Costs for	Part/floor: Exterior	On-site				\$8,116.00
------------------------	-----------------------------	----------------	--	--	--	-------------------

Facility: **WOMENS INFANTS & CHILDREN**

Area: **Exterior**

Part/Floor: **On-site**

Address: 330 HARRIS ST.

Year to be Completed: **TBD**

Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$8,116.00

Facility: **WOMENS INFANTS & CHILDREN**
 Address: 330 HARRIS ST.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 Classroom

Ovens

2776	<ul style="list-style-type: none"> As-Built Description: Oven controls are not on front panel of oven. Proposed Solution: Provide oven with accessible controls. Notes: Controls located over burners. 	PCODE KF22 ADAAG 13.3.4(7) ADA 2010 804.6.5.3 CBC 2010 1111B.5.1 CBC 2013 11B-804.6.5.3 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$800	\$800
------	---	--	---	-----	-------	--------------



Sink


2775	<ul style="list-style-type: none"> As-Built Description: Food waste disposal at kitchen sink protrudes into knee space (recommended: remove equipment if requested as a reasonable accommodation by an employee). Proposed Solution: Remove unit. Notes: Determine if staff only 	PCODE IN06DNT ADAAG 4.24.3 ADA 2010 606.2 CBC 2010 1115B.4.7.1 CBC 2013 11B-606.2 Priority 4 Severity 2 TBD Contract Work	1	JOB	\$300	\$300
------	---	--	---	-----	-------	--------------



3 Staff Offices Near Entrance

Sliding/Folding Door

2780	<ul style="list-style-type: none"> As-Built Description: Sliding or folding door: More than 5 lbs force required to open door. As-Built: 8-11 lbs Proposed Solution: Provide new guides and track. Provide opening and patch. Notes: Sliding doors, adjust & maintain. 	PCODE ID20 ADAAG 4.13.11(2) ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 4 Severity 3 TBD Contract Work	4	JOB	\$750	\$3,000
------	---	---	---	-----	-------	----------------

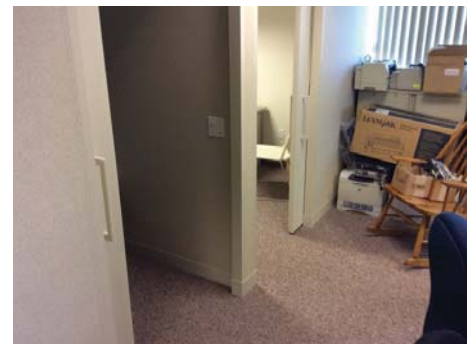


4 Men's Restroom


Facility: **WOMENS INFANTS & CHILDREN**
 Address: 330 HARRIS ST.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Lavatory</u>						
2783	<ul style="list-style-type: none"> <i>As-Built Description:</i> Wheelchair clearance under lavatory apron or lavatory counter front edge less than 29" high. <i>As-Built:</i> 28.5"-28.75" <i>Proposed Solution:</i> Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD03 ADAAG 4.19.2 ADA 2010 606.3 CBC 2010 1115B.4.3.3 CBC 2013 11B-606.3 Priority 3 Severity 3 TBD Contract Work	1	JOB	\$3,400	\$3,400
						

5 Women's Restroom

<u>Door Clearance</u>						
2791	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> Door difficult to open 90 degrees. <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01 ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 3 Severity 4 TBD Contract Work	1	JOB	\$2,600	\$2,600
						


<u>Lavatory</u>						
2792	<ul style="list-style-type: none"> <i>As-Built Description:</i> Wheelchair clearance under lavatory apron or lavatory counter front edge less than 29" high. <i>As-Built:</i> Left 28.75" Right 29" <i>Proposed Solution:</i> Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD03REF ADAAG 4.19.2 ADA 2010 606.3 CBC 2010 1115B.4.3.3 CBC 2013 11B-606.3 Priority 3 Severity 3 TBD Contract Work	REF			
						


6 WIC Lobby

Facility: **WOMENS INFANTS & CHILDREN**
 Address: 330 HARRIS ST.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **1**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
Public Counter						
2804	<ul style="list-style-type: none"> <i>As-Built Description:</i> Service counter (stand-up): Accessible section min. 36" length and 36" max. height (in CA: 28" to 34" high) not provided. <i>As-Built:</i> 40" <i>Proposed Solution:</i> Provide auxiliary shelf, clipboard, or table as equivalent facilitation. <i>Notes:</i> Additional nearby room provided with lower counter desk. Also clipboards provided. 	PCODE IN03 ADAAG 7.2(2) ADA 2010 904.4 CBC 2010 1122B.4 CBC 2013 11B-904.4 Priority 1 Severity 3 TBD Contract Work	1	JOB	\$150	\$150
						

Seating						
2806	<ul style="list-style-type: none"> <i>As-Built Description:</i> Clear floor or ground space (30" x 48") not overlapping with other clear space requirements, is not provided at at least one end of the bench. <i>Proposed Solution:</i> Relocate one chair. 	PCODE NO07NT ADAAG 16.12.4 ADA 2010 903.2 CBC 2010 1132B.1 CBC 2013 11B-903.2 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$50	\$50
						


7 WIC Lobby - Paper Work Office

Non-Fixed Desk						
2811	<ul style="list-style-type: none"> <i>As-Built Description:</i> Accessible non-fixed table or desk (top 28" to 34" high; knee space at least 27" high x 19" deep x 30" wide) not provided. <i>As-Built:</i> 9.75" deep <i>Proposed Solution:</i> Provide table or desk with accessible dimensions when purchasing new furniture. 	PCODE IN02A ADAAG 4.32.3 & .4 ADA 2010 306.1 CBC 2010 1122B.3 & 4 CBC 2013 11B-306.1 & 11B-902.3 Priority 2 Severity 2 TBD Contract Work	1	JOB	\$1,600	\$1,600
						


Facility: **WOMENS INFANTS & CHILDREN**
 Address: 330 HARRIS ST.

Area: **Interior**
 Year to be Completed: **TBD**


Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Sliding/Folding Door</u>						
2812	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sliding or folding door: More than 5 lbs force required to open door. • <i>As-Built:</i> 7 lbs • <i>Proposed Solution:</i> Provide new guides and track. Provide opening and patch. • <i>Notes:</i> Maintain .adjust costs on others 	PCODE ID20 ADAAG 4.13.11(2) ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 4 TBD Contract Work	1	JOB	\$75	\$75
						

8 Break Room

<u>Sliding/Folding Door</u>						
2814	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sliding or folding door: More than 5 lbs force required to open door. • <i>As-Built:</i> 9 lbs • <i>Proposed Solution:</i> Provide new guides and track. Provide opening and patch. 	PCODE ID20 ADAAG 4.13.11(2) ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 4 Severity 4 TBD Contract Work	1	JOB	\$750	\$750
						

9 Patient Room Corridor


<u>Sliding/Folding Door</u>						
2817	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Sliding or folding door: More than 5 lbs force required to open door. • <i>As-Built:</i> 8-10 lbs • <i>Proposed Solution:</i> Provide new guides and track. Provide opening and patch. • <i>Notes:</i> Adjust 	PCODE ID20 ADAAG 4.13.11(2) ADA 2010 404.2.9 CBC 2010 1133B.2.5 CBC 2013 11B-404.2.9 Priority 2 Severity 4 TBD Contract Work	8	JOB	\$750	\$6,000
						

10 Breastfeeding Room

Facility: **WOMENS INFANTS & CHILDREN**
 Address: 330 HARRIS ST.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Carpet</u>						
2821	<ul style="list-style-type: none"> <i>As-Built Description:</i> Carpet or carpet tile is not securely attached to the floor surface. <i>Proposed Solution:</i> Attach carpet or carpet tile securely to floor. <i>Notes:</i> Attach corners 	PCODE IM01A ADAAG 4.5.3 ADA 2010 302.2 CBC 2010 1124B.3 CBC 2013 11B-302.2 Priority 2 Severity 3 TBD Contract Work	10	SF	\$4	\$40
						

Total Costs for	Part/floor: Interior	Ground Floor					\$18,765.00
------------------------	-----------------------------	---------------------	--	--	--	--	--------------------

Facility: **WOMENS INFANTS & CHILDREN**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 HARRIS ST.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Interior

\$18,765.00

Facility: **WOMENS INFANTS & CHILDREN**

Area: **Interior**

Part/Floor: **Ground Floor**

Address: 330 HARRIS ST.

Year to be Completed: **TBD**

Priority No: **2**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for	Facility: WOMENS INFANTS & CHILDREN					\$26,881.00
------------------------	--	--	--	--	--	--------------------

Facility: **HANFORD LIBRARY**

Area: **Exterior**

Part/Floor: **On-site**

Address: 401 N. DOUTY ST.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

2 POT from Two Accessible Spaces to Back Entrance

Top & Bottom Extension at Stairs

3118

• *As-Built Description:*

Stair handrail does not extend horizontally 12" minimum beyond top nosing, and one tread width sloped, plus 12" minimum horizontally beyond the bottom nosing.

• *Proposed Solution:*

Extend stair handrail at top and bottom (cost for each extension piece).

PCODE ED06

ADAAG 4.9.4(2)

ADA 2010 505.10.2; 505.10.3

CBC 2010 1133B.4.2.2

CBC 2013 11B-505.10.2; 11B-505.10.3

Priority 4

Severity 2

TBD Contract Work

1 JOB \$170 \$170



Total Costs for	Part/floor: Exterior	On-site	\$170.00
------------------------	-----------------------------	----------------	-----------------

Facility: **HANFORD LIBRARY**

Area: **Exterior**

Part/Floor: **On-site**

Address: 401 N. DOUTY ST.

Year to be Completed: **TBD**

Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Total Costs for

Area: Exterior

\$170.00

Facility: **HANFORD LIBRARY**
 Address: 401 N. DOUTY ST.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Basement**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Basement Storage - Staff Area

Drinking Fountain

- 3087
- *As-Built Description:*
 Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain).
 - *Proposed Solution:*
 Provide new, accessible fountain.

PCODE **IA02**
 ADAAG **4.15.5(1)**
 ADA 2010 **602.2**
 CBC 2010 **1115B.4.6.2**
 CBC 2013 **11B-602.2**
 Priority **4**
 Severity **2**
TBD Contract Work

1 JOB \$3,200 **\$3,200**



Sink

- 3086
- *As-Built Description:*
 Sink does not have knee space min. 27" high x 19" deep x 30" wide.
 - *As-Built:* Top 36" AFF
 - *Proposed Solution:*
 Remodel sink cabinet.

PCODE **IN06A**
 ADAAG **4.24.3**
 ADA 2010 **606.2**
 CBC 2010 **1115B.4.7.1**
 CBC 2013 **11B-606.2**
 Priority **4**
 Severity **2**
TBD Contract Work

1 JOB \$1,750 **\$1,750**



Total Costs for	Part/floor: Interior	Basement	\$4,950.00
------------------------	-----------------------------	-----------------	-------------------

Facility: **HANFORD LIBRARY**
 Address: 401 N. DOUTY ST.


Area: **Interior**
 Year to be Completed: **TBD**


Part/Floor: **Ground Floor**
 Priority No: **3**


Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

1 Main Entrances & Lobby

Drinking Fountain

<p>2974</p> <ul style="list-style-type: none"> <i>As-Built Description:</i> Where only one drinking fountain is provided per floor: Fountain is not accessible to individuals who use wheelchairs, or to those who have difficulty bending or stooping. <i>Proposed Solution:</i> Provide additional fountain or hi-lo combination fountain. 	<p>PCODE IA01A ADAAG 4.1.3(10)(a) ADA 2010 211.1 CBC 2010 1115B.4.6.1 CBC 2013 11B-211.1 Priority 3 Severity 2 TBD Contract Work</p>	<p>1 JOB \$2,000 \$2,000</p>	
--	---	-------------------------------------	---

<p>2973</p> <ul style="list-style-type: none"> <i>As-Built Description:</i> Wall- and post-mounted cantilevered units: Knee space not provided at drinking fountain (27" high, 8" deep, 30" wide from front of drinking fountain). <i>Proposed Solution:</i> Provide new, accessible fountain. 	<p>PCODE IA02 ADAAG 4.15.5(1) ADA 2010 602.2 CBC 2010 1115B.4.6.2 CBC 2013 11B-602.2 Priority 3 Severity 2 TBD Contract Work</p>	<p>1 JOB \$3,200 \$3,200</p>	
--	---	-------------------------------------	--

<p>2975</p> <ul style="list-style-type: none"> <i>As-Built Description:</i> CA only: Drinking fountain not located in an alcove (min. 32" wide x 18" deep) or otherwise encroaches into pedestrian way. <i>Proposed Solution:</i> Provide new alcove for drinking fountain, or, if unreasonable hardship is determined, provide wing walls or cane-detectable railings on each side of the drinking fountain. The wings must project out from the supporting wall at least as far as the drinking fountain to within 6" of the surface of the circulation path, but cannot reduce the required clear width of the adjacent accessible route. 	<p>PCODE IA04 CBC 2010 1115B.4.6.3; Fig. CBC 2013 11B-602.9 Priority 3 Severity 2 TBD Contract Work</p>	<p>1 JOB \$3,000 \$3,000</p>	
--	--	-------------------------------------	---

5 Women's Restroom

Facility: **HANFORD LIBRARY**
 Address: 401 N. DOUTY ST.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Door Clearance

- 3002
- *As-Built Description:*
 Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open.
 - *As-Built:* 29"
 - *Proposed Solution:*
 Provide new, larger door and frame with new accessible hardware.

PCODE ID01REF
 ADAAG 4.13.5
 ADA 2010 404.2.3
 CBC 2010 1133B.1.1.1.1
 CBC 2013 11B-404.2.3
 Priority 3
 Severity 3
 TBD Contract Work

REF



Door Swing

- 3001
- *As-Built Description:*
 Latch approach: At push side, door does not have clear and level maneuvering space measuring door width plus 24" (starting at hinge) x 42", or 48" if door has closer (CA only: door width plus 24" x 44").
 - *As-Built:* 36"
 - *Proposed Solution:*
 Provide relocated new door and frame; remodel walls as needed.

PCODE ID28BREF
 ADAAG Fig. 25(c)
 ADA 2010 404.2.4
 CBC 2010 11B-26A(c)
 CBC 2013 11B-404.2.4
 Priority 3
 Severity 3
 TBD Contract Work

REF



Grab Bars

- 3012
- *As-Built Description:*
 Grab bars not provided or are not code compliant.
 - *Proposed Solution:*
 Provide accessible grab bars.

PCODE WB07REF
 ADAAG 4.17.6
 ADA 2010 604.5
 CBC 2010 1115B.4.1.3
 CBC 2013 11B-604.5
 Priority 3
 Severity 3
 TBD Contract Work


REF





Facility: **HANFORD LIBRARY**
 Address: 401 N. DOUTY ST.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Lavatory</u>						
3008	<ul style="list-style-type: none"> <i>As-Built Description:</i> Knee clearance 27" min. high starting 8" back from the front edge of the lavatory towards the wall is not provided. <i>As-Built:</i> 24.5" <i>Proposed Solution:</i> Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD04REF ADAAG Fig. 31 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-306.3.3 Priority 3 Severity 2 TBD Contract Work				
						REF
						


<u>Restroom</u>						
3005	<ul style="list-style-type: none"> <i>As-Built Description:</i> Multiple accommodation restroom not accessible; multiple compliance violations. <i>Proposed Solution:</i> Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens). 	PCODE WA01A ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.1 CBC 2013 11B-603 Priority 3 Severity 1 TBD Contract Work	1	JOB	\$35,000	\$35,000
						


<u>Toilet Stall</u>						
3010	<ul style="list-style-type: none"> <i>As-Built Description:</i> Toilet stall less than 60" wide. <i>As-Built:</i> 31.5" <i>Proposed Solution:</i> Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended). 	PCODE WB06REF ADAAG 4.17.3 ADA 2010 604.8.1.1 CBC 2010 1115B.3.1.4.1 CBC 2013 11B-604.8.1.1 Priority 3 Severity 1 TBD Contract Work				
						REF
						

Facility: **HANFORD LIBRARY**
 Address: 401 N. DOUTY ST.


Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Turning Space</u>						
3004	<ul style="list-style-type: none"> <i>As-Built Description:</i> Wheelchair clearance: Clear space, floor to 27" high with a diameter of 60", not provided (space 56" x 63" acceptable). <i>As-Built:</i> 46.5" <i>Proposed Solution:</i> Provide wheelchair clearance space in restroom. 	PCODE WC01REF ADAAG 4.22.3 ADA 2010 603.2.1 CBC 2010 1115B.3.2 CBC 2013 11B-603.2.1; 11B-304.3 Priority 3 Severity 2 TBD Contract Work				REF
						

<u>Water Closet</u>						
3011	<ul style="list-style-type: none"> <i>As-Built Description:</i> Flush Control: Operating handle not mounted toward wide side of stall. <i>Proposed Solution:</i> Replace flush control with properly mounted accessible type, or install sensor flush. 	PCODE WB10REF ADAAG 4.16.5 ADA 2010 604.6 CBC 2010 1115B.4.1.5 CBC 2013 11B-604.6 Priority 3 Severity 3 TBD Contract Work				REF
						

6 Men's Restroom

<u>Door Clearance</u>						
3021	<ul style="list-style-type: none"> <i>As-Built Description:</i> Door on accessible route has less than 32" clear and 80" (78" min. to closer if provided) opening width when 90° open. <i>As-Built:</i> 29" <i>Proposed Solution:</i> Provide new, larger door and frame with new accessible hardware. 	PCODE ID01REF ADAAG 4.13.5 ADA 2010 404.2.3 CBC 2010 1133B.1.1.1.1 CBC 2013 11B-404.2.3 Priority 3 Severity 3 TBD Contract Work				REF
						

Facility: **HANFORD LIBRARY**
 Address: 401 N. DOUTY ST.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Door Swing

- 3028
- *As-Built Description:*
 Front approach: At pull side, door does not have clear and level maneuvering space measuring door width plus 18" x 60".
 - *As-Built:* 39" to stall
 - *Proposed Solution:*
 Remodel as needed.

PCODE ID23BREF
 ADAAG Fig. 25(a)
 ADA 2010 404.2.4
 CBC 2010 11B-26A(a)
 CBC 2013 11B-404.2.4
 Priority 3
 Severity 2
 TBD Contract Work

REF



- 3020
- *As-Built Description:*
 Latch approach: At push side, door does not have clear and level maneuvering space measuring door width plus 24" (starting at hinge) x 42", or 48" if door has closer (CA only: door width plus 24" x 44").
 - *As-Built:* 36"
 - *Proposed Solution:*
 Provide relocated new door and frame; remodel walls as needed.

PCODE ID28BREF
 ADAAG Fig. 25(c)
 ADA 2010 404.2.4
 CBC 2010 11B-26A(c)
 CBC 2013 11B-404.2.4
 Priority 3
 Severity 3
 TBD Contract Work

REF



Grab Bars

- 3030
- *As-Built Description:*
 Grab bars not provided or are not code compliant.
 - *Proposed Solution:*
 Provide accessible grab bars.

PCODE WB07REF
 ADAAG 4.17.6
 ADA 2010 604.5
 CBC 2010 1115B.4.1.3
 CBC 2013 11B-604.5
 Priority 3
 Severity 3
 TBD Contract Work




REF



Facility: **HANFORD LIBRARY**
 Address: 401 N. DOUTY ST.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

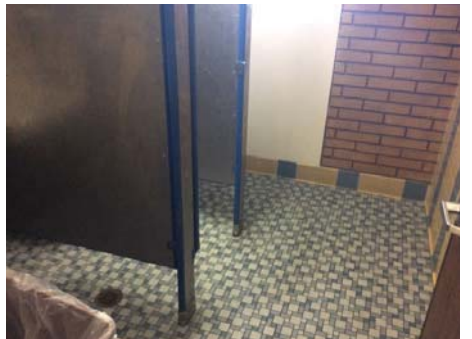Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Lavatory</u>						
3022	<ul style="list-style-type: none"> <i>As-Built Description:</i> Knee clearance 27" min. high starting 8" back from the front edge of the lavatory towards the wall is not provided. <i>As-Built:</i> 25" <i>Proposed Solution:</i> Provide new accessible lavatory. Remodel restroom as needed. 	PCODE WD04REF ADAAG Fig. 31 ADA 2010 606.3 CBC 2010 1115B.4.3 CBC 2013 11B-306.3.3 Priority 3 Severity 2 TBD Contract Work				
						REF
						
3023	<ul style="list-style-type: none"> <i>As-Built Description:</i> Lavatory: Accessible faucet (lever-operated, push-type or electronically controlled) not provided at otherwise accessible lavatory. <i>Proposed Solution:</i> Provide accessible faucet at accessible lavatory. 	PCODE WD06REF ADAAG 4.19.5 ADA 2010 606.4 CBC 2010 1115B.4.3 CBC 2013 11B-606.4 Priority 3 Severity 3 TBD Contract Work				
						REF
						
<u>Restroom</u>						
3017	<ul style="list-style-type: none"> <i>As-Built Description:</i> Multiple accommodation restroom not accessible; multiple compliance violations. <i>Proposed Solution:</i> Remodel area to provide accessible restroom with one accessible stall, lavatory (and one urinal at Mens). 	PCODE WA01A ADAAG 4.22 ADA 2010 603 CBC 2010 1115B.3.1 CBC 2013 11B-603 Priority 3 Severity 1 TBD Contract Work	1	JOB	\$35,000	\$35,000
						

Facility: **HANFORD LIBRARY**
 Address: 401 N. DOUTY ST.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
-------------------	--	-------------------------	-----	------	------	-------

Toilet Stall

- 3029
- *As-Built Description:*
Toilet stall less than 60" wide.
 - *As-Built:* 31"
 - *Proposed Solution:*
Provide new accessible stall (alternate stalls 36" x 69" or 48" x 69" not recommended).

PCODE **WB06REF**
 ADAAG **4.17.3**
 ADA 2010 **604.8.1.1**
 CBC 2010 **1115B.3.1.4.1**
 CBC 2013 **11B-604.8.1.1**
 Priority **3**
 Severity **1**
 TBD Contract Work

REF



Turning Space

- 3027
- *As-Built Description:*
Wheelchair clearance: Clear space, floor to 27" high with a diameter of 60", not provided (space 56" x 63" acceptable).
 - *As-Built:* 44"
 - *Proposed Solution:*
Provide wheelchair clearance space in restroom.

PCODE **WC01**
 ADAAG **4.22.3**
 ADA 2010 **603.2.1**
 CBC 2010 **1115B.3.1**
 CBC 2013 **11B-603.2.1; 11B-304.3**
 Priority **3**
 Severity **2**
 TBD Contract Work

1 JOB \$1,190 **\$1,190**



Urinal

- 3031
- *As-Built Description:*
CA only: Front of rim projects less than 13.5" from wall.
 - *As-Built:* 12.5"
 - *Proposed Solution:*
Provide accessible urinal. Remodel restroom as needed.

PCODE **WE01REF**
 ADA 2010 **605.2**
 CBC 2010 **1115B.4.2.1**
 CBC 2013 **11B-605.2**
 Priority **3**
 Severity **4**
 TBD Contract Work



REF



Facility: **HANFORD LIBRARY**
 Address: 401 N. DOUTY ST.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **3**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
3032	<ul style="list-style-type: none"> • <i>As-Built Description:</i> Fixture mounted with rim more than 17" above floor. • <i>As-Built:</i> 24" • <i>Proposed Solution:</i> Provide accessible urinal. Remodel restroom as needed. 	PCODE WE02REF ADAAG 4.18.2 ADA 2010 605.2 CBC 2010 1115B.4.2.1 CBC 2013 11B-605.2 Priority 3 Severity 2 TBD Contract Work				
						REF
						
3033	<ul style="list-style-type: none"> • <i>As-Built Description:</i> 36" wide clearance in front of accessible urinal not provided when walls or partitions project more than 24" from the front edge of 30" x 48" clear space. • <i>As-Built:</i> 31" • <i>Proposed Solution:</i> Provide 36" clear floor space in front of accessible urinal. Remodel restroom as needed. 	PCODE WE04AREF ADAAG 4.18.3 ADA 2010 605.3 CBC 2010 1115B.4.2.3 CBC 2013 11B-605.3 Priority 3 Severity 2 TBD Contract Work				
						REF
						

7 Staff Office

Sink

3034

- *As-Built Description:*
Sink does not have knee space min. 27" high x 19" deep x 30" wide.
- *Proposed Solution:*
Remodel sink cabinet.
- **Notes:**
Staff Only

PCODE **IN06AREF**
 ADAAG **4.24.3**
 ADA 2010 **606.2**
 CBC 2010 **1115B.4.7.1**
 CBC 2013 **11B-606.2**
 Priority **4**
 Severity **2**
 TBD **Contract Work**

REF





8 Central Stairs


Facility: **HANFORD LIBRARY**
 Address: 401 N. DOUTY ST.

Area: **Interior**
 Year to be Completed: **TBD**

Part/Floor: **Ground Floor**
 Priority No: **4**

Item No. and Name	Existing Architectural Barrier and Proposed Solution	Codes / Mitigation Info	Qty	Unit	Cost	Total
<u>Handrail</u>						
3039	<ul style="list-style-type: none"> <i>As-Built Description:</i> Open guards does not have balusters or ornamental patterns such that a 4-inch-diameter (102 mm) sphere cannot pass through any opening. <i>As-Built:</i> 13" <i>Proposed Solution:</i> Provide new guards which do not allow passage of an 4 inch sphere at any opening. 	PCODE ED08A ADA 2010 405.9.2 CBC 2010 1013.3 CBC 2013 11B-405.9.2 Priority 4 Severity 2 TBD Contract Work	40	LF	\$120	\$4,800
						

<u>Stairway</u>						
3038	<ul style="list-style-type: none"> <i>As-Built Description:</i> The leading 2" of the tread does not have visual contrast of dark-on-light or light-on-dark from the remainder of the tread. <i>Proposed Solution:</i> Provide 2" wide contrasting color strip 1" max. from nosing on top & bottom treads when altering area. 	PCODE I102B ADA 2010 504.4 CBC 2010 1133B.4.4 CBC 2013 11B-504.4.1 Priority 4 Severity 3 TBD Contract Work	32	LF	\$14	\$448
						
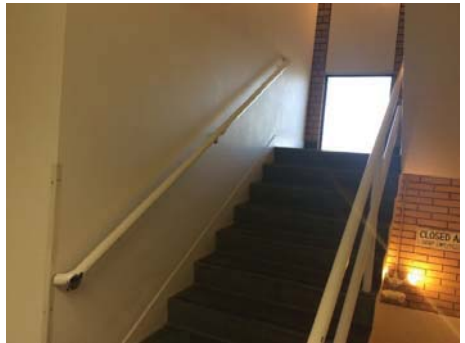
<u>Top & Bottom Extension at Stairs</u>						
3040	<ul style="list-style-type: none"> <i>As-Built Description:</i> Stair handrail does not extend horizontally 12" minimum beyond top nosing, and one tread width sloped, plus 12" minimum horizontally beyond the bottom nosing. <i>Proposed Solution:</i> Extend stair handrail at top and bottom (cost for each extension piece). 	PCODE ED06 ADAAG 4.9.4(2) ADA 2010 505.10.2; 505.10.3 CBC 2010 1133B.4.2.2 CBC 2013 11B-505.10.2; 11B-505.10.3 Priority 4 Severity 2 TBD Contract Work	10	JOB	\$170	\$1,700
						

10 Staff Area